

Alert number 0458/06



Notifying country Hungary

Product category Toys

Type Consumer

Product

Brand Unknown

Type / number of model 30998ABCD

Barcode 5 97421 718015

Product description Shooting blow-pipe

Risk type Choking

Risk description This product poses a risk of choking. During testing, the suction cup easily comes off the projectiles. The height of the suction cup is 13 mm and the closing element of the blow pipe is smaller than required. These 'small parts' may be easily swallowed and cause choking if the child puts them into his mouth. The toy does not comply with the Toys Directive and the European standard for toys.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Sales ban and withdrawal from the market ordered by the authority.

Other

Alert number 0457/06

Notifying country Greece

Product category Motor vehicles

Type Consumer

Product Passenger car

Name Toyota Corolla Verso

Brand Toyota

EC-type approval/model Corolla Verso

Risk type Injuries

Risk description These cars pose a risk of injuries. Due to incorrect programming of the electronic control unit (ECU), the seat-belt pre-tensioner for the right side of vehicle is disabled instead of the passenger's airbag in the affected vehicles when the "airbag manual on-off system" is turned off. This poses a risk of injuries for the co-passenger due to non-function of the seat-belt pre-tensioner.

Country of origin Türkiye

Measures taken by economic operators Other : Voluntary corrective actions taken by the importer.
Other

| | |
|--------------------------------------|---|
| Alert number | <u>0456/06</u> |
| Notifying country | Belgium |
| Product category | Recreational crafts |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Type / number of model | 350 MAG, 350 MAG MPI, 5.00 MPI, MPI Horizon, MW6.2 MPI Horizon |
| Barcode | Alpha Drive: OM300000 to OW387854, Bravo Drive: OM300000 to OW386609 |
| Product description | Petrol multi-port fuel injected boat engines BRUNSWICK Mercruiser |
| Risk type | Fire |
| Risk description | An incorrectly routed wire could cause the boat engine to malfunction, which, in turn, could give rise to a fire. |
| Country of origin | United States |
| Measures taken by economic operators | Other : Voluntary corrective actions taken by the producer. Other |

Alert number 0455/06



| | |
|--------------------------------------|--|
| Notifying country | Spain |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | Passenger car |
| Brand | Land Rover |
| EC-type approval/model | DISCOVERY 3, RANGE ROVER, RANGE ROVER SPORT |
| Risk type | Injuries |
| Risk description | The gearbox may fail to lock when the gearshift lever is put into the parking position "P", which could lead to the vehicle moving if the handbrake is not activated. In the case of the Discovery 3, in addition to this defect, the vehicle is equipped with xenon headlights without the system of automatic dynamic height control that is required by law. The rolling away of the vehicle when in the parking position may lead to collisions with other vehicles or pedestrians and cause traffic accidents. The lack of automatic dynamic height control for the xenon headlights of the Discovery 3 could reduce visibility for the driver or blind other vehicles, thereby increasing the risk of accidents. |
| Country of origin | United Kingdom |
| Measures taken by economic operators | Other : Voluntary corrective actions taken by the importer. Other |

Alert number 0454/06



Notifying country Germany

Product category Other

Type Consumer

Product

Brand Unknown

Product description Heating appliance TrumaType/number of model: Heating systems, authorisation numbers:e1*2001/56*2004/78*0146e1*2001/56*2004/78*0147National authorisation number S 300; Trumatic C 3402 (E); Trumatic C 4002 (E), Trumatic C 6002 (E) and Trumatic C 6002 EH,Factory numbers: C 16 255 001 to 17 159 000C EH.... 15 329 001 to 17 159 000,

Risk type Fire
Injuries

Risk description In pure hot water mode (summer mode), it is possible that the heating system may overheat, which in extreme cases may lead to a fire in the vehicle interior. A possible malfunction of the heating system can lead to the overheating of casing parts. In extreme cases, this may lead to a local fire. The thermal overload can lead to a noticeable smell developing. The manufacturer recommends not using the heating system until it has been examined.

Country of origin Germany

Measures taken by economic operators

Other : Voluntary corrective actions taken by the importer.
Other



| | |
|--|--|
| Alert number | <u>0453/06</u> |
| Notifying country | Norway |
| Product category | Gas appliances and components |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Product description | Camping gas stove ProvidusType/number of model: models FG 100 and BG 1000. |
| Risk type | Injuries |
| Risk description | The product poses a risk of explosion because there is a risk of gas leakage between the gas canister and the burner. The gas can then escape through the top of the plastic house and be ignited by the burner. This can cause the plastic house to soften and the burner to start tilting to one side which further can lead to ignition of a rather large quantity of gas. The product does not comply with the Gas Appliance Directive and the relevant European standard EN 521. At least four accidents have been reported, including accidents that caused personal injury and total damage by fire to a house. |
| Country of origin | Italy |
| Measures ordered by public authorities | Other : Sales ban and withdrawal from the market ordered by the authority. Other |

Alert number 0452/06

Notifying country Ireland

Product category Motor vehicles

Type Consumer

Product

Brand Unknown

Product description Passenger car Daimler Chrysler


Risk type Injuries

Risk description The product poses a risk of injury caused by vehicle impact because testing revealed that parking brake may not engage or fails to hold the vehicle.

Country of origin United States

Measures taken by economic operators Other : Voluntary corrective actions.
Other

Alert number 0451/06

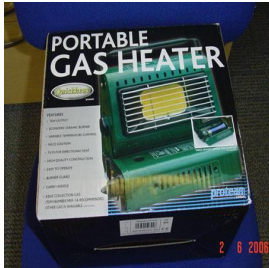

| | |
|--------------------------------------|---|
| Notifying country | United Kingdom |
| Product category | Gas appliances and components |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Type / number of model | CA1003 |
| Product description | Portable Gas Heater Proteam (Quickheat) |
| Risk type | Injuries |
| Risk description | There is evidence of failure of stops designed to prevent over rotation of the burner head. Over rotation of the burner head may lead to damage to the gas supply capillary thereby causing a risk of explosion. In addition, failure to provide safety critical information required by EN521 and the Gas Appliances (Safety) Regulation prevents the purchaser from being able to make safe use of the appliance. |
| Country of origin | People's Republic of China |
| Measures taken by economic operators | Other : Voluntary corrective actions taken by the importer. Other |

Alert number

0450/06



Notifying country The Netherlands

Product category Chemical products

Type Consumer

Product

Brand Unknown

Product description Bike repair set SedioType/number of model: Article nr. SG-GC015 EAN code 4260047621873.

Risk type Chemical

Risk description This product poses a carcinogenic risk to consumers because the rubber solution contains 64.9 % benzene and 14.4 % toluene. Benzene is classified as carcinogenic category I, mutagenic category II and toxic under Directive 76/769/EEC. Toluene is classified as carcinogenic category III, harmful and highly inflammable. In addition, the labelling is incorrect and incomplete. Consumers have skin contact with the product and inhale the vapour.

Country of origin Germany

Measures taken by economic operators Other : Voluntary withdrawal from the market.
Other

Alert number 0449/06



| | |
|--------------------------------------|---|
| Notifying country | Slovakia |
| Product category | Clothing, textiles and fashion items |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Product description | Children's briefs New Line |
| Risk type | Chemical |
| Risk description | This product poses a chemical risk because it contains carcinogenic aromatic amine benzidine prohibited under Directive 76/769/EEC at levels of 60 mg.kg/l. |
| Country of origin | Thailand |
| Measures taken by economic operators | Other : Voluntary withdrawal from the market and warning of consumers by the distributor. Other |

Alert number 0448/06



Notifying country Spain

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Product description Hairdryer MompotoType/number of model: Model: SSRH 1238, Barcode: 84 35019763462.

Risk type Electric shock
Fire

Risk description This product poses a risk of electric shock and fire because: - it is possible to touch live parts with the test finger; - flames came out of the appliance during the tests and the hairdryer failed to withstand the subsequent dielectric strength test: - it is possible to remove parts acting as additional insulation without damaging them; - casing used for additional insulation is not appropriately or securely set in place; - the appliance does not attain the specified voltage value of 230 volts, there is no Class II symbol and not all the mandatory warnings are given. This product does not comply with the Low Voltage Directive and the relevant European Standards.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0447/06



| | |
|--------------------------------------|---|
| Notifying country | Spain |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Product description | Passenger car Land Rover 4x4Type/number of model: Range Rover Sport LS |
| Risk type | Injuries |
| Risk description | The clip on the front left wheel balance weight may chafe against the brake hose, ABS sensor or brake pad wear sensor. If any of these situations occurs, the driver will have to press down further on the brake pedal, increasing the braking distance and the brake failure warning light or brake pad wear warning light on the dashboard will come on. If braking effectiveness is reduced, this could cause road accidents, irrespective of whether the driver is alerted by the brake failure warning light or brake pad wear sensor light |
| Country of origin | United Kingdom |
| Measures taken by economic operators | Other : Voluntary corrective actions taken by the importer. Other |

Alert number 0445/06



Notifying country The Netherlands

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Type / number of model L 6 - 25A

Product description Circuit-breaker FSE Kontakt.

Risk type Electric shock

Risk description In case of overload of the home electrical installation the circuit breaker can cause a direct risk of electric shock for a user. Late opening or not opening at all of the breaker contacts can cause overheating and/or fire. The circuit breaker can also become damaged, causing live parts to become accessible.

Country of origin Poland

Measures taken by economic operators Other : Voluntary withdrawal from the market.
Other

Alert number 0444/06



| | |
|--------------------------------------|---|
| Notifying country | United Kingdom |
| Product category | Decorative articles |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Type / number of model | SR10, SR14, SR21, SR30, SR36, SR37 (not marked) - in two principle designs |
| Product description | Oil lamps. Decorative Glass Ornament Oil Lamp Holders. |
| Risk type | Fire |
| Risk description | This product poses a risk of fire because: - The oil lamps overturn when placed on a platform inclined at 20 degrees. - No wick guard is fitted to prevent access to the wick by small children. - The filler opening does not require two independent movements to be opened. - The lamp leaked oil when under test. - Instructions are not provided. These products do not comply with the European Standard on decorative oil lamps. |
| Country of origin | Poland |
| Measures taken by economic operators | Other : Voluntary withdrawal from the market by the importer. Other |

Alert number 0443/06



Notifying country United Kingdom

Product category Cosmetics

Type Consumer

Product

Brand Unknown

Product description Tanning intensifiers and bronzers 'Swedish Beauty'. Type/number of model: All batch codes are affected. Bar codes are: 05440267002, 054402670019, 05440267071, 054402670026, 054402670057, 054402670033 & 054402650547

Risk type Chemical

Risk description These products pose a chemical risk because they contain vitamin D3 (cholecalciferol) which is prohibited in cosmetics under the Cosmetics Directive.

Country of origin United States

Measures ordered by public authorities Other : Temporary sales ban ordered by the authority
Other

Measures taken by economic operators Other : Voluntary recall from consumers by the importer
Other