


Alert number 0102/06

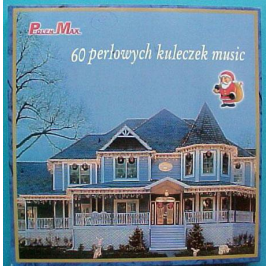

Notifying country Hungary

Product category Lighting chains

Type Consumer

Product

Brand ing chain "Polen Max" consisting of 60 series-parallel connected globular incandescent lamps with resistor bridge.

Product description Lighting chain "Polen Max" consisting of 60 series-parallel connected globular incandescent lamps with resistor bridge. Name: "60 perłowych kuleczek music". Type/model: Unknown.

Risk type Electric shock
Fire

Risk description This product presents the risk of electric shock because: the insulation of the wire is poor, the cross section area of the wires is less than required, the cord anchorage is missing, the cable inlet of the flashing/sound generating unit is not rounded, the plug is non-standardized and the construction of the plug makes it possible to insert the plug partially into the socket. The plastic parts of the lamp holders do not resist to ignition sufficiently, so it may entail risk of fire. This product does not comply with the LVD Directive and the European Standard.

Country of origin People's Republic of China

Measures ordered by public Other : Withdrawal from the market and recall ordered by

authorities authority.
Other



Alert number 0101/06



Notifying country Hungary

Product category Lighting chains

Type Consumer

Product

Brand Unknown

Product description Lighting chain "Serie De 40 Campanas Musical" consisting of 38 replaceable series-connected Type/model: Unknown.


Risk type Electric shock
Fire

Risk description This product presents the risk of electric shock because: the cross section area of the wires between the lamp holders and the sound-generating unit is less than required, the cord anchorage is missing, the cable inlet of the flashing unit is rounded and the plug is non-standardized. This product does not comply with the LVD Directive and the European Standard.

Country of origin Unknown

Measures ordered by public authorities Other : Withdrawal from the market and recall ordered by authority.
Other

Alert number 0100/06

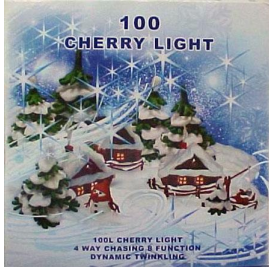

Notifying country Hungary

Product category Lighting chains

Type Consumer

Product Lighting chain

Name 1. "100 Cherry Light", 2. "144 RICE LIGHTS 8 FUNCTION".

Brand Unknown

Type / number of model Type/model: 1. 100L (origin: Unknown); 2. Unknown (origin: China).

Risk type Electric shock

Risk description This product presents risk of electric shock because the cross section area of the core is less than required, the cord anchorage is missing, the cable inlet of the flashing unit is rounded and the insulation is not adequate. This product does not comply with the LVD Directive and the European Standard.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market and recall ordered by authority.
Other

Alert number 0099/06



Notifying country Hungary

Product category Lighting chains

Type Consumer

Product

Brand Unknown

Product description Lighting chain with 100 non-replaceable miniature incandescent lamps and an 8-function flashing unit. Type/model: Unknown.

Risk type Electric shock

Risk description This product presents the risk of electric shock because: the cross section area of the core is less than required, the cord anchorage is missing, the cable inlet of the flashing unit is rounded and there is no protection against water ingress. This product does not comply with the LVD Directive and the European Standard.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market and recall ordered by authority.
Other

Alert number 0098/06



Notifying country Hungary

Product category Lighting chains

Type Consumer

Product

Brand Unknown

Product description Lighting chain with plastic frame and paperback in a form of a Christmas tree with 120 replaceable incandescent lamps and a flashing unit. Type/model: Unknown.

Risk type Electric shock
Fire

Risk description This product presents the risk of electric shock because the cross section area of the core is less than required, the insulation is of poor quality, the cord anchorage is missing and the plug is non-standardized and the cable inlet of the flashing unit is rounded. The resistance to ignition of the plastic parts of the lamp holders is not adequate, there is a risk of fire. This product does not comply with the LVD Directive and the European Standard.

Country of origin Unknown

Measures ordered by public authorities Other : Withdrawal from the market and recall ordered by authority.
Other

Alert number 0097/06



Notifying country Hungary

Product category Lighting chains

Type Consumer

Product

Brand Unknown

Product description Lighting chain with 144 non-replaceable miniature incandescent lamps and an 8-function flashing unit. Type/model: TL-144-6M.

Risk type Electric shock

Risk description The cross section area of the core is less than required, the cord anchorage is missing and the plug is non-standardized, thus electric shock may occur. This product does not comply with the LVD Directive and the European Standard.

Country of origin Unknown

Measures ordered by public authorities Other : Withdrawal from the market and recall ordered by authority.
Other

Alert number 0096/06



Notifying country Lithuania

Product category Toys

Type Consumer

Product

Brand helicopter "Modern Aircraft".

Product description Toy - helicopter "Modern Aircraft". Name: Toy - helicopter (according to CR 14379 category N). Type/model: TO561-H3078, price: 4,50 Lt. Bar code: 59089453357282.

Risk type Injuries

Risk description Helicopters wings do not have protective ring around the perimeter. Without such protective ring helicopter presents risk of injury. This product does not comply with the Toys Directive and the European Standard (Part 1, 4.17.2.b).

Country of origin People's Republic of China

Measures ordered by public authorities Other : Placing on the market banned by authority.
Other

Alert number 0095/06

Notifying country Sweden

Product category Toys

Type Consumer

Product

Brand Unknown

Product description Toy Crayons "Junior Art" Type/model: 969684-1932.
Description: 24 pcs oil pastel.

Risk type Chemical

Risk description High level of lead in crayons. The amount of lead was 22150 mg/kg while the limit value is 90 mg/kg. The ingestion of paint containing lead can result in particular in brain damage. This product does not comply with the Toys Directive and the European Standard (Part 3 - Migration of certain elements).

Country of origin People's Republic of China

Measures taken by economic operators Other : Importer voluntarily has withdrawn the product from the market and stopped placing it on the market.
Other

Alert number 0094/06



Notifying country Germany

Product category Hand tools

Type Consumer

Product

Brand Unknown

Product description Axe / hatchet "AM/63" (600g). Type/model: Axe / hatchet CK9/000070, EAN 8711295574290.

Risk type Injuries

Risk description There is a risk of injury because the axe was made from brittle material (cast iron, very high tramp materials content / chilled iron). The same risk arises from the inadequate fastening of the handle, which can become loose (hard adhesive, no permanently elastic connection, no positive locking means). There is thus a hazard even if the metal withstands brittle fracture. The material does not satisfy the quality requirements of DIN 7287.

Country of origin Unknown

Measures ordered by public authorities Other : Withdrawal from the market by dealer ordered by authority.
Other

Alert number 0093/06



Notifying country United Kingdom

Product category Lighters

Type Consumer

Product

Brand Unknown

Product description Novelty lighters. Brand: Unknown. Type/model: Lighters in various shapes and forms with or without light and/or sound. Description: The lighters use gas to produce the flame. There are in many shapes and sizes: 1) Parrots Head with key ring, 2) Sea horse with key ring, 3) Pink pig, 4) Wrench, 5) Skateboard, 6) Coffin with light, 7) Rocket, 8) USA bottle opener, 9) Nail clippers/file (Guangdong Wenye) with key ring, 10) Bird, 11) Packet of Airsave Sugerfree gum spearmint, 12) Bowling pin with lights, 13) Mobile phone with digital clock, 14) Mobile phone with picture, 15) Guitar, 16) Can of Jacobs Ice Presso + milk, 17) Gold car, 18) Playing cards, 19) Mobile phone with light, 20) Palm tree with light, 21) Dolphin with light, 22) Blue bulls head with light, 23) Bird Hologram with sound, 24) Talking lighter with transfer of a cartoon girl, 25) Trophy with football, 26) Motorbike (Tenghong).

Risk type Burns
Fire

Risk description Danger to young children - the forms of the lighters, which on the basis of European standard EN 13869, correspond to the definition of novelty lighters, may be attractive to children

under the age of 51 months leading to the increased risk of burns and fire.

Country of origin Unknown

Measures taken by economic operators Other : Retailer voluntarily stopped selling the lighters.
Other

Alert number 0092/06



Notifying country	Germany
Product category	Machinery
Type	Consumer
Product	
Brand	Unknown
Product description	Chain saw with petrol engine "Bonus" Type/model: BKS 3835-01CK.
Risk type	Injuries
Risk description	The throttle, when released, does not always return to the idling position. The fault occurs in particular when the thumb is pressed sharply against the throttle lock before it is removed, after the throttle is released (as one might do unintentionally when throwing the chain saw away in an emergency situation, e.g. on stumbling while cutting branches from a felled tree). This product does not comply with the Machinery Directive and the European Standard.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from the market by distributor. Other

Alert number 0091/06



Notifying country	Germany
Product category	Hobby/sports equipment
Type	Consumer
Product	
Brand	Unknown
Product description	Syntace handlebar stem for bicycle "Syntace"Type/model: Force 99. Parts with production codes up to 34-05 are affected.
Risk type	Injuries
Risk description	When the bicycle is stationary or is being ridden, the handlebar stem can become detached from the steer tube, making steering impossible. Excessive tightening torque applied to the fastening screws and stress corrosion lead to cracks in the handlebar stem with consequent failure.
Country of origin	Germany
Measures taken by economic operators	Other : Voluntary recall of the product by manufacturer. Other

Alert number 0090/06



Notifying country	Slovakia
Product category	Electrical appliances and equipment
Type	Consumer
Product	
Brand	Unknown
Product description	Four socket electric outlet "Ben electronic" Type/model: P 04C 16A/250V.
Risk type	Electric shock
Risk description	This product is dangerous because: - protective clamp is not indicated by means of a prescribed label, - does not meet the requirement of dielectric strength test under voltage applied, - non-compliant values of clearance between the "live" conductor screw and the metal strip of the ground conductor (required distance: min 3 mm, measured distance: max. 0.5 mm).
Country of origin	Unknown
Measures taken by economic operators	Other : Voluntary actions taken by retailer: placing on the market stopped, recall. Other

Alert number 0089/06



Notifying country	Austria
Product category	Machinery
Type	Consumer
Product	
Name	Sit-on petrol mower
Brand	Viking
Product description	Sit-on petrol mower "Viking" Name: Sit-on petrol mower. Type/number of model: MT 785, MT 785 S, MT 795. Description: Unknown.
Risk type	Burns Fire
Risk description	Risk of fire and burns. Fuel tank leak.
Country of origin	Austria
Measures taken by economic operators	Other : Voluntary recall of the product by manufacturer. Other

Alert number	<u>0088/06</u>
Notifying country	Greece
Product category	Motor vehicles
Type	Consumer
Product	
Brand	Unknown
Product description	Car "Peugeot 307"Type/model: 1.6 L automatic (Motor vehicles produced on July 2005).
Risk type	Injuries
Risk description	Fault in the positioning of the stop located on the floor under the accelerator pedal. If the stop is incorrectly positioned, there is a risk of temporarily being unable to accelerate previously programmed speed, with the speed limiter function activated, or of not being able to activate the kick down function for vehicles with automatic gearboxes. Danger of accident during overtaking.
Country of origin	France
Measures ordered by public authorities	Other : Corrective actions taken by importer. Other
Measures taken by economic operators	Other : Corrective actions taken by importer. Other