

Alert number **0193/06**



Notifying country **Romania**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Electric radiator "STC / EMEKSAN" Type/model: Unknown.**

Risk type **Electric shock**

Risk description **The product does not meet the safety requirements and presents risk of electric shock because: the earth terminal is missing, the part of the resistance that is going to be connected to the terminals is not covered with a nonconducting material in order to prevent the passage or leakage of electricity and there is the possibility to come into contact the electric resistance and the metal enclosure of the product. There is not a sign indicating the Class II of protection.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Sale of the product has been banned and withdrawal from the market has been ordered by authority.
Other**

Alert number **0192/06**



Notifying country **Sweden**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Children's cot "IKEA" Type/model:A) SNIGLAR cot size 55 x 112 cm, article number 700 441 71;B) TASSA cot size 55 x 112 cm, article number 800 834 21.**

Risk type **Injuries**

Risk description **Possible non-compliance of some cot bases with the relevant standards. Insufficient strength of the cot base due to incorrect gluing in the production.**

Country of origin **Poland**

Measures taken by economic operators **Other : Voluntary withdrawal from the sale and recall from consumers by manufacturer.
Other**

Alert number **[0191/06](#)**



Notifying country	United Kingdom
Product category	Jewellery
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Reebok heart shaped charm bracelet Type/model: CN Code 7117 1999 90. Description: Reebok heart shaped Charm Bracelet - an 8 inch long metal bracelet with a heart shaped charm with the word "Reebok" engraved on one side of the charm. The charm bracelet was provided as a free gift with the purchase of various styles of children's footwear.
Risk type	Chemical
Risk description	The recalled jewellery contains high level of lead, posing a risk of lead poisoning and adverse health effects to young children. Reebok has received a report of a death caused by lead poisoning of a 4-year old child in the US. The child reportedly swallowed a piece from one of these bracelets
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary measures. Other

Alert number **0190/06**



Notifying country **United Kingdom**

Product category **Communication and media equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Mobiles phones "O2 X1"**

Risk type **Fire**

Risk description **4 or 3 incidents of overheating whilst charging have occurred, the latest incident is alleged to have scorched the floor. (Exact number of incidents still has to be confirmed). Test results carried out to date have been inconclusive. After the third incident O2 has appointed a different specialist testing house and also submitted the earlier two damaged devices together with chargers for re-testing. O2 is still awaiting the results of this latest round of testing.**

Country of origin **Republic of Korea**

Measures taken by economic operators **Other : Voluntary recall of the product from consumers by importer.
Other**

Alert number **0189/06**



Notifying country **Germany**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Leather gloves Code: 40726008961000000499.**

Risk type **Chemical**

Risk description **Prohibited azo dyes found in the leather; benzidine (1007mg/kg) found after reductive splitting of the azo dyes.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary recall of the product and destruction.
Other**

Alert number **0188/06**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Car SAAB 9-3.Type/model: YS3FXXXX. Description: Concerns vehicles whose rear axle is fitted with wheel bearings with manufacturing code "3 2635". VINs concerned: YS3F*****61024205 - YS3F*****61027871.**

Risk type **Injuries**

Risk description **Owing to inadequate hardening of the wheel bearings, the correct guidance of the wheel may be adversely affected. In extreme circumstances the wheel may shear off from the rear axle.**

Country of origin **Sweden**

Measures taken by economic operators **Other : Voluntary corrective actions taken by manufacturer.
Other**

Alert number **0187/06**



Notifying country **Germany**

Product category **Kitchen/cooking accessories**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Vacuum jug/flask "Itaso" Type/model: NPA-100 B, EAN 4038611048650.**

Risk type **Chemical**

Risk description **Inside the flask, between the glass carafe and the plastic container, there is a spacer about 5 mm thick containing asbestos. Marketing of asbestos is prohibited. This constitutes a hazard, especially on uncontrolled disposal by final consumers.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Placing on the market was stopped. Voluntary withdrawal of the product from the market and destruction by importer.
Other**

Alert number **0186/06**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Motor vehicles "Seat" - two-part flywheel.Type/model: ALTEA, TOLEDO, LEON, with 2.0l Tdi engine and 6-speed manual gearbox - 02Q.Description: The recall concerns vehicles with serial numbers : ALTEA/TOLEDO from 5P/4R000048 to 5P/4R017390, from 5P/5R000026 to 5P/5R103620 and from 5P/6R000009 to 5P/6R001638 and LEON from 1P/6R000004 to 1P/6R001610.**

Risk type **Injuries**

Risk description **In some vehicles the two-part flywheel can get damaged during extreme clutch engagements (jumping-back clutch pedal) because of a not optimally designed through-flow restrictor in the ventilation valve of the clutch pressure pipe.**

Country of origin **Spain**

Measures taken by economic operators **Other : Voluntary corrective actions by importer.
Other**

Alert number **[0185/06](#)**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Toy rooster imitating a telephone "BEAUTEOUS CHANTICLEER" Type/model: Code No 517.**

Risk type **Choking
Strangulation**

Risk description **String which connect toy and phone horn is 2045 mm long (risks of strangulation). Plastic pellicles separated from the toy fit into a small part cylinder (risk of choking). The toy does not comply with the Toys Directive and the European Standards.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Unknown.
Other**

Measures taken by economic operators **Other : Unknown.
Other**

Alert number **0184/06**



Notifying country	Lithuania
Product category	Toys
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Toy pistol with arrows Type/model: MK 1241325.
Risk type	Injuries
Risk description	The laboratory tests revealed that the elastic material placed at end of the arrow — suction cup can be removed under traction of less than 60 N. Kinetic energy $0,115 \pm 0,021$ J is higher than described in the standard. The toy does no comply with the Toys Directive and the European Standards.
Country of origin	People's Republic of China
Measures ordered by public authorities	Other : Unknown. Other
Measures taken by economic operators	Other : Unknown. Other

Alert number **0183/06**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Dog shaped toy.Type/ model: 020635.**

Risk type **Choking**

Risk description **Dog's ears, tail, cap, stickers, wheels and key detached during the test. These parts can easily be placed in small parts cylinder. The toy does not comply with the Toys Directive and the European Standards.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Unknown.
Other**

Measures taken by economic operators **Other : Unknown.
Other**

Alert number **0182/06**



Notifying country **Hungary**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Steam iron "TECHNIKA" Type/model: TK-1368A.**

Risk type **Electric shock
Fire**


Risk description **The notified iron presents risk of electric shock because during the tests appliance began to emit smoke, gas and flame. The cover melted, opened and live parts became accessible. Moreover, the cross section area of the conductor is less than required and the product does not have a thermal fuse, regulating switch and it may cause fire. This product does not comply with the LVD Directive and the relevant European Standards.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by authority.
Other**

Alert number

0181/06

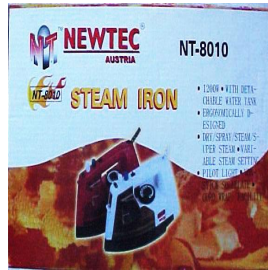

Notifying country

Hungary

Product category

Electrical appliances and equipment

Type

Consumer

Product

** **

Brand

Unknown

Product description

Steam iron "NEWTEC" Type/model: NT-8010.

Risk type

**Electric shock
Fire**

Risk description

The basic insulated metal bottom part (including the heating element) is accessible which may cause electric shock. The plug is non-standardised. The product does not have a thermal fuse, regulating switch, which may cause fire. During testing the appliance began to emit smoke, gas and flame. The product does not comply with the LVD Directive and the relevant European standards

Country of origin

Unknown

Measures ordered by public
authorities

**Other : Withdrawal from the market and recall ordered by the authority.
Other**

Alert number **0180/06**



Notifying country **Hungary**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Coffee maker "TECHNIKA" Type/model: TK-7900.**

Risk type **Fire**

Risk description **This product presents risk of fire because during the tests the appliance began to emit smoke and the cross section area of the conductor is less than required. This product does not comply with the LVD Directive and the relevant European Standards.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by authority.
Other**

Alert number **0179/06**



Notifying country	Greece
Product category	Motor vehicles
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Car Renault Scenic. Type/model: Concerns vehicles produced between 1.2.2003 and 12.12.2005.
Risk type	Injuries
Risk description	A concern relating to the anti-rotation shim between seatbelt stalk fastener and seat. Excessive clearance is liable to occur on the stalk fasteners of the rear side seatbelts when system is subjected to a high level of stress under specific operating conditions. In extreme cases, such clearance may eventually result in the loosening of stalk fastener.
Country of origin	France
Measures taken by economic operators	Other : Voluntary corrective action taken by the importer. Other

Alert number **0178/06**

Notifying country **Germany**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Gloves. Type/model: Code: 60311001791000000100. Description: knitted gloves; size 7, 70% wool, 20% angora, 10% polyamide. Soft, red textile material, similar to wool, with a holed pattern sewn into the cuff, with a printed cardboard tag attached by a plastic thread, and an adhesive textile label in the left glove.**

Risk type **Chemical**

Risk description **The red knitted fibre has been manufactured or treated using prohibited azo dyes (benzidine - 695 mg/kg), which may release one of the carcinogenic amines.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary recall of the product by retailer.
Other**

Alert number **[0177/06](#)**



Notifying country	Germany
Product category	Electrical appliances and equipment
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Circuit tester "OPTIMAL" Type/model: Current tester in two parts, 6-24 volts, Art. 11006, EAN 4041073110063.
Risk type	Electric shock
Risk description	Due to similar appearance, risk of confusion with a circuit tester for 230 volts. Lack of warnings and safety instructions and the barely legible inscription on the tester "6V-12V-24V" make it likely that its misuse will lead to the risk of electrocution (internal resistance of around 500 ohms). In addition, the tester can be opened without difficulty and can therefore be tampered with. The product does not comply with the LVD Directive.
Country of origin	Unknown
Measures ordered by public authorities	Other : Placing on the market suspended by the authority. Remaining stocks will be destroyed. Other

Alert number **0176/06**

Notifying country **Poland**

Product category **Motor vehicles**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Car Opel Vectra C.Type/model: MY06, CN:8703**

Risk type **Injuries**

Risk description **Lack of blockade in reel of a safety belt may result in a faulty operation of the middle safety belt in case of a head-on collision. Above mentioned defect may have a significant impact on passenger safety.**

Country of origin **Germany**

Measures taken by economic operators **Other : Voluntary corrective actions taken by importer.
Other**

Alert number

0175/06



Notifying country

United Kingdom

Product category

Recreational crafts

Type

Consumer

Product

** **

Brand

Unknown

Product description

**Sealine branded Motor Yacht "Sealine International Ltd."
Type/model: Models F34, F37 and F43.**

Risk type

Chemical

Risk description

Risk of carbon monoxide poisoning. On a number of these boats there is a possibility that the through ventilation is less than 100% of the area required and incomplete combustion could occur if all windows and doors were closed when cooking at full capacity was taking place.

Country of origin

United Kingdom

Measures taken by economic operators

**Other : Voluntary corrective actions taken by manufacture.
Other**

Alert number **0174/06**



Notifying country **Spain**

Product category **Lighting equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Adjustable halogen desk lamp "KONNOC", metallic, available in various colours (black, red, blue and white).Type/model: Model SX 388.**

Risk type **Electric shock**

Risk description **Product presents risk of electric shock because: the insulating sleeve is not securely fixed, the conductor is not held in place between metallic surfaces, the terminals are not securely affixed to the luminaire, the mechanical and electrical characteristics of the flex do not correspond to those laid down in the standard, the cross-section of the conductors is smaller than 0.75 mm² and during the short-circuit test the transformer winders exceeded the maximum temperatures specified. This product does not comply with the LVD Directive and the relevant European Standards.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by authority.
Other**

Alert number **0173/06**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Car Toyota RAV4.Type/model: RAV4; (ABE No G703, EG-BE: e4*93/81*0001*..)Description: Concerns vehicles built between 19 May 1995 and 31 July 1995.**

Risk type **Injuries**

Risk description **Corrosion can lead to breakage of the front suspension spring, which could then touch and damage the tyre. 11 cases of suspension spring breakage have been reported outside Japan.**

Country of origin **Japan**

Measures taken by economic operators **Other : Voluntary corrective actions taken by manufacturer.
Other**

Alert number **0172/06**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Sandwich toaster "Breville" in the shape of a cow
Type/model: Daisy TR13S.**

Risk type **Burns**

Risk description **Product presents risk of burns, as the temperature of the cover can reach 89°C during normal use. The shape and decoration of the appliance could lead children to believe that it is a toy (this product is in the shape of a cow and emits sounds). This product does not comply with the LVD Directive and the relevant European Standards.**

Country of origin **United Kingdom**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by authority.
Other**

Alert number **[0171/06](#)**



Notifying country	Germany
Product category	Electrical appliances and equipment
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Travel hair drier.
Risk type	Electric shock
Risk description	Product presents risk of electric shock because slight pressure on the housing opens up a gap through which live components can be touched. This product does not comply with the LVD Directive and the relevant European Standards.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from the sale by retailer. Other

Alert number **0170/06**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Yo-Yo Puffer ball with flashing light. Type/model: Unknown. N.B.:The yo-yo is put on sale in a cardboard display box containing 12 yo-yos.**

Risk type **Strangulation**

Risk description **Yo-yo ball presents a risk of strangulation because it can wrap around child's neck in particular when child is playing with it around his head like with lasso.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban ordered by authority. Import of the product rejected at the border.
Other**

Alert number **0169/06**

Notifying country **United Kingdom**

Product category **Pyrotechnic articles**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Category: Fireworks "WECO - Spider, Viper, Sydney, Rio, Apollo, Cobra"Type/model: Ground Firework Collection Art No. 4965-30. Power Family Assortment Art No. 2062-30. Best of Rocket Assortment Art No. 2952-30. 18 Display Rockets Art No. 2944-30. Apollo Star Roman Candle Art No. 3278-30. Power Family Assortment Art No. 2060-30.Description: Unknown.**

Risk type **Injuries**

Risk description **Incorrect labelling has been applied to individual fireworks.**

Country of origin **Germany**

Measures taken by economic operators **Other : Voluntary recall by the importer.
Other**