


Alert number **0383/06**

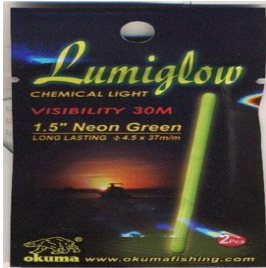

Notifying country **France**

Product category **Gadgets**

Type **Consumer**

Product ** **

Brand **Unknown**

Barcode **4718947700257**

Product description **Light sticks "OKUMA"**

Risk type **Chemical**

Risk description **This product contains a preparation which is not permitted for public use due to its toxicity. The coloured phase of this product consists mainly of dibutylphthalate (CAS 84-72-4) which is classified as toxic for reproduction (development) (category 2), very toxic to aquatic organisms and toxic for reproduction (fertility) (category 3). In addition, the decree of 07/08/1997 prohibits the marketing of this substance or of preparations containing a sufficient quantity of the substance.**

Country of origin **Canada**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by the authority.
Other**

Alert number **[0382/06](#)**



Notifying country **Cyprus**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Barcode **6 921213 212537**

Product description **Electrical sauna belt "BEAUTY-SZ2138"**

Risk type **Burns
Electric shock**

Risk description **Two persons have been injured (Burns).**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary withdrawal from the market.
Other**

Alert number **[0381/06](#)**



Notifying country **Spain**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **Carnival, Rainbow, Sunshine**

Product description **Swing seats "RAINBOW" sold as accessories to some Rainbow Brand play systems in the Carnival, Sunshine and Rainbow series.**


Risk type **Injuries**

Risk description **The seats of the notified swings may break causing children using the swings to fall and sustain injuries. The seats may break due to a fact that low-density polyethylene was used in the manufacture process. In the USA, one child fell and broke her arm when the swing seat broke.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary recall of the product.
Other**

Alert number **0380/06**

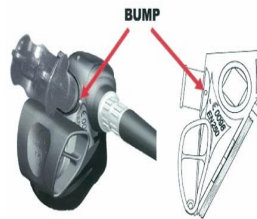

Notifying country **Italy**

Product category **Hobby/sports equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Diving regulator “SCUBAPRO® X650 Second Stage Regulator”.**

Risk type **Drowning**

Risk description **The housing for the cover and diaphragm of the affected units were manufactured with a material that could deform over time, causing the cover of the regulator to come loose and the diaphragm inside the regulator to become dislodged. If the regulator is exposed to sufficient heat for a prolonged period of time, housing deformation would be accelerated. In the event the diaphragm dislodges in water, air flow will be interrupted and the regulators will no longer function, posing a drowning hazard to users.**

Country of origin **Italy**

Measures taken by economic operators **Other : Voluntary withdrawal from the market and recall from consumers by the manufacturer.
Other**

Alert number **0379/06**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **STEERING WHEEL, 10-748A**

Product description **Toy with light and sound and movement.**

Risk type **Burns**

Risk description **This product poses a risk of burns because: - it exceeds by more than 55 degrees the maximum permissible temperature rise (45K) in accessible metal parts, short-circuiting the insulation between components of differing polarities, - the housings have insufficient mechanical resistance, - there are no instructions. Owing to the temperature rises observed, the toy may cause burns to children using it. This product does not comply with the Toys Directive and the relevant European Standard.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authority.
Other**

Alert number **0378/06**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Chevrolet Nexia and Espero**

Brand **Chevrolet**

EC-type approval/model **Espero serial numbers 102171 to 990453 inclusive, Nexia serial numbers 000001 to 793829 inclusive**

Product description **Models manufactured between 1993 and 1997.**

Risk type **Injuries**

Risk description **It is possible that the buckles of the front seatbelts may not close properly, owing to a design fault in one of the components inside the buckle. This means that the retention mechanism of the front seatbelt buckle may not work properly.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer.
Other**

Alert number **[0377/06](#)**



Notifying country **Germany**

Product category **Machinery**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **73516**

Barcode **8714892735163**

Product description **Stone cutting disc "Work-it"**

Risk type **Injuries**

Risk description **In a centrifugal test, the cutting discs failed well below the minimum fracture speed of 150 m/sec prescribed by the relevant standard. Cracks radiating from the metal ring are apparent on the front of the disc. The indications of intended use are contradictory, the mention of use for stone being accompanied by a pictogram for steel, which is not permissible. In addition the product had incorrect labelling.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Distribution ban ordered by the authority.
Other**

Alert number **[0376/06](#)**



Notifying country **Lithuania**

Product category **Furniture**

Type **Consumer**

Product ** **

Name **Table AIR/I TV cabinet chrome.**

Brand **“ACTONA Company Bringing Home Value”**

Product description **Table “ACTONA Company Bringing Home Value” Name: Table AIR/I TV cabinet chrome. Type/number of model: 0426822045, PO# 44162.**

Risk type **Injuries**

Risk description **The product poses a risk of injury because it is unstable. The product does not comply with standard LST L ENV 12521:2000. During strength, durability and stability test, table tumbled down when work top was affected by 110 N strength whereas according to the requirement, table has to be stable when affected with strength of less than 200 N.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban and withdrawal from the market ordered by the authority.
Other**

Alert number **0375/06**



Notifying country **Greece**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product ** **

Brand **y Soother Clipping Chain "CHEER"**

Type / number of model **908321**

Product description **Safety Soother Clipping Chain "CHEER"**

Risk type **Suffocation**

Risk description **The product poses a risk of choking because during tensile tests it was discovered that garment fastener can become detached and it has no ventilation holes.**

Country of origin **Taiwan**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authority.
Other**

Alert number **[0374/06](#)**



Notifying country	Lithuania
Product category	Furniture
Type	Consumer
Product	&nbsp;
Name	Chair "ERA" II combi chrome.
Brand	"NOWY STYL UKRAINE (ZAO NOVYJ STYL) (ru: ЗАО "Новый Стиль")"
Type / number of model	PIN 925/K02
Product description	Chair "NOWY STYL UKRAINE (ZAO NOVYJ STYL) (ru: ЗАО "Новый Стиль")"
Risk type	Injuries
Risk description	This product poses a risk of injury (falling, trapped/jammed body parts) due to the insufficient structure of the chair. In particular, - due to chair's insufficient balance, there is a risk of the chair falling backwards and thus injuring the consumer; - given that hollow pipes are not covered, consumer can trap his fingers inside the pipes; - the construction of the chair does not guarantee durability and proper strength for performing seats and the backs' support broke during a fatigue test. There is therefore no guarantee that chair will not fall back, to the sides or to the front. This product does not comply with the European Standards EN 13761 and EN 1728.
Country of origin	Ukraine

Measures ordered by public
authorities

**Other : Sales ban and withdrawal from the market ordered
by the authority.
Other**

Alert number **0373/06**



Notifying country	Czechia
Product category	Lighting equipment
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Table halogen luminaire "LUCERNA" Type/number of model: L460/L462.
Risk type	Burns Cuts Fire
Risk description	This product poses a risk of burns, fire and cuts because: - the temperature limit of the mounting surface was exceeded. - the protective shield of the tungsten halogen lamp failed to meet the mechanical resistance requirements. - the connections of the internal wiring did not have sufficient insulation. - the thermal requirements were not met. This product does not comply with the European Standard on electrical products.
Country of origin	Czechia
Measures ordered by public authorities	Other : Sales ban ordered by the authority. Other

Alert number

0372/06



Notifying country

Czechia

Product category

Electrical appliances and equipment

Type

Consumer

Product

** **

Brand

Unknown

Product description

Electrical sauna Belt "Bestseller" Type/number of model: Unknown.

Risk type

**Burns
Electric shock**

Risk description

This product poses a risk of electric shock and burns because: - the temperature rise of the insulation of the internal wiring, the heating element and the surface of the belt exceeds the maximum values of heating specified in the standard; - the flexible part is not resistant against moisture which can occur during normal use; - the leakage current is excessive and the electric strength is insufficient. This product does not comply with the LVD Directive and the European Standard EN 60335.

Country of origin

Hong Kong

Measures ordered by public authorities

**Other : Sales ban ordered by the authorities.
Other**

Alert number **[0371/06](#)**



Notifying country **Estonia**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **MAG 6730 079 802**

Product description **Soldering iron "MAGNUM"**

Risk type **Electric shock**

Risk description **This product poses a risk of electric shock because: - dimensions of the plug are not in line with the standard; - cross-section area of the cord (0,2 mm²) is smaller than required in the standard (0,5 mm²). In addition, appliance handle screw temperature exceeds the limit in the standard. This product does not comply with the European Standard on electrical products.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban and withdrawal from the market ordered by the authority.
Other**

Alert number **0370/06**



Notifying country **Hungary**

Product category **Toys**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **6108**

Product description **Toy mobile phone with sound in Hungarian.**

Risk type **Choking**

Risk description **The product poses a risk of choking because the small button batteries operating the toy are accessible by removing the back of the toy which can be done without tools. The product does not comply with the Toys Directive and the European Standards EN 71-1 and EN 50088.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban and recall from consumers ordered by the authority.
Other**

Alert number **0369/06**



Notifying country **Czechia**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **Sauna Belt - TV product.Type/number of model: 3in1.**

Risk type **Burns
Electric shock**

Risk description **This product poses a risk of electric shock and fire because:
- The temperature rise of the insulation of the internal wiring, the heating element and the surface of the belt exceeds the maximum values of heating specified in the standard. - The flexible part is not resistant against moisture which can occur during the normal use. - The leakage current is excessive and the electric strength is insufficient. This product does not comply with the LVD Directive and the relevant European Standards.**

Country of origin **Hong Kong**

Measures ordered by public authorities **Other : Sales ban ordered by the authorities.
Other**

Alert number **0368/06**



Notifying country **Greece**

Product category **Lighting chains**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **Unknown**

Product description **Luminous Christmas Tree "YIMEI"**

Risk type **Electric shock**

Risk description **This product poses a serious risk of electric shock because:**
- **The product's plug does not meet the requirements of electrical safety.** - **The cross-section area of the product's internal and external wiring is less than required.** - **The cord anchorage on the plug is inadequate, the lamp holders are not resistant to heat, fire etc.** - **The product did not contain instructions for use in Greek. This product does not comply with the LVD Directive and the relevant European Standards.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authority.**
Other

Alert number **[0367/06](#)**



Notifying country **United Kingdom**

Product category **Machinery**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **mini motorbikes.Type/number of model: The words 'F.Kingdom' on the handlebars.**

Risk type **Fire
Injuries**

Risk description **This mini-motorbike poses a risk of injury because the drive chain and sprocket were unguarded and presented a trapping and contact hazard to the user and because of steering and braking deficiencies. A potential fire hazard exists due to inadequacies in the fuel system. The bike failed to comply with the Standard BS 7407 in a number of aspects: - The drive chain and sprocket were not guarded. - The braking system was insecurely attached, operated abnormally and was imbalanced and inefficient. - The machine did not have a suspension system, which in certain conditions would affect the handling characteristics. - The steering mechanism fouled on the fairing and did not have full freedom of movement. - There were sharp edges, trapping hazards and mis-alignment of the fairing.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Suspension from sale by the authority. (Importer signed over the bikes to the local authority for disposal).**

Other

Alert number **0364/06**



Notifying country **United Kingdom**

Product category **Machinery**

Type **Consumer**

Product ** **

Brand **Unknown**

Product description **mini motorbikes.Brand: Unknown. Type/number of model: Pocket Bike PK1.**

Risk type **Fire
Injuries**

Risk description **The drive chain and sprocket were unguarded and presented a trapping and contact hazard to the user. The fuel system and electrical circuits were inadequate causing possible fire hazards. The bike failed to comply with the Standard BS 7407 in a number of aspects: - The drive chain and sprocket were not adequately guarded. - The construction of the bike was of a poor standard, with inadequate welding and low grade nuts, bolts and screws used on engine mounting, brakes, transmission and steering. - There was no fuse system to protect the electrical circuit. - The fuel tank had no shielding from heat sources such as the engine. - The handlebar stop button appeared inadequate. - An effective speed limiting device was not evident. - The brake levers were not ball ended. - The rear mudguard was inadequate and did not extend to the vertical tangent of the wheel.**

Country of origin **People's Republic of China**

Measures ordered by public **Other : Suspension from sale by the authority. (Importer**

authorities

**signed over the bikes to the local authority for disposal).
Other**

Alert number **0363/06**



Notifying country	Greece
Product category	Motor vehicles
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Car accessories - Tires' pressure valve. The valves are provided by Shell through a gift program "Smart Club". Brand: Unknown. Type/number of model: 28PS/1.96 BAR & 36PSI/2 BAR.
Risk type	Injuries
Risk description	When the valve is applied to the tyre, there is a possibility of graduated reduction of the tyre's pressure. This could lead to loose of control of vehicle.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from the market and recall from the consumers by the importer. Other

Alert number

0362/06





Notifying country	Slovakia
Product category	Lighters
Type	Consumer
Product	&nbsp;
Brand	Unknown
Product description	Different novelty lighters of various shapes.Brand, type, model: Unknown.Description: 1. Locomotive with sound and lighting effects - MODEL TRAIN, 2. Cage with a bird with sound and lighting effects, 3. TOBACCO PIPE, 4. Candleholder, 5. CONEY camera with lighting effect, 6. Key ring with a TAXI sign with a lighting effect, 7. bulb, 8. HENG QWQ GON G HUA gun, 9. Mod 4k gun, 10. Horse standing on its back legs with a sound and lighting effect DELICACI GIFT, HD 14286, 11. Sewing machine, Art.04485 ROYCE, 12. Grinder DELICATE GIFT, Art. 04486 ROYCE, 13. Hand grenade - CONEY HOME Art. 40.300, 14. BEETLE CAR 133913, 15. Power-saw, 16. Pendant in the shape of a paprika, 17. Pendant in the shape of a fuel dispensing pump - GAS METER, 18. Pig, 19. Fighter jet, 20. Gun.
Risk type	Burns Fire
Risk description	Danger for small children - the lighter shapes identified above (which according to EN 13869 comply with the definition of a novelty lighter) can attract children younger than 51 months of age, which leads to increased chances of burning or fire risk.
Country of origin	People's Republic of China
Measures ordered by public authorities	Other : Sale of the product prohibited and warning of customers requested by the authority. Other