

Alert number **0747/06**



Notifying country **Germany**

Product category **Lighting equipment**

Type **Consumer**

Product **Floor lamp**

Brand **Unknown**

Type / number of model **167180**

Barcode **8716963159151**

Risk type **Electric shock
Fire**

Risk description **- it is not stable due to its dimensions; - the transformer is not adequately secured, which means that it can come into contact with the metal casing of the lamp; - during the voltage stability test, there was a transformer flashover at 3100 V; - instructions for changing the bulb are incomplete; - assembly instructions are only in English. Risk of electric shock and fire. The product poses a risk of electric shock and fire because: The product does not comply with the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by the authority.
Other**

Alert number **0746/06**



Notifying country **United Kingdom**

Product category **Other**

Type **Consumer**

Product ** **

Name **4 pcs Luggage Strap”**

Brand **ory: LUGGAGE STRAPS.4 pcs luggage strap “Everyday Tools.**

Type / number of model **P20/628**

Barcode **5-055132206283**

Risk type **Injuries**

Risk description **The product poses a risk of injury because metal hooks straighten out causing the elasticated strap to recoil at high velocity. During testing, all single length straps failed the force requirement (400N for 60 seconds) as defined in the relevant British standard due to a combination of pull-through and hook failure. In addition, the markings and instructions for use are insufficient. The packaging states ‘Do not exceed 170N Tension’ when the standard requires that elasticated straps should sustain 400N Tension for 60 seconds. Similar products have in the past caused serious eye injuries.**

Country of origin **People's Republic of China**

Measures taken by economic **Other : Voluntary recall from consumers. Prosecution**

operators

**notice issued by the authority.
Other**

Alert number **[0745/06](#)**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **Air filter and screws in Yamaha motorcycle**

Brand **Yamaha**

EC-type approval/model **YZF R6 '06**

Risk type **Injuries**

Risk description **The affected motorcycles pose a risk of injury following a loss of control of the motorcycle. The risk results from the fact that the air filter mounting screws may come off and get caught at the throttle valve. If this happens, the throttle valve may stick and the vehicle does not reduce the engine speed properly.**

Country of origin **Japan**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer.
Other**

Alert number **[0744/06](#)**



Notifying country **The Netherlands**

Product category **Cosmetics**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **Unknown**

Product description **Skin whitening gel and cream "Fair & White Exclusive Whitener Gel Crème" (30 ml, product code B58) and "Fair & White Exclusive Whitener Fade Cream" (200 ml, product code L06045)**


Risk type **Chemical**

Risk description **These products pose a chemical risk to consumers because they contain hydroquinone (at levels of 8% in the gel, and 3.8% in the cream). Long-term use of skin creams containing hydroquinone may have harmful side-effects. These products do not comply with the Cosmetics Directive.**

Country of origin **France**

Measures taken by economic operators **Other : Voluntary withdrawal from the market.
Other**

Alert number **0743/06**

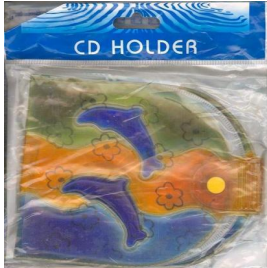

Notifying country **Spain**

Product category **Gadgets**

Type **Consumer**

Product ** **

Name **CD holder "POESSA"**

Brand **Unknown**

Type / number of model **312493**

Barcode **8430173124937**

Risk type **Chemical**

Risk description **The laboratory has examined the composition of the liquid and found that it is a mixture of hydrocarbons mainly in the C7-C17 range. Its kinematic viscosity is less than 7mm²/s at 40 °C and its surface tension is less than 33 mN/m at 25 °C. In view of these findings, this liquid has been classified as "harmful" and is not allowed to be used in ornamental objects intended to produce light or colour effects by means of different phases (Directive 97/64/EC).**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authority.
Other**

Alert number **[0742/06](#)**

Notifying country **Germany**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product ** **

Name **Ladies' jacket "MOD'L Paris T 1 Fagon CuiR, P. U DOUBLUE"**

Brand **Unknown**

Type / number of model **11298**

Barcode **11298006411000000499**

Product description **Season 2006, beige-brown, 100 % Polyester, MOD'L Paris T 1 Fagon CuiR , P. U DOUBLUE.**

Risk type **Chemical**

Risk description **The product poses a risk to the health of pregnant women and unborn children due to excessive release of solvent dimethylformamide which can be inhaled when the jacket is worn. The dose regarded as harmful to pregnant women (15 mg/m³ air) is exceeded. The substance can also be absorbed through large areas of the skin.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary recall from consumers.
Other**

Alert number **0741/06**



Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product ** **

Name **Colour crayons "Grand"**

Brand **Unknown**

Type / number of model **Friends, 12 colours (02249)**

Barcode **5903364 244910**

Risk type **Chemical**

Risk description **The product poses a risk of poisoning because dark green crayon contains excessive quantities of lead (lead content $305,9 \pm 7.3$ while the limit value is 90). This product does not comply with the Toys Directive and the relevant European standard EN 71-3.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary stop of sales, withdrawal from the market and recall from consumers by the distributor and the supplier.
Other**

Alert number **0740/06**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product ** **

Name **Automatic transmission computer in Renault cars**

Brand **Renault**

EC-type approval/model **Clio III, Megane II**

Product description **The recall concerns vehicles equipped with DPO automatic transmission and produced from 7 March to 29 May 2006.**

Risk type **Injuries**

Risk description **Due to incorrect programming of the Automatic Transmission Computer, a malfunction of the operation of the automatic gearbox may occur. The malfunction can affect vehicle conformity and, in particular, lead to a loss of manual mode or shifting into hydraulic third gear, which in turn, can lead to an injury due to a loss of control of the vehicle.**

Country of origin **France**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer.
Other**

Alert number **[0739/06](#)**

Notifying country **The Netherlands**

Product category **Cosmetics**

Type **Consumer**

Product **Nail Polish**

Brand **Casuelle Cosmetics**

Type / number of model **80.630 PU**

Barcode **0257**

Product description **Colour code 531 & 847; Glass Bottle 10 ml. Description: Unknown.**

Risk type **Chemical**

Risk description **Phthalates have a negative effect on the development of male/female reproductive organs. Especially children are vulnerable as their body is developing and can be negatively affected by these toxic substances. This product poses a chemical risks to consumers because it contains Dibutyl Phthalate (4,0 % and 5,4 %) which may cause harm to the unborn child and pose a possible risk of impaired fertility. The use of this substance is prohibited in cosmetics under the Cosmetic Directive.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary withdrawal from the market.
Other**

Alert number **0738/06**



Notifying country **The Netherlands**

Product category **Cosmetics**

Type **Consumer**

Product **Make-up kit**

Brand **Casuelle Cosmetics**

Type / number of model **80.613**

Barcode **0451**

Product description **Unknown.**

Risk type **Chemical**

Risk description **This product poses a chemical risks to consumers because it contains dibutyl phthalate at level of 6.8 %. Dibutyl phthalate is classified as possibly causing harm to an unborn child and impaired fertility. Phthalates have a negative effect on the development of male/female reproductive organs. Especially children are vulnerable as their body is developing and can be negatively affected by these toxic substances. The use of this substance is prohibited in cosmetics under the Cosmetic Directive.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary withdrawal from the market by the importer.
Other**

Alert number **0737/06**



Notifying country	The Netherlands
Product category	Chemical products
Type	Consumer
Product	Tyre repair kit
Brand	Jin Shong Che. Ind. Co., Ltd.
Barcode	4326470000002
Risk type	Chemical
Risk description	The maximum permitted level of benzene in consumer products is 0.1%. The product poses a carcinogenic risk to consumers because the rubber solution contains 33 % benzene and 22% toluene. Benzene is classified as carcinogenic category I R45, mutagenic category II R46 and toxic (R46/23/24/25). Toluene is classified as carcinogenic category III, harmful R20/48 and highly inflammable. The labelling of the product is incorrect and incomplete.
Country of origin	Germany
Measures taken by economic operators	Other : Voluntary withdrawal from the market. Other

Alert number **0736/06**



Notifying country	Spain
Product category	Toys
Type	Consumer
Product	Letters, numbers and symbols in magnetic plastic
Brand	Unknown
Product description	Presented in a blister pack with the labelling on pink cardboard.
Risk type	Cuts
Risk description	This product poses a risk of cuts to children because polymer materials of the letters contain sharp points. The sharp points could cause cuts among the children using it. While the injuries children may suffer are in principle minor, the possibility of them to occur is high due to the fact that playing with the toy involves handling all the pieces. As the toy is aimed at children, the risk is therefore high. This product does not comply with the Toys Directive and the relevant European standard EN 71-1.
Country of origin	People's Republic of China
Measures ordered by public authorities	Other : Withdrawal from the market ordered by the authorities. Other

Alert number **0770/06**

H1538 Sporty Style Playset



H1537 City Pretty Playset



Notifying country **United Kingdom**

Product category **Toys**

Type **Consumer**

Product ** **

Name **Polly Pocket Magnetic Play sets "Mattel"**

Brand **Mattel**

Type / number of model **B2632-Polly Place Hanging out House, B3158-Polly Place Treetop Clubhouse, B3201-Spa Day, B7118-Polly Place Totally Tiki Diner, G8605-Quik Klik Boutique, H1537-Quik Klik City Pretty Playset, H1538-Quik Klik Sporty Style Playset, H3211- Totally Zen Playset**

Product description **Plastic toys inside card board box.**

Risk type **Injuries**

Risk description **170 complaints regarding the small magnets coming out of these recalled toys have been reported. There were three reports of serious injuries to children who swallowed more than one magnet. All three suffered intestinal perforations that required surgery. Risk of internal injuries. Tiny Magnets inside the dolls and accessories can fall out undetected to parents and guardians. The magnets can be swallowed, aspirated by young children or placed by a child in their nose or ears. When more than one magnet is swallowed, the magnets can attract to each other and cause intestinal perforation, infection or blockage, which can be fatal. Aspiration to the lungs requires immediate surgery. Magnets placed in the nose or ears can cause swelling and be difficult to remove.**

Country of origin

People's Republic of China

Measures taken by economic operators

Other : Voluntary withdrawal from the market and recall from consumers by the manufacturer
Other

Alert number **0765/06**



Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product **Tempera paints**

Brand **Sakota**

Type / number of model **12 pieces (CEA 2039)**

Barcode **5997875 720391**

Risk type **Chemical**

Risk description **This product poses a serious risk of poisoning because orange tempera paint contains high levels of lead (content 216.7 ± 3.8 ; 90 permitted). This product does not comply with the Toys Directive and the relevant European standard EN 71-3.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary actions taken by the distributor: stop of placing of the product on the market, withdrawal from the market.
Other**

Alert number **0764/06**



Notifying country **Lithuania**

Product category **Lighting equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **71018/1W FOREVER**

Product description **Wall lamp "Forever"**

Risk type **Electric shock**

Risk description **This lamp poses a serious risk of electric shock because: - parts of the lamp are not earthed, - there is no connection to main supply, - electrical wires are not jointed together, - lamp holder loosens (fixing elements are missing). This product does not comply with the Low Voltage Directive and the LVD standards.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban and withdrawal from the market ordered by the authority.
Other**

Alert number **[0763/06](#)**



Notifying country **The Netherlands**

Product category **Toys**

Type **Consumer**

Product **Wooden puzzle girl**

Brand **Unknown**

Barcode **8713219189573**

Risk type **Choking**

Risk description **This toy poses a serious risk of choking to children because it contains small elements which fit within the small parts cylinder. This product does not comply with the Toys Directive and the Toys Standard.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Measures ordered by the authority: information to consumers, sales ban, withdrawal from the market.
Other**

Alert number **[0762/06](#)**



Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Aluminium light metal wheel for use on motor cars "SMC"**

Brand **Unknown**

EC-type approval/model **WB 75016**

Product description **Five-spoke Softline rim. The wheel is marked on the front with the national type designation KBA 45580 and on the back with the type WB 75016 and the date of manufacture, as follows: the rear of the rim bears a number, e.g. 04, 05 or 06, beside which is a grid, the cells of the grid contain dots which indicate the month of manufacture, e.g. 04 plus 11 dots = November 2004.**

Risk type **Injuries**

Risk description **Testing of the wheels established that their strength is inadequate under certain circumstances. This can lead to a spoke fracture and ultimately destruction of the wheel. If this occurs, the driver may lose control of the vehicle.**

Country of origin **Germany**

Measures taken by economic operators **Other : Voluntary recall from consumers by the producer.
Other**

Alert number **0761/06**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product **Tricycle in a form of motorcycle**

Brand **Unknown**

Type / number of model **Unknown**

Risk type **Choking Injuries**

Risk description **This product poses a serious risk of external injuries because: - child's legs can jam between pedals at the pushing moment; - metallic tubes are accessible because plastic coverage can be taken of using force of less than 60 N; - it is sold without any instructions for use and without any information about possible hazards. This product also poses a serious risk of choking because stickers (plastic sheets) attached to the tricycle may detach and they fit completely within the small parts cylinder. This product does not comply with the Toys Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban and withdrawal from the market ordered by the authority.
Other**

Alert number **0760/06**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product **Tricycle**

Brand **Unknown**

Type / number of model **SUC2206-2**

Risk type **Choking
Injuries**

Risk description **- during tension test, the cover of protruding parts detached with force of 60 N + 2 N revealing the metallic tubes of handlebars although parts that suggest a hazard to a child must remain covered; - product does not comply with the requirement that a toy the purpose of which is to carry a child's weight has to be constructed in a way that a child cannot fit any body parts between the moving parts and there should be a certain gap between moving parts; - product does not comply with the requirement that tricycles which have handle for pushing must be constructed in a way that the child's foot cannot get jammed between the pedals; - during tension test, a spring which completely fits into the small part cylinder detached from the tricycle; - although a toy the purpose of which is to carry a child's weight has to be sold with instructions for use and the necessary safety warnings, such information is missing. This product poses a serious risk of injury and choking due to the following non-compliances with the relevant standard: This toy does not comply with the Toys Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Other : Sales ban and withdrawal from the market ordered
by the authority.
Other**

Alert number **[0759/06](#)**



Notifying country **United Kingdom**

Product category **Other**

Type **Consumer**

Product ** **

Name **Fur Hot Water Bottle “New Look”**

Brand **Unknown**

Type / number of model **SKU No.1104545, Style No: 1104473**

Risk type **Burns**

Risk description **The product poses a serious risk of scalding because leaks may occur from the neck and/or base whilst the hot bottle is in use. In particular, the following non-compliances with the relevant British standard occurred during the testing: - the stopper separates from the ferrule at 370N and 350N respectively in less than 5 minutes where as the requirement is 500N; - the strength of bonded or welded seams does not reach the required tensile force of 72N.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary recall from consumers.
Other**

Alert number **0758/06**



Notifying country **Sweden**

Product category **Toys**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **5743210701729**

Product description **Wire Intercom (Phone set made of plastic. Two pieces connected with wire)Type/number of model: Suppliers item No. 704901**

Risk type **Damage to hearing**

Risk description **This product poses a serious risk of damage to hearing because the sound level was found to be 124 dB which is considerable higher than the allowed 80 dB. The tests have been performed by the importer. This toy does not comply with the Toys Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary actions taken by the importer: stop of placing of the product on the market, withdrawal from the market.
Other**

Alert number **0757/06**



Notifying country **United Kingdom**

Product category **Machinery**

Type **Consumer**

Product ** **

Name **Rotary Hammer Drill “Performance Power”**

Brand **Unknown**

Type / number of model **NLH1050SDS**

Barcode **05075294, 05096510**

Risk type **Injuries**


Risk description **This product poses a risk of a broken wrist, hand, fingers and/or facial injuries. The handle disengages from the secure mounting on the drill body, rotating rapidly around it. Given that the user would probably be gripping both this handle and the rear handle, there is a risk of injury as the two handles suddenly rotate with considerable force in relationship to each other. The product does not comply with the Machinery Directive and the relevant European standard EN 60745. 9 incidents have been recorded varying from broken fingers to facial damage.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Recall by the importer
Other**

Measures taken by economic operators

Other : Recall by the importer
Other

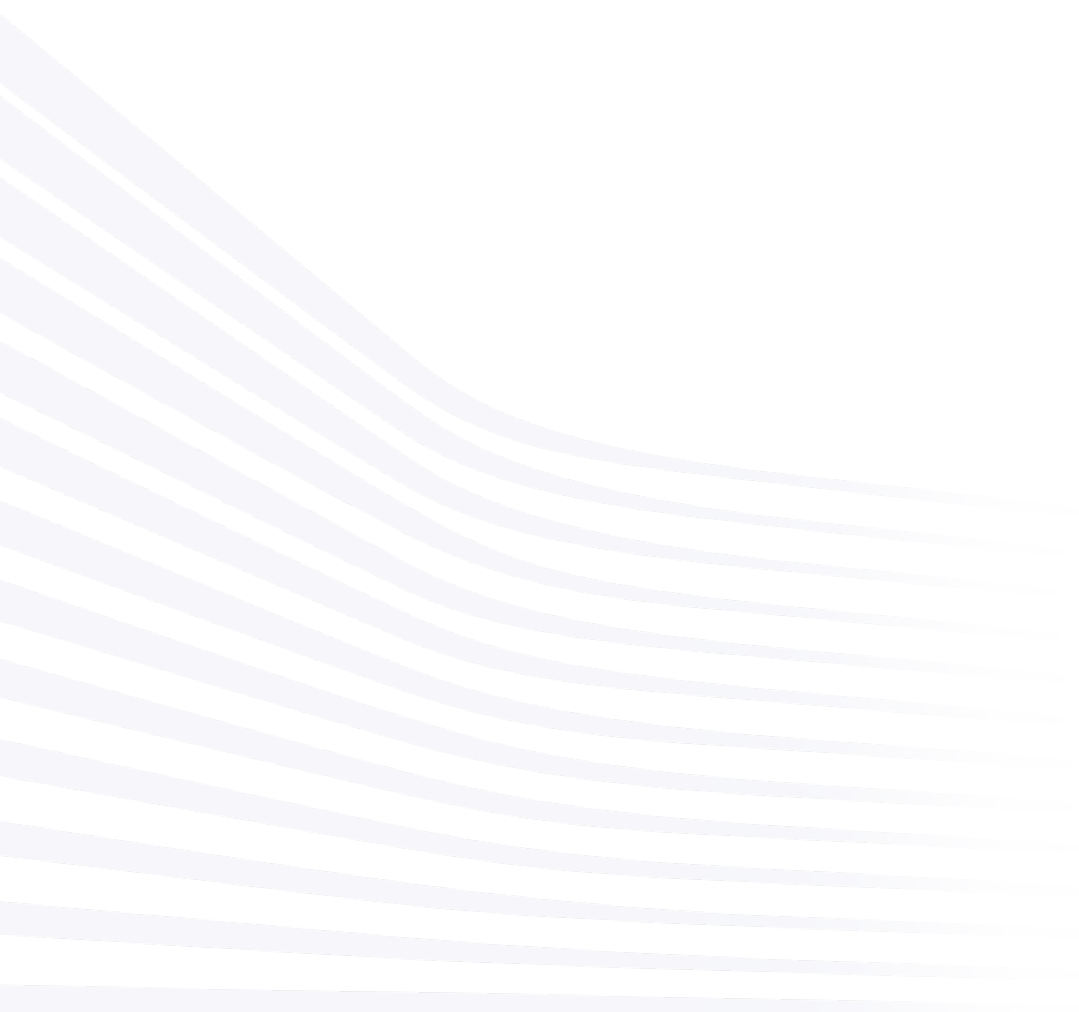

Alert number **0756/06**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **FIAT Stilo passenger car**

Brand **Fiat**

EC-type approval/model **Stilo, type 192**

Product description **Type approval e3*98/14*0089*.Description: The vehicles concerned are those of the model years 2001 to 2006.**

Risk type **Injuries**

Risk description **The product poses a risk of accident and injury because the front axle springs can break, come in contact with and damage the tyres. Road salt deposits on the spring plate can cause severe corrosion and fracture the spring. The broken spring may touch the tyres and damage them. Some cases of damage to the vehicle have been reported.**

Country of origin **Italy**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the producer.
Other**

Alert number **[0755/06](#)**



Notifying country **Sweden**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Floating leisure articles “Intex” (full size only)**

Brand **Unknown**

Type / number of model **Unknown**

Risk type **Chemical**

Risk description **This product poses a chemical risk because it contains 30% DEHP (softener) which is classified as toxic for reproduction and which may impair fertility and may cause harm to the unborn child. This product is dangerous in particular to young children.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban ordered by the authority.
Other**

Alert number **0754/06**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Brand **Honda**

EC-type approval/model **CIVIC 4 door, CIVIC 5 door**

Product description **Electronic Power Steering (EPS) control unit in Honda cars**
Description: The recall concerns the following vehicles:
2006 Civic 5 Door
(SHHFK1*6U000101~SHHFK1***6U003998;**
SHHFK2*6U000101 ~ SHHFK2***6U009998;**
SHHFK3*6U000101~ SHHFK3***6U009351) manufactured**
between 13 September 2005 and 22 February 2006 and
2006 Civic 4 Door (JHMFD1*6S200022~**
JHMFD1*6S205130; JHMFD3***6S200009 ~**
JHMFD3*6S200874) manufactured between 1 September**
2005 and 26 January 2006.

Risk type **Injuries**

Risk description **The Electronic Power Steering (EPS) control unit can, in some cases, switch to fail safe mode while driving due to detection of abnormal current within the EPS control unit. If this occurs, there will be a sudden loss of power assistance and the driver will notice that the steering becomes very heavy without warning. The sudden loss of power assistance could lead to an accident and injury.**

Country of origin **United Kingdom**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer.**
Other

Alert number **0753/06**



Notifying country	Finland
Product category	Electrical appliances and equipment
Type	Consumer
Product	AC adaptor for TFT television/monitor “Denver” (television itself is not affected)
Brand	Unknown
Type / number of model	FJ-SW1210X
Barcode	5 700751 005299
Risk type	Electric shock
Risk description	The product poses a serious risk of electric shock because: - the insulation between the parts connected to the mains (primary circuit) and parts that can be touched by the user (secondary circuit) is not sufficient. In particular: - creepage distances and clearances in the mains transformer between the primary windings and secondary windings are less than 5mm/4 mm (measured a minimum of 0.4 mm); - the secondary circuit is accessible through the terminals. The product does not comply with the Low Voltage Directive and the relevant European standard EN 60065.
Country of origin	Unknown
Measures ordered by public authorities	Other : Withdrawal from the market and recall from consumers ordered by the authority. Other

Alert number **0752/06**



Notifying country **Finland**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Battery charger for mobile phone**

Brand **Maxcall**

Type / number of model **KDN100B-15**

Risk type **Electric shock**

Risk description **- clearances/creepage distances in transformer T1 between the primary and the secondary windings are less than 4 mm /5 mm; - the secondary circuit is accessible through the output terminal. This product poses a serious risk of electric shock because there is not sufficient insulation between parts connected to the mains (primary circuit) and parts that can be touched by the user (secondary circuit). In particular: This product does not comply with the LVD Directive and the relevant European standard EN 60065.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Recall from consumers ordered by the authority.
Other**

Alert number **0751/06**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Brand **Unknown**

EC-type approval/model **Megane II 5 door, Megane II Convertible, Scenic II**

Product description **Seatback Frames in Renault cars
The recall concerns vehicles produced between 1 and 30 of September 2003 for Megane II Convertible, between 1 September and 31 October 2003 for Megane II 5door and between 1 August 2003 and 31 October 2003 for Scenic II.**

Risk type **Injuries**

Risk description **A deformation of front seatbacks of the two front seats may occur in the affected vehicles and this deformation could possibly affect the stability of the seatback in a case of an accident and result in injury.**

Country of origin **France**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer.
Other**

Alert number **0750/06**



Notifying country **Spain**

Product category **Machinery**

Type **Consumer**

Product **Belt sander “WORX”**

Brand **Unknown**

Type / number of model **WX90BS**

Risk type **Injuries**

Risk description **This product poses a serious risk of injuries (trapping, engagement and abrasion of the fingers) because: - the belt guard at the front means is too short thus the operator's fingers can easily come into contact with the sanding belt during operation. The gap left between the belt and the frame acting as the support base is wide enough to admit all the fingers and trap the hand between the (moving) sanding belt and the frame; - the machine did not pass the test required by the standard EN-60745-1, since, when it was dropped from a height of 1 m, the sanding-depth adjustment screw broke and the basic support structure and all of its fastener flanges were deformed, preventing it from being re-attached correctly; - the assembly and operating instructions are inadequate. This product does not comply with the Machinery Standard and Machinery Directive.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authority.**

Other

Alert number **[0749/06](#)**



Notifying country **Spain**

Product category **Lighting equipment**

Type **Consumer**

Product ** **

Brand **Unknown**

Type / number of model **SR 1801**

Barcode **8435109746566**

Product description **Portable lamp in the form of a penguin “SUNRISE-AJOK”**


Risk type **Electric shock**

Risk description **The product poses a serious risk of electric shock because there are no components to reduce the voltage on the active parts to 24V and the lamp's design is attractive to children. In particular, the lamp fails to comply with the relevant standards in the following ways: - children may regard this lamp as a toy, and although it must therefore run off a transformer or converter which supplies a voltage not exceeding 24V, the lamp does not comply with this requirement since it has no components to reduce the voltage to 24V and runs directly off the mains supply (230V); - the lamp does not bear certain required markings; - given its design and the lack of instructions it is not apparent how the bulb may readily be changed. The product does not comply with the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **People's Republic of China**

Measures ordered by public
authorities

**Other : Withdrawal from the market ordered by the
authority.
Other**

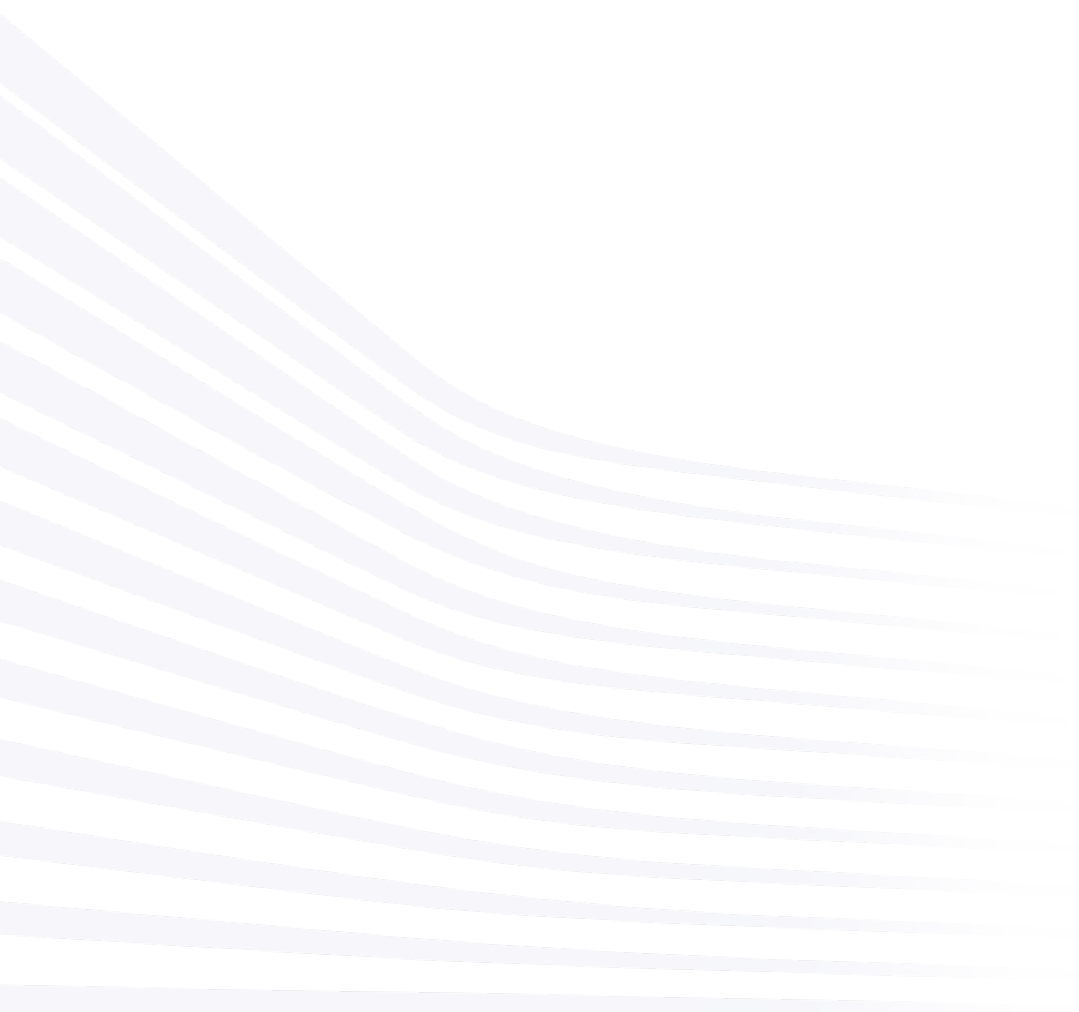

Alert number **0748/06**



Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Brand **Jeep**

EC-type approval/model **Grand Cherokee WG, Grand Cherokee WJ**

Product description **Heated Seat Elements in Jeep cars**
The recall concerns vehicles equipped with heated front seats built after 10 September 2002 for the WJ and after 24 January 2003 for the WG. The VIN/chassis numbers are: 1J8G2@8#?&Y* where @ = E or B, # = A or J or S, ? = 1 to 9 or X, & = 3 or 4 and * = production numbers of 6-digits.

Risk type **Fire**

Risk description **The product poses a risk of fire because the front seat electric heating elements may overheat and cause an interior fire.**

Country of origin **Austria**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer.
Other**