
Alert number **0593/07**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car - intermediate shaft in power-assisted steering in Renault Scenic II**

Brand **Renault**

EC-type approval/model **SCENIC II (LHD)**

Product description **The recall concerns vehicles produced from 13 June 2006 to 17 June 2006.**

Risk type **Injuries**


Risk description **In affected vehicles, there might be a malfunction in the intermediate shaft of the Power-Assisted Steering. This may cause a road accident, as the vehicle may be immobilised while being in motion.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number

0592/07

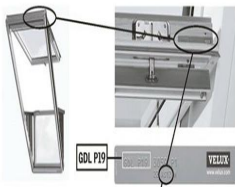

AR05, AR06, AR07, AR08, AR09, AR10, AR11, AR12, AS01, AS02, AS03, AS04,
AS05, AS06, AS07, AS08, AS09, AS10, AS11, AS12, AT01, AT02, AT03, AT04

Notifying country **Portugal**

Product category **Construction products**

Type **Consumer**

Product **Window-balcony**

Brand **Velux**

Type / number of model **GDL P19**

Product description **Window-balconies GDL P19 sold from 1 June 2005 to 16 April 2007. The window-balconies affected have the following information placed on the information plate, which is located on the upper frame: GDL P19 and one of the following codes: AR05, AR06, AR07, AR08, AR09, AR10, AR11, AR12, AS01, AS02, AS03, AS04, AS05, AS06, AS07, AS08, AS09, AS10, AS11, AS12, AT01, AT02, AT03 or AT04.**

Risk type **Injuries**

Risk description **The two screws used to attach the side railings are 1.6 mm too short, which means that they cannot be fixed securely to the nuts. When the window-balcony is opened and closed, the screws, which are on each side of the upper part of the side railings, can become loose and detach, rendering one (or both) side railings unsafe. The barrier is therefore inadequate, with the consequent risk of injury. As long as the nut is fastened/fitted to the screw, the structure of the railing remains intact but becomes loose. Despite being unstable the strength of the railing is unchanged. If one of the screws and nuts became detached, the side railing would remain unattached to the lower element.**

Country of origin

Unknown

Measures taken by economic operators

Other : Voluntary corrective actions taken by the importer
Other

Alert number **0591/07**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car - Anti-Lock Brake Control Module**

Brand **Ford**

EC-type approval/model **MAVERICK (LHD)**

Product description **The recall concerns FORD MAVERICK vehicles produced from 1 May 2003 to 23 January 2004 (produced in Ohio) and from 22 October 1999 to 19 December 2003 (produced in Kansas City).**

Risk type **Fire**

Risk description **The product poses a serious risk of fire since engineering investigations have identified a small percentage of Maverick vehicles that may have missing or dislodged wire seals in the Anti-Lock Brake System (ABS) Module connector. This condition could allow contamination to enter the module connector, creating a potential risk for an electrical short. An electrical short might cause an ABS malfunction that would illuminate the ABS warning light, and in extreme cases, the module may overheat resulting in a burning odour, smoke and/or fire.**

Country of origin **United States**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number **0590/07**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's garment set**

Brand **KEMAL**

Type / number of model **Unknown**

Product description **Pink children's garment set consisting of two pieces. The upper part has a hood with 60 cm long drawstring and a pompon and is decorated with two dogs and with the following text: Happy Puppy Life.**

Risk type **Suffocation**

Risk description **The drawstring provided with a hood in the upper part of the clothing may pose a risk of suffocation. The relevant European standard does not allow for use of knots, toggles and drawstrings in the hood of garments for young children. This product does not comply with the relevant European Standard EN 14682.**

Country of origin **Türkiye**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by the authorities
Other**

Alert number **0589/07**



Notifying country **The Netherlands**

Product category **Gas appliances and components**

Type **Consumer**

Product **Outdoor heater - Tristar Patio Heater**

Brand **Tristar**

Type / number of model **KA-5303 (code on packing), AB Stainless steel**

Product description **Unknown**

Risk type **Burns
Fire**


Risk description **This product poses a serious risk of burns and fire because:**
- the burner can not be ignited safely with a match, because the ignition opening is too remote from the pilot flame to ignite the appliance with a match; - repeated start-up problems can cause too large amounts of gas pouring out. Subsequently uncontrolled ignition can cause a burst of flame. Also is stated that ignition can take place at maximum capacity of the appliance (measured 10,7kW (Hs)); - when ignition occurs with a capacity of more than 5 kW (Hs) a burst of flame can come into being or the heat development can be so high that burning of clothing and/or skin can happen. This product does not comply with the Gas Appliances Directive and the relevant European standard EN 14543.

Country of origin **People's Republic of China**

Measures ordered by public **Other : Withdrawal from the market ordered by the**

authorities

authorities
Other

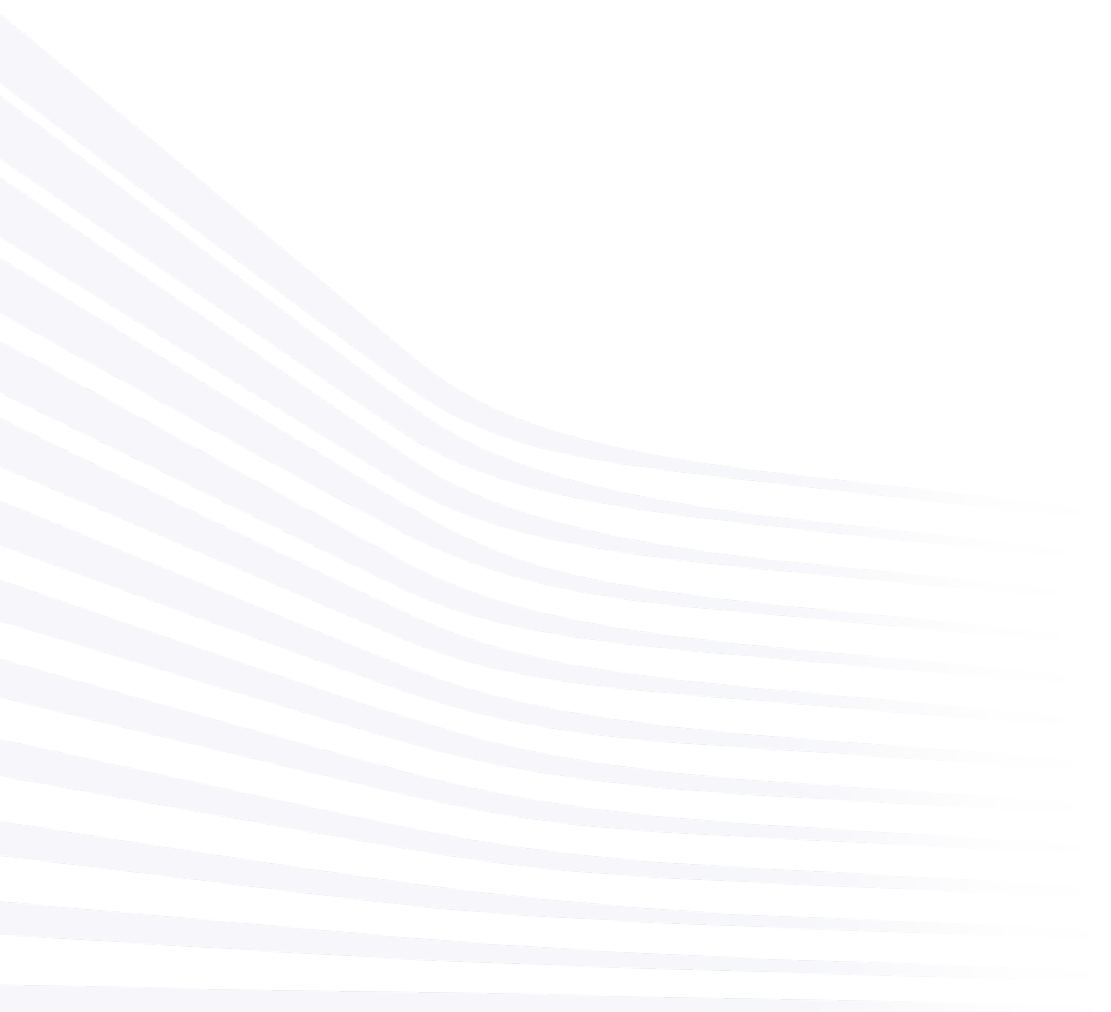

Alert number **0588/07**



Notifying country **Norway**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Pushchair - Stokke Xplory stroller**

Brand **Stokke Xplory**

Type / number of model **The affected components are two front wheels on some units of the Stokke Xplory strollers manufactured before June 2006. Affected serial numbers are: - risk of this defect : 1 to 27,295; 27,698 to 28,097; - no risk of this defect: 27,296 to 27,697; 28,098 and above. Serial numbers are placed on the bottom of the foot plate which is over the front wheels. Stokke Xplory strollers manufactured after June 2006 has another wheel construction and does not have this possible effect.**

Product description **Unknown**

Risk type **Injuries**

Risk description **This product poses a serious risk of injuries because the front wheel can become detached from the chassis as a consequence of weakening strength of the steel bolt/plate component.**

Country of origin **Norway**

Measures taken by economic operators **Other : Voluntary information to retailers and consumers and corrective actions taken by the manufacturer
Other**

Alert number **[0587/07](#)**



Notifying country	Poland
Product category	Childcare articles and children's equipment
Type	Consumer
Product	Baby walker / baby cradle
Brand	SUN Baby
Type / number of model	SB 807
Product description	It is a folding walker, made of light green coloured plastic. A playing part is in the shape of an elephant head, coloured white and red. There are multi-colour buttons which pressed, turn the musical boxes on. The saddle is covered by fabric. The product can be folded and used as a cradle. There are some stickers on the product There is a label attached to product with following information: "SUN baby®" and a picture of a baby head; CE marking, "Made in China"; some warnings in Polish and English; "Warning! Never leave a child without supervisory!" and "Not intended for children younger than 6 month". An appropriate user's manual is attached.
Risk type	Choking Injuries
Risk description	This product poses a serious risk of injuries because: - there is only one blocking device on folding and adjusting mechanism, which can be unintentionally released, causing a risk of folding with a child inside; - of possible losing stability while the child is moving backward, causing a risk of collapse; and of choking because of small construction parts, fixing the musical desk to the frame, which can be easily detached by using screwing force less then 0,34 Nm. Those parts fit completely into the small parts cylinder.

This product does not comply with the Toys Directive and the relevant European standards EN 71-1 and 1273.

Country of origin

People's Republic of China

Measures ordered by public authorities

**Other : Sales ban, withdrawal from the market and information to consumers ordered by the authorities. Press release has been issued.
Other**

Alert number **0586/07**



Notifying country **United Kingdom**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's garment - Teddy Overall**

Brand **Spirit of nature**

Type / number of model **1040**

Product description **Children's garment, "Teddy Overall", made from organic cotton fleece. Ribbed cuffs on sleeves and legs. Natural trim around hood and down front. Wooden buttons down the front. 100% organic cotton fleece.**

Risk type **Choking**

Risk description **This product poses a serious risk of choking because buttons on children's clothing, that may represent a choking hazard, should not become detached from a garment at a force less than 70 Newtons when applied for 10 seconds. This product has five buttons, which fits into the small parts cylinder. This product does not comply with the relevant standards.**

Country of origin **Germany**

Measures taken by economic operators **Other : Voluntary withdrawal from the market by the retailer
Other**

Alert number **0585/07**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car - Mazda Tribute**

Brand **MAZDA**

EC-type approval/model **Mazda Tribute (LHD). VINs range : - JMZ BU**** 1K M01609 - M01653; - JMZ CU**** 1K M01613 - M71964; - JMZ CU**** 2K M02430 - M66493; - JMZ CU**** 3K M01977 - M42399; - JMZ CU**** 4K M08220 - M34781.**

Product description **The recall concerns MAZDA Tribute vehicles, produced from 30 May 2000 through 18 December 2003.**

Risk type **Fire**

Risk description **This product poses a serious risk of fire because the Anti-Lock Brake System (ABS) Module connector may have missing or dislodged wire seals. This can allow contamination to enter the ABS electrical connector and cause corrosion of the electrical terminals. The corrosion gradually may result in an ABS malfunction that causes illuminating the ABS warning indicator lamp, blowing of fuses, and in some rare instances smoking or melting of the electrical connector, and/or fire. This can occur either when the vehicle ignition switch is in the off position or while the vehicle is being operated.**

Country of origin **Japan**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer. Press release has been issued.
Other**

Alert number **0584/07**



Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product **Yoyo toy - JO JO Mesh Squish Ball**

Brand **Unknown**

Type / number of model **EAN 8586666007512**

Product description **The toy Jo Jo mesh squish ball is packed at 24 pieces in the box. The ball is made from softened PVC in diameter of 4 cm in various colours. The ball is wrapped in a black net. The top is equipped with an elastic string with a loop for an entrapment by the finger. The length of the string including the loop is about 12 cm. Each ball is packed in a transparent plastic bag with affixed label containing data on origin, name of importer, CE marking, an unsuitable pictograph (graphics, size and colour), age limit and warnings. The box contains data about the product with a picture of two balls and titles in English language "Morph ball! Squishy stuff! Changeable colour! Squeeze it! An unpleasant smell of the toy is of chemical origin."**

Risk type **Chemical
Suffocation**

Risk description **This toy poses : - a serious risk of suffocation by strangulation because the string can be prolonged up to 120-600 mm depending on the way of its use. It poses a serious risk of strangulation due to possible entwining of the string around the neck of a child; - a chemical risk because it contains volatile chemical substances, including toluene, a- pinane, and ethyl benzene. These substances are harmful and irritating with a possible effect on the**

central nervous system. This toy does not comply with the Toys Directive and the relevant European standard EN 71-1.

Country of origin

People's Republic of China

Measures taken by economic operators

**Other : Voluntary stop of import and withdrawal from the market by the importer
Other**

Alert number **[0583/07](#)**



Notifying country **The Netherlands**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Portable water microfilter and replacement cartridge**

Brand **MSR MiniWorks**

Type / number of model **Model number: 35422 and 356210**

Product description **Weight: 16 oz./456 g. Dimensions:7.5 x 2.75 in./19 x 7 cm.
Cartridge Life: Up to 2000 litres, depending on water conditions.**

Risk type **Microbiological**

Risk description **This product poses a serious microbiological risk because it filters the bacteria for a period of only five days instead of the indicated lifetime of 2000 litres in the instruction manual.**

Country of origin **United States**

Measures taken by economic operators **Other : Voluntary information to consumers and corrective actions
Other**

Alert number **0582/07**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **One metre extension cord**

Brand **Leiva**

Type / number of model **Ref: 11981. Bar code: 8431487119817**

Product description **One metre extension cord. The packaging is a transparent plastic bag with a cardboard label carrying the following information: LEIVA ELECTRICIDAD, CE, CIF: B-96544788, 1 M extension cord, reference and bar code.**

Risk type **Fire**

Risk description **This product poses a serious risk of fire because: - dimensions of the socket are different from those indicated in the standard sheets; - it is possible to insert a plug with a higher rating into the socket. This product does not comply with the Low Voltage Directive.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authorities
Other**

Alert number [**0581/07**](#)

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Vans - Ford Transit**

Brand **Ford**

EC-type approval/model **Ford vans manufactured between 5 July 2006 and 12 July 2006**

Risk type **Injuries**

Risk description **This product poses a serious risk of injuries because the bolts of the front suspension lower arm may be tightened to the wrong specification or they may be damaged. Such a problem may result in the front suspension lower arm becoming partially detached from the substructure, which would affect the vehicle's steering and stability.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number **0580/07**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car - Ford Focus**

Brand **Ford**

EC-type approval/model **Ford Focus 1.6 Diesel and Ford Focus C-Max 1.6 Diesel.**

Product description **Ford vehicles built between 14 July 2004 and 22 February 2005**

Risk type **Injuries**

Risk description **This product poses a serious risk of injuries because a rigid fuel return pipe not corresponding to the specifications may have been installed. If the pipe is not replaced it may degrade, resulting in seepage of fuel. In extreme cases the pipe can become detached, resulting in more pronounced fuel seepage.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number **[0579/07](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car - Ford Transit**

Brand **Ford**

EC-type approval/model **Ford Transit - 2.4L Duratorq-TDCi (Puma) Diesel (115 PS, 125 PS, 135 PS)**

Product description **Ford Transit manufactured between 8 July 2004 and 23 August 2005 (with the bodywork assembly in Southampton)**

Risk type **Injuries**

Risk description **This product poses a serious risk of injuries because the timing belt tensioner does not correspond to specifications and may not function correctly, causing slack in the belt. As a result of this, the belt may jump over the teeth of the camshaft gear, causing contact between the valve and the piston and serious damage to the engine.**

Country of origin **Türkiye**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number **[0578/07](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car - Ford Focus C-Max**

Brand **Ford**

EC-type approval/model **Focus C-Max 1.6L Duratorq TDCi 110 PS**

Product description **Ford vehicles 'Focus C-Max 1.6L Duratorq TDCi 110 PS' manufactured between 27 February 2004 and 28 June 2004**

Risk type **Injuries**

Risk description **Investigations carried out have shown that in the batch of '1.6L Duratorq TDCi 110 PS' engines built into the Ford 'Focus C-MAX' vehicles in question, the oil feed holes between the cylinder head and the camshaft bearings may be misaligned, reducing the flow of oil to the camshaft bearings. Over time, this reduced oil flow could cause premature wear of the camshaft bearings and may also result in seizure of the engine without prior warning.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number **[0577/07](#)**



Notifying country **Portugal**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Crib**

Brand **TOYS 'R US Ltd**

Type / number of model **Ref.: "Mini Cuna Vermont" ("Mini Vermont Cradle")**

Product description **Crib with wooden frame**

Risk type **Injuries**

Risk description **This product poses a serious risk of injuries because: - the bars of the crib can break, allowing the baby to pass a part of its body through it and thus placing it at risk of becoming trapped; - there are no warnings and instruction manual in Portuguese. This product does not comply with the relevant European standard EN 1130.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authorities
Other**

Alert number **[0576/07](#)**



Notifying country	Slovakia
Product category	Toys
Type	Consumer
Product	Yoyo toy - JO JO puffer ball
Brand	Unknown
Type / number of model	EAN 8586666007499
Product description	The toy Jo Jo puffer balls are packed at 24 pieces in the box, however, according to the text on the box, the latter should contain 12 pieces. The ball is made from softened PVC in diameter of 4 cm in various colours with painted eyes, nose and mouth. The top is equipped with an elastic string of 10,5 cm length including a loop for an entrapment by the finger. It is flashing inside upon a hit. The card with marking and warnings is affixed to the string.
Risk type	Chemical Suffocation
Risk description	This toy poses: - a serious risk of suffocation by strangulation because the string can be prolonged up to 105-700 mm depending on the way of its use. So the toy represents a serious risk of strangulation by wrapping around the neck of a child; - a chemical risk because it contains volatile chemical substances, including toluene, a-pinane, and ethyl benzene. These substances are harmful and irritating with a possible effect on the central nervous system. In addition, the marking of the toy is not sufficient as concerns its size and visibility. This toy does not comply with the Toys Directive and the relevant European standard EN 71-1.

Country of origin

People's Republic of China

Measures taken by economic operators

Other : Voluntary stop of import and withdrawal from the market by the importer
Other

Alert number

0575/07



Notifying country **The Netherlands**

Product category **Cosmetics**

Type **Consumer**

Product **Deep moisturising shampoo**

Brand **Osmo Essence**

Type / number of model **Code 071021, bar code 5032435700731, batch code 1324**

Product description **Yellow plastic container with purple printed text and white transparent plastic screw cap. White coloured liquid. Volume 9.5 fl oz 280ml.**

Risk type **Chemical**


Risk description **This product poses a chemical risk because it contains 70 µg/kg of N-nitrosodiethanolamine, which is classified as human carcinogen and prohibited by the Cosmetics Directive 76/768/EEC.**

Country of origin **United Kingdom**

Measures taken by economic operators **Other : Administrative fine and sales ban ordered by the authorities. Voluntary withdrawal from the market
Other**

Alert number

0574/07

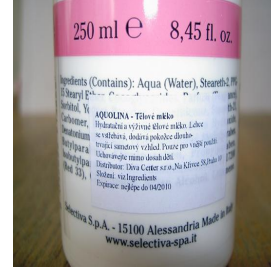

Notifying country

Czechia

Product category

Cosmetics

Type

Consumer

Product

Body lotion - Aquolina Latte Corpo containing yogurt fraganza frutti di bosco

Brand

Aquolina

Type / number of model

All batches

Product description

White plastic bottle with black lid, volume 250 ml, pictures of strawberries and/or wild strawberries and/or apricots and/or citruses and/or cherries and/or coconut and/or vanilla on the label. The products smell like a fruit. Contains warning labels.

Risk type

Chemical

Risk description

The products can be misused as food products because of their fruit yogurt aroma and the shape of packaging that resembles food. The product represents a serious health risk for children, as chemical pneumonia may develop after ingestion for following reasons. Unpleasant taste fortified by addition of denatonium benzoate (Bitrex) and the product formulation can stimulate vomiting after ingestion. Because of anatomical parameters of the apertura of larynx and aesophagus in small children, the vomited material can be more readily aspirated. The products contain detergents and emulsifiers in their formulations, i.e. active surface agents, which have toxic damaging effects on bronchial and lung alveolar tissues. The chemical damage is followed by inflammation, i.e. pneumonia caused by chemicals present in the product formulation

Country of origin

Italy

Measures ordered by public
authorities

**Other : Withdrawal from the market ordered by the
authorities
Other**

Alert number **0573/07**



Notifying country **Slovakia**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Three-way electrical adaptor**

Brand **EMOS**

Type / number of model **Type EF-7, EAN 8594043070042**

Product description **The product is white of 0,075 kg weight, packaged in a transparent bag closed with a card. Marking on the product concerning rated values for power supply: 16A/250V, on the sockets 10A/250V; 2,5A/250V, on the card 250V~, 3x250V~, S16A max with the text "the appliance complies with electrical safety".**

Risk type **Fire**


Risk description **This product poses a serious risk of fire because: - during the test, the product has changed resulting in a damage of insulating material protecting current-carrying parts, which may cause a direct contact with the current-carrying parts. The product is made from the material not resistant to heat; - the values provided on the product are not suitable for the current-carrying capacity and voltage; - marking of the product is missing. One incident has been reported. This product does not comply with the Low Voltage Directive and the relevant standards.**

Country of origin **People's Republic of China**

Measures ordered by public **Other : Sales ban and information to consumers ordered by**

authorities

the authorities
Other

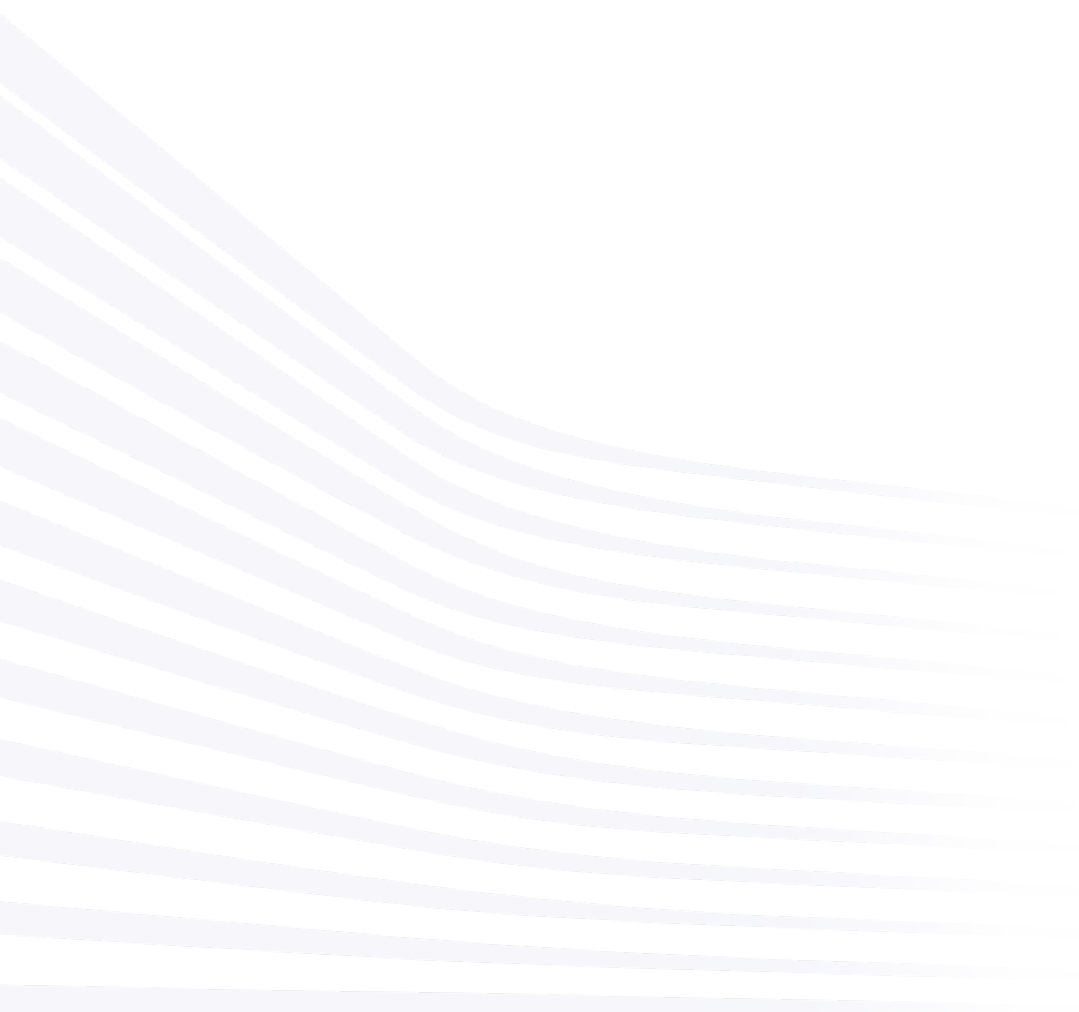

Alert number **[0572/07](#)**



Notifying country	United Kingdom
Product category	Protective equipment
Type	Consumer
Product	Gas alarm - plug-in carbon monoxide alarm
Brand	Proteam
Type / number of model	Item number HO1497 (LX-GS) and HO1227 (LX-GS). Batch codes: PO6/001400 and PO6/001474.
Product description	Alarm is sold singly (HO1227) or with an EU socket travel adaptor (HO1497). Clear plastic clam shell packaging. Product is approximately 115mm x 70mm x 30mm (excluding conductor pins) of white plastic with three small led marked 'power', 'state' and 'alarm'. Batch marking is on the rear of the alarm and not visible through unopened packaging.
Risk type	Asphyxiation
Risk description	This product poses a risk of poisoning and explosion because of its inability to detect a positive level of carbon monoxide resulting in a risk of undetected excessive carbon monoxide level. In addition, the markings and the instructions provided do not contain required warnings and information, in particular relating to how the alarm operates, to the action to be taken in the event the alarm sounds, and to the effects of carbon monoxide on the human body. This product does not comply with the European standard EN 50291.
Country of origin	People's Republic of China

Measures taken by economic operators

Other : Voluntary withdrawal from the market and recall from consumers by the manufacturer
Other



Alert number **0571/07**



Notifying country **Czechia**

Product category **Lighting equipment**

Type **Consumer**

Product **Portable table lamp**

Brand **TESCO**

Type / number of model **L 076**

Product description **Portable table lamp intended for internal use fitted by 1 bulb max 40W/E14. Parameters: 230V/50Hz, max 40W, Class II. Packing: imprinted paper box of dimensions 130x145x200 mm.**

Risk type **Electric shock**

Risk description **This product poses a serious risk of electric shock because: - insufficient cross section of internal and external wiring; - the supply conductor with basic insulation only can touch the accessible metal part; - the bulb socket is not secured against turning when bulb is replaced; - the parts intended to be hand-manipulated get overheated (external metal nut on the shield's surface); - instructions are missing, there is no instruction how to replace the supply cord. This product does not comply with the Low Voltage Directive and with the relevant European standard EN 60598.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban ordered by the authorities. Press release has been issued.
Other**

Alert number **0570/07**



Notifying country **Czechia**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Dummy for babies**

Brand **Latex Baby Nova**

Type / number of model **Model No 25533, Batch code 054734; EAN 40001071255333**

Product description **Latex dummy in blister package containing 2 peaces**

Risk type **Chemical**

Risk description **This product poses a chemical risk because the latex teat of the dummy has positive evidence of thiosulphates. Products intended to touch food and meal must have negative evidence of thiosulphates. This product does not comply with the hygienic requirements set up in the European standard EN 1400-1.**

Country of origin **Germany**

Measures ordered by public authorities **Other : Sales ban ordered by the authorities
Other**

Alert number

0569/07



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's waistcoat with lining**

Brand **QI FENG**

Type / number of model **5149-B**

Product description **Girl's waistcoat with lining, zip-fastener and a hood. The hood is supplied with an elastic drawstring and a plastic toggle. Size: 128.**

Risk type **Injuries
Suffocation**

Risk description **This product poses a serious risk of : - suffocation by strangulation because of the elastic drawstring and plastic toggles provided with the hood. The use of toggles and drawstrings is not allowed in the hood of garments for young children; - injuries because when pulling the string, the plastic toggle may cause injury on the child's face or to the eye. This product does not comply with the relevant European standard EN 14682.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by the authorities
Other**

Alert number

0568/07



Notifying country

Germany

Product category

Electrical appliances and equipment

Type

Consumer

Product

Electric fly-swatter (with 220 V mains connection)

Brand

Tianye

Type / number of model

Serial No: ZL 00207306.4; EAN 6938308400014

Product description

Length: approximately 46 cm. Width: approximately 18 cm. The rechargeable batteries in the fly-swatter are charged from the mains using an adaptor.

Risk type

Electric shock

Risk description

This product poses a serious risk of electric shock because the pins of the mains adaptor are exposed. In order to charge the battery in the handle of the swatter, an adaptor-plug for German mains sockets must be used. There is a risk of contact with the live pins on the handle. In addition, warnings and instructions in German are missing. This product does not comply with the Low Voltage Directive and with the relevant standard.

Country of origin


People's Republic of China

Measures ordered by public authorities

**Other : Withdrawal from the market ordered by the authorities. Destruction of the product by the retailer
 Other**

Alert number

0567/07

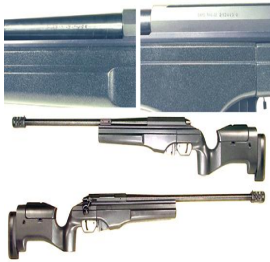

Notifying country

Finland

Product category

Hobby/sports equipment

Type

Consumer

Product

SAKO TRG rifle

Brand

SAKO

Type / number of model

Sako TRG-22, Sako TRG-42, Sako M995 (TRG-S)

Product description

The recall covers Sako TRG-22, Sako TRG-42 and Sako M995 (TRG-S) rifles manufactured between October 1999 and October 2002. TRG-22 and TRG-42: sharp shooting rifle, green or black synthetic stock, black barrel, overall length 1150-1200 mm; Sako M995 (TRG-S): hunting rifle, black synthetic stock, black barrel, overall length 1120-1200 mm. Calibers: 25-06 Rem, 270 Win, 284 Firebird, 7mm Rem Mag, 308 Win, 30-06 Sprg, 300 Win Mag, 308 Warbird, 30-378 Weath Mag, 338 Win Mag, 338 Lapua Mag, 9.3x62, 375 H&H Mag.

Risk type

Injuries

Risk description

There is a risk that when the rifle is fired with a defective cartridge - either because it was reloaded or because the cartridge had a primer that pierced upon detonation - the rearward gas escape might cause a broken portion of the firing pin to exit the rear portion of the rifle towards the shooter. No actual accidents happened but one incident was confirmed in Italy and one in Canada. Ejected firing pin may cause injury to the shooter, especially if the shooter is firing the rifle without use of protective safety glasses.

Country of origin

Finland

Measures taken by economic operators

Other : Voluntary recall from consumers and corrective actions by the manufacturer
Other

Alert number **0566/07**



Notifying country **Czechia**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Plug-in three-way socket**

Brand **EMOS, BEN Electronic**

Type / number of model **EF-7, EAN 8594043070042**

Product description **Plug-in three-way socket. Parameters: AC 250V 16A**

Risk type **Fire**

Risk description **This product poses a risk of fire because: - the dimensions of the pole socket are out of tolerance and the diameter of a hole is insufficient; - the socket and plug temperature rise is over the limit**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban ordered by the authorities
Other**

Alert number

0565/07



Notifying country

Hungary

Product category

Clothing, textiles and fashion items

Type

Consumer

Product

Children's garment set

Brand

WANDUNG

Type / number of model

2429

Product description

Pink children's garment set consisting of two pieces, the upper has a hood with 80 cm long elastic drawstring and a plastic toggle. The upper is decorated with a dog pattern on the left side. Size: 110.

Risk type

**Cuts
Suffocation**

Risk description

The elastic drawstring and plastic toggle provided with a hood in the upper part of the clothing may pose a risk of suffocation and cuts. When pulling the string the plastic toggle may cause injuries on the child's face or to the eye. The relevant European standard does not allow for use of toggles and drawstrings in the hood of garments for young children. This product does not comply with the relevant European standard EN 14682.

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Other : Withdrawal from the market and recall from consumers ordered by the authorities
Other**

Alert number **0564/07**



Notifying country **Germany**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Multiple socket**

Brand **Unknown**

Type / number of model **ZOY-DB03K, EAN 8712879427018**

Product description **3-way socket strip, white, with switch, screw fittings, 1.5m mains cable, in plastic pouch**

Risk type **Electric shock**

Risk description **The product poses a serious risk of electric shock because :
- length of protective conductor is insufficient; - connection points of flexible mains cable are soldered; - gap between protective conductor contacts is too wide; - protective conductor lead cross-section is <math><0.75 \text{ mm}^2</math>; - excessive temperature rise during overheating test. This product does not comply with the Low Voltage Directive and the relevant standards.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary withdrawal from the market by the retailer
Other**

Alert number **0563/07**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Quilted baby's coat**

Brand **Leo-poldi**

Type / number of model **109-0232**

Product description **Light blue baby's coat with a hood. There is a drawstring applied in the hood with a knot on the end. Size: 62-68.**

Risk type **Suffocation**

Risk description **This product poses a serious risk of suffocation by strangulation because of the elastic drawstring and plastic toggles provided with the hood. This product does not comply with the relevant European standard EN 14682.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by the authorities
Other**

Alert number **0562/07**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Balloons**

Brand **Flower Balloons**

Type / number of model **10074. EAN 8420698100745**

Product description **Set of colourful balloons with accessory for creating shapes and with mouth-piece**

Risk type **Choking**

Risk description **This toy poses a serious risk of choking because it contains a piece which fits into the small part test cylinder. As a result of spontaneous inhalation children can suffocate. This toy does not comply with the Toys Directive and the relevant European standard EN 71-1.**

Country of origin **Spain**

Measures ordered by public authorities **Other : Sales ban ordered by the authorities
Other**

Alert number **0561/07**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's waistcoat with lining**

Brand **DI SHENG**

Type / number of model **G16**

Product description **White waistcoat with orange lining and a hood. In the hood, there is an elastic drawstring and a plastic toggle. The waistcoat is closable with press-studs.**

Risk type **Injuries
Suffocation**

Risk description **This product poses a serious risk of: - suffocation by strangulation because of the elastic drawstring and plastic toggles provided with the hood; - injuries when pulling the string the plastic toggle may cause injury on the child's face or to the eye. This product does not comply with the relevant European Standard EN 14682.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market and recall from consumers ordered by the authorities
Other**

Alert number **0560/07**

Notifying country **Spain**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Brand **SUZUKI**

EC-type approval/model **Model VZR 1800 K7**

Product description **Unknown**

Risk type **Fire**

Risk description **This product poses a risk of fire because due to incorrect fastening of the fuel pipe, fuel leaks may occur.**

Country of origin **Japan**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number **0559/07**



Notifying country **United Kingdom**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Swing for children - Mattel Inc., Rainforest Open Top Take-along Swing**

Brand **Fisher - Price**

Type / number of model **K7203, K7192, K7195**

Product description **Metal frame with upholstered plastic seat; in cardboard packaging**

Risk type **Injuries**

Risk description **Infants can shift to one side of the swing and become caught between the frame and seat, posing an entrapment hazard. So far, 55 reports of the infants becoming entrapped resulting in cuts, bumps, bruises and red marks.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary withdrawal from the market, recall from consumers and information to consumers
Other**

Alert number

0558/07



Notifying country **Finland**

Product category **Toys**

Type **Consumer**

Product **Soft toy**

Brand **Tiimari, Makaava pupu**

Type / number of model **Tiimari article code No: 37327, EAN code: 6417564373275**

Product description **Soft toy rabbit with a bow around the neck**

Risk type **Chemical**

Risk description **This toy poses a chemical risk because the bow contains 58 mg/kg of formaldehyde, which exceeds the allowed maximum limit of 30 mg/kg. This toy does not comply with the Toy Safety Directive and the relevant standard EN 71.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary recall of the product and corrective actions by the importer
Other**

Alert number **0557/07**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product **"SPIDER-MAN" play set**

Brand **Unknown**

Type / number of model **NO:8827**

Product description **Toy set includes: black and brown pistols with inscription on it NO:559, three resiliency suction projectiles, handcuff, grenade, knife, radio-telephone, canteen, binoculars, truncheon and target. The toy is sold in a cardboard display box and label on it. Warning SPIDER-MAN. Probably counterfeited product.**

Risk type **Injuries**

Risk description **This toy poses a risk of injuries to children because during the traction test, suction cups detached from arrows when a force of 60 N + 2 N was applied. This toy does not comply with the Toys Directive and the relevant European standard EN-71.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Other : Sales ban and withdrawal from the market ordered by the authorities
Other**

Alert number **0556/07**

Notifying country **Austria**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle KTM**

Brand **KTM**

EC-type approval/model **- KTM 990 Adventure ABS - model year 2007 - KTM 990 Adventure S - model year 2007 - KTM 950 Superenduro-R - model year 2007**

Product description **Unknown**

Risk type **Injuries**

Risk description **These motorcycles pose a risk of injuries due to loose fixing screws on the chain sliding guard. If the upper screw becomes completely unscrewed, there is a danger that the chain sliding guard could block the chain, causing the motorcycle to crash.**

Country of origin **Austria**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the manufacturer
Other**

Alert number **0555/07**

Notifying country **Poland**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car - Fiat Ducato and Multipla**

Brand **Fiat**

EC-type approval/model **Fiat Ducato X2/44 with 2,8 JTD engine and Fiat Multipla 1,9 Multijet engines**

Product description **Fiat Ducato produced in the period between May 2005 and August 2006 of series from type 0760384 to 07842474. Fiat Multipla produced in period between September 2005 and January 2007 of series from type 02243474 to 02296615.**

Risk type **Fire**

Risk description **These vehicles pose a risk of injuries because the sound insulation of the engine chamber can overheat and ultimately catch fire.**

Country of origin **Italy**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer
Other**

Alert number **0554/07**



Notifying country **Portugal**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Crib**

Brand **El Corte Inglés**

Type / number of model **Code: 05372212257**

Product description **Crib with wooden frame and fabric**

Risk type **Injuries
Suffocation**

Risk description **This product poses a risk of injuries and suffocation because: - it has four wheels that did not lock when tested (this requirement is intended to prevent a child inadvertently pushing the crib when a baby is inside it); - the average thickness of a packaging was 0.027 mm while the minimum required thickness is 0.038 mm (risk of suffocation); - there are no instructions in Portuguese; - there is no warning "Warning: do not use when child is able to sit, kneel or stand up unaided", which is intended to prevent the risk of falls, since cribs are usually designed for very small children and are not safe for children who can stand up or climb out, as they may topple over. This product does not comply with the relevant European standard.**

Country of origin **Unknown**

Measures ordered by public **Other : Withdrawal from the market ordered by the**

authorities

authorities
Other



Alert number **[0553/07](#)**



Notifying country	Portugal
Product category	Childcare articles and children's equipment
Type	Consumer
Product	Crib
Brand	Pauma BB-03
Type / number of model	Unknown
Product description	Crib with wooden frame
Risk type	Injuries Suffocation
Risk description	This product poses a serious risk of injuries because: - the rocking system has a locking mechanism which could be operated with a residual force of lower than 50 N. The piece of wood used as a brake is not secured and it was not possible to measure the force needed to unlock the rocking system because the piece became dislodged with a gentle tap. This could enable a small child to release the crib while a baby is in it, creating the potential for it to overturn when a child pushes it inadvertently, which could cause the baby to fall; - one of the top parts became detached, revealing low resistance to impact and opening up a space in which a baby's fingers could become trapped; - there is no marking : "Warning: do not use when child is able to sit, kneel or stand up unaided". This warning is intended to prevent the risk of falls, since cribs are usually designed for very small children and are not safe for children who can stand up or climb out, as they may topple over; and of suffocation because the average thickness of the packaging is 0.028 mm (lower than the minimum of 0.038 mm) and there is no warning on the risk of suffocation. This

product does not comply with the relevant European standard EN 1130.

Country of origin


Unknown

Measures ordered by public authorities

**Other : Withdrawal from the market
Other**

Measures taken by economic operators

**Other : Withdrawal from the market
Other**

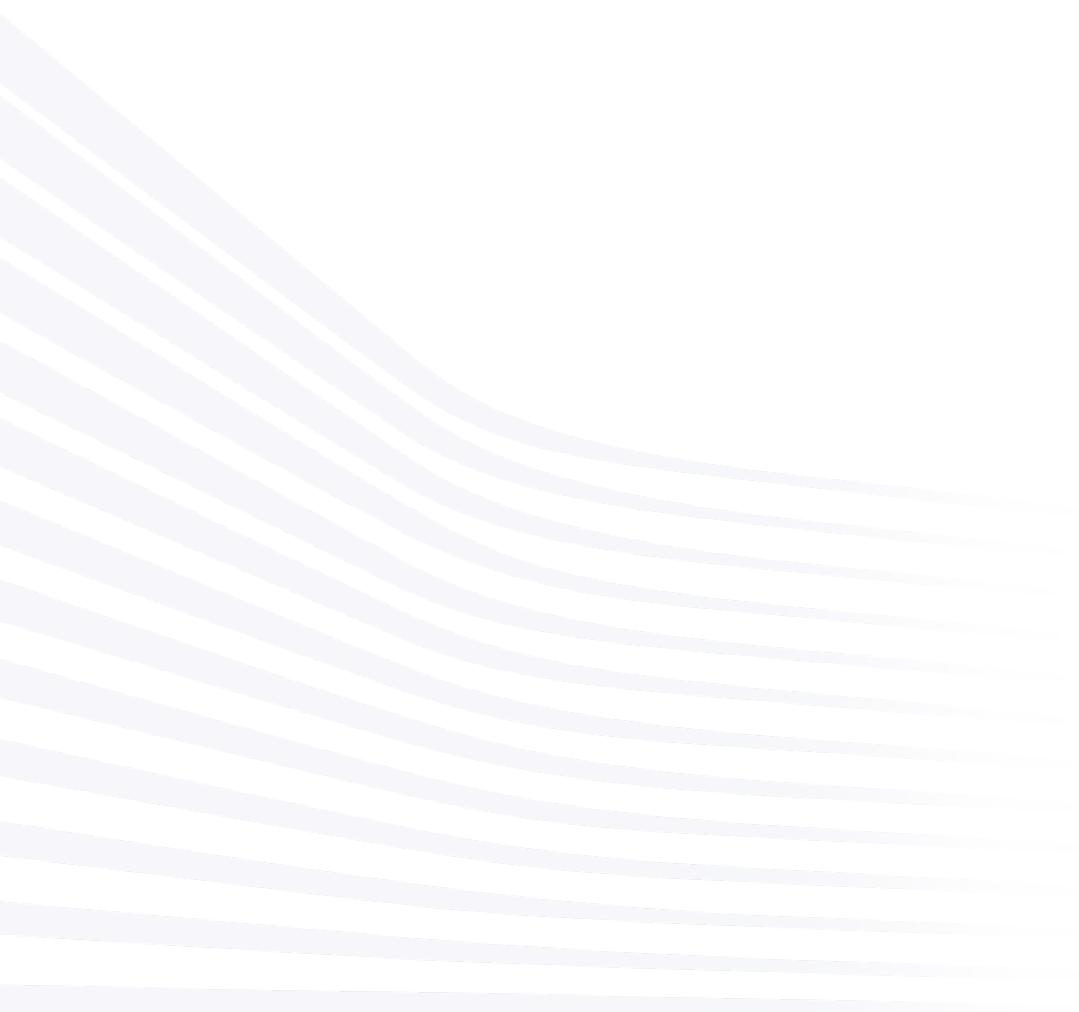

Alert number **0552/07**



Notifying country **Germany**

Product category **Cosmetics**

Type **Consumer**

Product **Nail polish - "OPI Nail Lacquer 15ml, No C 09"**

Brand **OPI**

Type / number of model **No C 09, "POMPEI - PURPLE", 940261/F62232WR**

Product description **Printed and labelled glass phial with application brush and plastic screw top, 15 ml**

Risk type **Chemical**

Risk description **is product poses a chemical risk because it contains 0.62 % of dibutyl phthalate, which is prohibited in cosmetics. Dibutyl phthalate may cause harm to an unborn child and possibly pose a risk of impaired fertility. Phthalates have a negative effect on the development of male/female reproductive organs. This product does not comply with the Cosmetics Directive 76/768/EEC.**

Country of origin **United States**

Measures taken by economic operators **Other : Voluntary withdrawal from the market by the distributor
Other**

Alert number

0551/07



Notifying country

Germany

Product category

Electrical appliances and equipment

Type

Consumer

Product

Wireless switch unit

Brand

ELRO

Type / number of model

Flamingo ELRO AB400S 6899S, Lot No 02A06, EAN 8711658285191

Risk type

Fire

Risk description

This product poses a serious risk of fire because: - the distance between the protective contacts is too large; - the unit caught fire during the stress test: the temperature of the contacts increased by up to 150K. In addition, the declaration of conformity refers to standard not applicable to these types of product. This product does not comply with the Low Voltage Directive and the relevant standard.

Country of origin

People's Republic of China

Measures ordered by public authorities

**Other : Sales ban and recall from consumers ordered by the authorities
Other**

Alert number **0550/07**



Notifying country	Spain
Product category	Toys
Type	Consumer
Product	Blister pack with crossbow, bow and four arrows with suction cups
Brand	Unknown
Type / number of model	Type No: 397, item No: 44263, bar code: 8436019644263
Product description	There is a label on the back of the blister pack with the bar code, importer identification, CE marking and the wording “Not suitable for children under three years of age due to small parts that may be swallowed” and “Keep packaging and instructions”.
Risk type	Choking
Risk description	This product poses a risk of choking to children because during the tests, a suction cup became detached when a tensile force of less than 60 N was applied. Once the suction cups become detached, they pose a risk of choking to children. This risk becomes more serious given that children usually lick the suction cups to wet them to increase their ability to stick to the surface that will be hit. In addition, this toy does not contain the following warning “WARNING: Do not aim at eyes or face”. This product does not comply with the Toys Directive and the relevant European standard EN 71-1.
Country of origin	People's Republic of China

Measures ordered by public
authorities

**Other : Withdrawal from the market ordered by the
authorities
Other**

