

Alert number 0263/06



Notifying country Hungary

Product category Lighting equipment

Type Consumer

Product

Brand Unknown

Type / number of model QW-TL00138-7

Product description Desk lamp "Tiffany"

Risk type Electric shock

Risk description This product poses a risk of electric shock because the wireways are lead through sharp and burring edges, and thus the cable may get damaged. Moreover, at the cable inlet of the E 14 lamp holder the nipple is not locked, not secured against loosening and there is no indication of Class II. This product does not comply with the LVD Directive and the relevant European Standards.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0262/06

Notifying country	Germany
Product category	Motor vehicles
Type	Consumer
Product	Passenger car
Name	GM Daewoo Auto & Technology Company/Korea
Brand	Daewoo
Product description	Sales designation Matiz or M100/M200 or Zitto or d'Arts or Spark; Vehicle type Klya, EU type approval e4*2001/116*0028. Description: The recall concerns vehicles built in 2005 with vehicle identification numbers 5C041024 to 5C078655.
Risk type	Injuries
Risk description	If the passenger airbag is activated, the gas generator can become detached from the housing, leading to an increased risk of injury.
Country of origin	Republic of Korea
Measures taken by economic operators	Other : Voluntary corrective action taken by the producer. Other

Alert number 0261/06



Notifying country Germany

Product category Lighting equipment

Type Consumer

Product

Brand Unknown

Type / number of model TerraPlus Comfort Clamp Lamp 250 W

Barcode 4037797009059

Product description Clamp-type reflector lamp for terrarium "TerraPlus & Euro Zoo"

Risk type Electric shock

Risk description There is an extreme risk of a lethal electric shock when changing the bulb if that the power plug is inserted in the power outlet in such a way that the L-conductor (live) touches the threaded bulb holder and the user touches the base of the lamp or the screw thread on the bulb holder when changing the bulb. The appliance did not pass the test for electric shocks. The base of the bulb holder could be accessed with the test finger. The lamp is not fitted with a strain relief device. Lamps equipped with a mains lead must include a strain release device that prevents the connecting cable being pulled or twisted at points of entry and protects the cable insulation from wear and tear. This product does not comply

with the LVD Directive and the European Standard.

Country of origin People's Republic of China

Measures taken by
economic operators Other : Placing of the product on the market has been
voluntarily stopped by the importer.
Other

Alert number 0260/06



Notifying country	United Kingdom
Product category	Toys
Type	Consumer
Product	
Brand	Unknown
Type / number of model	Unknown
Product description	Flashing Multi-glow mouth and teeth. Remark: Product bears following inscription "Warning - choking hazard - small parts. Not for children under 12 years". "For ages 12+ years." CE Marked.
Risk type	Choking
Risk description	Parts that are small enough to fit inside truncated cylinder could be pulled from the mouth actuated toy. The detached parts constitute a potential choking hazard. The provisions relating to mouth actuated toys apply regardless of the age of the child. Product does not comply with the Toy Directive and the relevant European standard.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from the market by the supplier. Other

Alert number 0259/06



Notifying country	United Kingdom
Product category	Toys
Type	Consumer
Product	
Brand	Unknown
Type / number of model	Unknown
Product description	Flashing Nursing Bottle. Remark: the labelling includes a graphical age restriction warning 0-6 and 'warning - choking hazard - small parts. Not for children under 6 years'. 'For ages 6+ years.' CE Marked.
Risk type	Choking
Risk description	Small parts which fit into the small parts cylinder could be detached from the toy. Provisions relating to mouth actuated toys apply regardless of the age of the child. This product does not comply with the Toys Directive and the relevant European Standards.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from sale. Other


Alert number 0259/06



Notifying country	United Kingdom
Product category	Toys
Type	Consumer
Product	
Brand	Unknown
Type / number of model	Unknown
Product description	Flashing Nursing Bottle. Remark: the labelling includes a graphical age restriction warning 0-6 and 'warning - choking hazard - small parts. Not for children under 6 years'. 'For ages 6+ years.' CE Marked.
Risk type	Choking
Risk description	Small parts which fit into the small parts cylinder could be detached from the toy. Provisions relating to mouth actuated toys apply regardless of the age of the child. This product does not comply with the Toys Directive and the relevant European Standards.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from sale. Other

Alert number	<u>0258/06</u>
Notifying country	Greece
Product category	Motor vehicles
Type	Consumer
Product	Passenger car
Brand	Honda
EC-type approval/model	70200-SN7-ZS00 (for Accord), 70200-ST3-ST3 (for Civic)
Product description	<p>Car sunroof "Honda Accord 4d and Civic 5d" The recall concerns the following vehicles: Honda Accord 4d Year Model: 94-96 (Model Code CC7, CE7 ,CE8, CE9).VIN Range: SHHCC7***0U145553 - SHHCC7 ***0U146243SHHCE7***0U000161 - SHHCE7***0U011364SHHCE8***0U000101 - SHHCE8***0U009976SHHCE9 ***0U000105 - SHHCE9***0U002089.Honda Civic 5d Year Model: 95-96 (Model Code MA8, MA9, MB1).VIN Range: SHHMA8***0U026602 - SHHMA8 ***0U120747SHHMA9 ***0U100101 - SHHMA9 *** 0U108801SHHMB1 *** 0U100101 - SHHMB1***0U112285.</p>
Risk type	Injuries
Risk description	Sunroof glass may detach from frame while driving and cause an accident to the nearby coming vehicles.
Country of origin	United Kingdom
Measures taken by economic operators	Other : Voluntary corrective action taken by the importer. Other

Alert number 0257/06

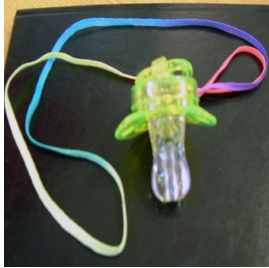

Notifying country	United Kingdom
Product category	Toys
Type	Consumer
Product	
Brand	Unknown
Type / number of model	Unknown
Product description	Flashing whistle in shape of a dummy.
Risk type	Choking
Risk description	Small parts which fit into the small parts cylinder could be detached from the toy. Provisions relating to mouth actuated toys apply regardless of the age of the child. This product does not comply with the Toys Directive and the relevant European Standards.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from sale. Other

Alert number 0256/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Product description Electrical 4-slice toaster "STAHLMANN"Type/model: ST-304.

Risk type Electric shock
Fire

Risk description This product poses a risk of electric shock because the internal wires are pressed against sharp, burring edges and they can get under the moving parts of the operating part-ejector, the insulation may get damaged. There is a risk of fire because the temperature rise of the mains cable is higher than the maximum permitted value of the standard. This product does not comply with the LVD Directive and the relevant European Standards

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0255/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Type / number of model SN-2507

Product description Electrical 2-slice toaster "SANUSY"

Risk type Electric shock

Risk description Product poses a risk of electric shock due to non-compliant protection, internal wiring and connection to mains supply: - the product is of Class II and the heating elements are accessible by test finger; - the internal wires are pressed against sharp, burring edges and they can get under the moving parts of the operating part-ejector as a result of which the insulation may get injured; - the plug is of non-standardized type with a small cross section area. Product does not comply with the LVD and the relevant European standard EN 60335.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal of the product from the market ordered by the authority.

Other

Alert number 0254/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Product description Electrical 4-slice toaster "TZS FIRST AUSTRIA"Type/model: FA-5367-CH (BH-003b).

Risk type Electric shock
Fire

Risk description This product poses risk of electric shock because the wires connected to the switch may get under the moving part of the operating and timer-ejecting device, the insulation may get damaged, the mains cable is not fixed properly (it can be pushed into/ pulled out of the appliance through its cord anchorage). The product presents risk of fire because the temperature rise of the core insulation of the PVC cable is 78,1K while the maximum allowed value is 50 K. Moreover, the connection shoe of the protective earth can be dismantled with hand, and is not secured against loosening. This product does not comply with the LVD Directive and the relevant European Standards.

Country of origin Unknown

Measures ordered by public Other : Withdrawal from the market ordered by the authority.

authorities Other



Alert number 0253/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Type / number of model EU-5556

Product description Electrical steam iron "EUROTEC"

Risk type Fire

Risk description Product poses a risk of fire because: -during the test of abnormal operation the product emitted dangerous amount of smoke, flame and melted metal and the fire had to be put out; -there is no thermal cut-out or temperature control built into the product. Product does not comply with the LVD and the relevant European standard EN 60335.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal of the product from the market ordered by the authority.
Other

Alert number 0252/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Type / number of model PI-002

Barcode 8558/3947, EAN 5060061910538

Product description Electrical steam iron "PACIFIC"

Risk type Electric shock

Risk description The Hungarian distributor has replaced the English type of the plug, in such a way that the end of the protective earth was cut off instead of connecting it into the plug. Therefore the continuity of the protective earth is broken in the plug. The protective earth was not connected with the earth contact. The dimensions of the earth contact are less than the minimum required value. Moreover, the Hungarian instructions for use are different from the foreign version in its content. Certain warnings are also missing. This product does not comply with the LVD Directive and the relevant European Standards.

Country of origin Hungary

Measures ordered by public
authorities

Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0251/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Product description Electrical dry iron with spray "ELCO"Type/model: EL-194G.

Risk type Electric shock
Fire

Risk description Product poses a risk of electric shock and fire because: - during the test of abnormal operation the product emitted dangerous amount of smoke and melted metal and became short-circuited. In addition, the sole part became detached and live parts accessible; -there is no thermal cut-out or temperature control built into the product. Product does not comply with the LVD and the relevant European standard EN 60335.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal of the product from the market ordered by the authority.
Other

Alert number 0250/06

Notifying country Portugal

Product category Recreational crafts

Type Consumer

Product

Brand Unknown

Product description Semi-rigid boats (RIBs) "Valiant" The affected fuel tanks were used in boats made in 2004 and 2005. Description: Unknown.

Risk type Fire

Risk description It was found that the fuel tanks of some semi-rigid boats of the Valiant brand leaked a small amount of fuel. This fault can be repaired by replacing the defective part when the boats are checked/inspected.

Country of origin Portugal

Measures taken by economic operators Other : Voluntary corrective action taken by the producer.
Other

Alert number 0249/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Type / number of model FA-5335 (SG-6602)

Product description Electrical sandwich toaster "TZS FIRST AUSTRIA Caty"

Risk type Electric shock

Risk description Wires connecting the moving parts of the appliance are led through open wound springs and the protective tube is unfixed in the spring. This may damage the wire insulation thereby posing a risk of electric shock. Product does not comply with the LVD and the relevant European standard EN 60335.

Country of origin Unknown

Measures ordered by public authorities Other : Withdrawal of the product from the market ordered by the authority.
Other

Alert number 0248/06



Notifying country United Kingdom

Product category Childcare articles and children's equipment

Type Consumer

Product

Name 1) Boots Designer Soothers,2) Boots Clear Soothers.

Brand "Boots"

Type / number of model 1) item code 41-09-643, 2) item code 23-68-102

Product description Soothers "Boots"

Risk type Choking

Risk description These products pose a risk of choking because the soothers might come apart due to the manufacturing failure. A very small number of soothers have been found to come apart posing a choking hazard. Quality Response Report from Jackel China factory states visual checks were carried out on 1750 soothers, which involved test to pull them apart by hand, 2 failed because they had not been welded. A further 500 were tested mechanically with forces in excess of 200N and none failed. Two customer complaints that soothers had fallen apart have been reported.

Country of origin People's Republic of China

Measures taken by
economic operators

Other : Voluntary recall from consumers by the producer.
Other

Alert number 0247/06



Notifying country Hungary

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Type / number of model NS-3990

Product description Electrical waffle maker "NUSHI"Product has black bakelite cover on the bottom part and metal cover on the upper part. Marks of approval. Technical parameters: 230V, 50Hz, 850W, Class I.

Risk type Electric shock

Risk description Product poses a risk of electric shock because: -wires connecting the moving parts of the appliance are led through open wound springs which may damage the wire insulation; - plastic cover deformed due to heat and fixing elements failed to function during testing as a result of which the cover can be removed by hand and the live parts become accessible. Product does not comply with the LVD and the relevant European standard EN 60335.


Country of origin Unknown

Measures ordered by public Other : Withdrawal of the product from the market ordered by

authorities the authority.
Other



Alert number 0246/06

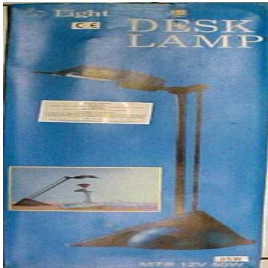

Notifying country Hungary

Product category Lighting equipment

Type Consumer

Product

Brand Unknown

Type / number of model SX064

Product description Portable electrical luminaire with halogen lamp.

Risk type Electric shock

Risk description The iron core of the transformer is accessible by the test finger. The basic insulated internal wires are not fixed and are in contact with the iron core and pressed against sharp and burring edges. The protective tubes over the soldered joints are not fixed. Moreover, the rated wattage of the light source is not indicated on the luminaire. The voltage indicated on the Hungarian label (220V) is misleading since the rated voltage used in Hungary is 230V. This product does not comply with the LVD Directive and the relevant European Standards.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0245/06



Notifying country	Germany
Product category	Communication and media equipment
Type	Consumer
Product	
Brand	Unknown
Type / number of model	UHD 3500
Barcode	4040895184153
Product description	Computer hard disk drive "Ultron" (mains unit of an external HDD drive)
Risk type	Electric shock
Risk description	Product poses a risk of electric shock because: -there is a heightened risk of flashover of the 240V supply to the low-voltage side which would expose the user to a lethal voltage; - the insulation separating the primary and secondary coils of the transformer is inadequate; -the ground conductor connection is too small and not secured against coming loose. Product does not comply with the LVD and the relevant European standard EN 60950.
Country of origin	People's Republic of China

Measures taken by
economic operators

Other : Voluntary recall of the product from the market by the
producer.
Other

Alert number

0244/06



Notifying country Spain

Product category Toys

Type Consumer

Product Toys with arrows with suction cups

Name 1) "SUPER GAME BOWMAN"2) "SOFT BULLET ARROW", 3) "MAXI ARCHERIE", 4) Unknown.5) 'BOW AND ARROW'

Brand Unknown

Type / number of model Type/number of model: 1) n° 2800, ref. 660912 (origin: Unknown), 2) n° YF238-B (origin: China), 3) n° 21008 (origin: China), 4) n° 3633 (origin: China) 5) n° 2829 (origin: Unknown),

Product description Five toys with arrows with suction cups. ref. 181786.

Risk type Choking
Injuries

Risk description The elastic material used for the impact area of the projectile (the suction cup) can be detached with a traction force of less than 60 Newtons and the kinetic energy reached by the projectile exceeds the permitted maximum. There is a risk of external injuries if the projectile's protective suction cup is removed and the projectile hits someone in the eyes or another part of the body. The detached suction cup could lead to a risk of choking. This danger is heightened by the fact that children usually lick the suction cap to moisten it, so that it sticks better to the surface it hits on impact. This product does not comply with the Toys Directive and the European Standard.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market ordered by authority.
Other

Alert number 0243/06



Notifying country Slovenia

Product category Childcare articles and children's equipment

Type Consumer

Product

Brand Unknown

Product description Playpen "Happy Hort"Type/model: 009920801 03045.

Risk type Choking
Cuts
Injuries

Risk description Product poses a risk of choking, injury and cuts because: - four angular rein forcing elements can be taken apart and their plasticized nuts are smaller then cylinder with the inner diameter of 25.4 mm, (parts that can be taken apart should not go into the cylinder); - four screws are protruding from the structure and - there are four places in which a test chain can be caught (there should not be any parts that stick out),; - distance between protective boards is 68 mm (allowed 65 mm); - distance between the lowest point of a grab handle and the base is 365 mm (required at least 500mm); - there is no permanent marking of the maximum weight of a child. This product does not comply with the relevant European Standard EN 12227.

Country of origin Germany

Measures ordered by public
authorities

Other : Withdrawal of the product from the market ordered by
the authority.
Other

Alert number 0242/06

Notifying country Germany

Product category Motor vehicles

Type Consumer

Product

Brand Unknown

Product description Motor vehicle Mercedes-Benz.Type/model: Sales designation R350, R500 and R320 CDI; type 251, EU type approval e1*2001/116*0341.Description: The recall concerns vehicles built between 01.2006 and 03.2006, vehicle identification numbers A011193 to A022336.

Risk type Injuries

Risk description In the event of a full load on the seatbelt buckles in the second row of seats, the persons wearing the seatbelts are under certain circumstances not effectively secured. It was established on the individual seats that the tightening torque on the buckles was tested, but not the torsion angle of the anchoring. The buckle anchorings are being tested and if necessary the individual seats replaced.

Country of origin Germany

Measures taken by economic operators Other : Voluntary corrective actions taken by the producer.
Other

Alert number	<u>0241/06</u>
Notifying country	Germany
Product category	Motor vehicles
Type	Consumer
Product	Passenger car
Brand	Mercedes-Benz
EC-type approval/model	Sales designation R350; type 251 (R350), EU type approval e1*2001/116*0341
Product description	Description: The recall concerns vehicles built between 08.2005 and 02.2006, vehicle identification numbers A000659 to A014575.
Risk type	Injuries
Risk description	The fitting position of the starter lead assembly is not as specified. In the case of damage to the assembly, which is encased in a corrugated tube, an acute voltage loss may occur, leading to failure of the entire electrical system.
Country of origin	Germany
Measures taken by economic operators	Other : Voluntary corrective action taken by the producer. Other

Alert number 0240/06



Notifying country Spain

Product category Toys

Type Consumer

Product

Brand Unknown

Product description Toy gun "COMBAT GUN"with projectiles (Rifle with five projectiles with suction cups and target included).
Type/model: Lote Gun nº 2871, bar code: 843054006097.

Risk type Choking

Risk description Since the projectiles are smaller than indicated in the Standard (less than 57 mm long), they may pose a risk of choking to children, because, if one got in a child's mouth and obstructed the child's airway, it would be difficult to extract the projectile quickly due to its small size. Moreover this toy does not have warnings concerning projectiles required by the Standard. This toy does not comply with the Toys Directive and the relevant European Standard.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0239/06



Notifying country Slovenia

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Product description Electrical fan "WATTON"Type/model: FS-1602A, 3830037263249.

Risk type Electric shock
Injuries

Risk description Product poses risks of electric shock and injuries because: - it is possible to touch fan blades with test finger before and after the test with force of 20 N to the guard, - internal wiring is in contact with the metallic housing of motor, which has sharp edge, - measured clearance and creepage distance between conductor with basic insulation and accessible surface through gap between push button and housing is less than 1 mm (the limit is 4 mm), - there is no provision for earthing, - instruction does not contain the warning about the replacement of the supply cord by qualified person. This product does not comply with the relevant European Standard.

Country of origin People's Republic of China

Measures ordered by public Other : Withdrawal of the product from the market ordered by

authorities authority.
Other

