

Alert number 0478/06



Notifying country Lithuania

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Type / number of model DL412L

Barcode 2000004320416

Product description Electrical switch "DONGLIN" with two keys and light indicator.

Risk type Fire

Risk description The product poses a risk of fire because it does not pass the normal operation test and it is non-resistant to heat. This product does not comply with the Low Voltage Directive and the European Standard EN 60669.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Sales ban and withdrawal from the market ordered by the authority.
Other

Alert number 0477/06



Notifying country	Hungary
Product category	Electrical appliances and equipment
Type	Consumer
Product	Hand mixer "SAYONA"
Brand	Sayona
Type / number of model	MX-503
Product description	<p>The hand mixer has a thermoplastic cover. The appliance has a toggle switch by which it can be switched on and revolution can be adjusted in 5 stages, in addition there is a sixth speed: TURBO press button (lockable against unintentional press). Main parts of the appliance: plug, mains cable, switch, micro switch, motor. Accessories: a pair of beaters, a pair of kneading beater. Technical parameters: 220-240V; 50-60 Hz; Class II.</p>
Risk type	<p>Electric shock Fire</p>
Risk description	<p>This product poses a risk of electric shock because: - the internal wires can be pressed against sharp burring metal edges, and can get pinched into the cover parts or get into contact with rotating parts of the motor, - the insulation of the internal wires is not satisfactory, since breakdown occurred during the tests, - due to the construction of the appliance the beaters can be interchanged, thus the mixture can get into the appliance, where it may cause mechanical or electric</p>

defect. The mixer also can cause a risk of fire because during the abnormal use test the temperature of the coil reached 232,1oC. The manual in Hungarian is not attached to the product which is required for the safe use and maintenance. This product does not comply with the LVD Standard and the Low Voltage Directive.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Sales ban and recall from consumers ordered by the authority.
Other

Alert number 0475/06



Notifying country Spain

Product category Childcare articles and children's equipment

Type Consumer

Product

Brand Cam

Type / number of model C 204

Product description Changing unit “Cam il mondo del bambino s.p.a.”

Risk type Injuries

Risk description This product does not comply with the safety requirements of the European Standard EN 12221: - clause 5.1.2: the accessible area contains openings which permit insert of the cone having 25 mm and do not permit insert of the cone having 45 mm. - clause 5.1.3.1: the accessible area contains openings which permit insert of the cone having 65 mm.

Country of origin Italy

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number	<u>0474/06</u>
Notifying country	Austria
Product category	Childcare articles and children's equipment
Type	Consumer
Product	
Brand	Cam
Type / number of model	Jackie, Art. No C 603 002
Product description	Nappy changing unit Tubular metal nappy changing unit on plastic casters with changing table and removable bath "Cam il mondo del bambino s.p.a".
Risk type	Injuries
Risk description	According to the test results the nappy changing unit <u>used without the bath</u> does not satisfy the safety requirements of the European Standard 12221-1 with respect to stability and strength. Although the instructions for <u>use</u> state that the nappy changing unit is to be used only with the bath fitted <u>,</u> it is reasonably foreseeable that it will be used without the bath, e.g. when the bath has been removed for cleaning and the nappy changer unexpectedly has to be used at short notice. Nappy changers are subject to very stringent safety requirements since the group of users at risk comprises infants who may suffer disproportionate injury in the event of an accident. A further danger arising with older infants is that they can already move very vigorously. There is thus a high risk of the unit's collapsing. One accident - the nappy changer collapsed (when used without the bath) and the baby lying on it suffered severe injury (fracture of the skull).
Country of origin	Italy
Measures ordered by public authorities	Other : Sales ban ordered by the authority. Other

Alert number 0473/06



Notifying country Spain

Product category Childcare articles and children's equipment

Type Consumer

Product

Brand Unknown

Type / number of model 55A4405

Product description Tortoise-shaped bath thermometer “Saro” and “Practical and fun”

Risk type Choking

Risk description During the drop test, small pieces, which fit completely into the small parts cylinder described in the European toy standard EN 71-1, broke off. Children using this product could choke on the small pieces that are generated. By virtue of the design of the product, children under 36 months could use this product as a toy.

Country of origin Thailand

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0470/06



Notifying country Greece

Product category Decorative articles

Type Consumer

Product

Brand Unknown

Type / number of model Rose Jelly Candle

Product description Decorative jelly candle "KARMA CANDLE"

Risk type Burns
Fire

Risk description During the combustion of the candle the flowers/leaves inside the candle caught fire with a very powerful flame (reached a height of approximately 10cm), resulting in the total blackening of the glass and the release of excessive soot. Judging from the flame intensity it is likely that burns may be caused to individuals that have not realised that the candle is being destroyed. Fire also can be generated in closed spaces of the candle, due to the powerful flame, especially if the candle is placed near flammable objects.

Country of origin Israel

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority. Press release has been issued.

Other



Alert number 0469/06



Notifying country United Kingdom

Product category Lighting equipment

Type Consumer

Product

Brand Unknown

Product description Floor standing electrical lamp “Hangzhou Delta Art Light Co Ltd. - Fiorentina Lamp”

Risk type Electric shock

Risk description 1) The luminaire has inadequate protection against electric shock. - The luminaire contains two lampholders. The wiring for these lampholders is connected to the supply cord by crimped terminals which are partially covered with some heat shrinkable sleeving. However, the test finger can touch the basic insulation covering the conductors. The Standard requires that the test finger should not be able to touch parts that were not separated by at least two levels of insulation or their equivalent. - The basic insulation on the internal wires is touching the metal parts of the luminaire. Thus the test finger can also touch accessible conductive parts separated from live parts by only a single layer of insulation. The metal frame would become live should the insulation fail. 2) The terminals are not satisfactorily crimped onto the conductors. The metal insert within the crimp is simply flattened onto the conductors and not permanently crimped. The neutral terminal can be easily pulled from the conductors. Poor terminations can lead

to overheating. 3) This sample does not meet the marking requirements of the standard. This product does not comply with the LVD standards.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0468/06



Notifying country	United Kingdom
Product category	Lighting equipment
Type	Consumer
Product	
Brand	Unknown
Type / number of model	WT-XMNOPRS/ABCD
Product description	Electrical stained Glass Butterfly Table Lamp (240V 50Hz 25W)
Risk type	Electric shock
Risk description	The product has inadequate protection against electric shock, including the following non-compliances with the relevant laws and standards: - the luminaire is fitted with a brass lampholder and has no means for earthing the accessible metal parts. Where the sheath of the supply cord has been removed to facilitate the conductors' connection to their terminals, this has left the exposed basic insulation on the conductors in contact with the metal lampholder. The lampholder would become live in the event of a failure of the insulation. - the brass lampholder would become live in the event of an insulation fault within the lamp. - there are no precautions to prevent the lampholder from becoming live due to a detached wire. The plug and the fuse do not meet the safety requirements including: - the cover screw had not

been provided with a means for retention and it fell out when the plug was opened. A lost screw can be replaced with an inappropriate type leaving the cover inadequately fixed. - the terminal screws have not been rounded at the ends to minimise damage to the conductors when tightening. - the endcaps of the fuse were insecurely fixed and the length of the fuse was shorter than required. In addition, the user instructions are inadequate and the product does not meet the marking requirements, including the maximum rated wattage and the symbol for class II construction.

Country of origin

People's Republic of China

Measures ordered by public authorities

Other : Sales ban and withdrawal from the market ordered by the authority.
Other

Alert number 0467/06




Notifying country	Spain
Product category	Toys
Type	Consumer
Product	
Brand	Unknown
Type / number of model	CE ITEM No 97454
Barcode	8430721097454
Product description	Child's chair "PALLAVI" with plastic back and seat and metal frame
Risk type	Injuries
Risk description	Laboratory tests determined that the chair has dangerously sharp edges which are accessible. The metallic parts and rigid polymeric parts of the seat have accessible burrs that could cause cuts or scratches. Unfolding of the chair presents pinching and shearing points. Further pinching and shearing points are generated when body weight is applied. This product does not comply with the Toys Standard and the Standard on outdoor furniture. One incident reported: a three-year old boy needed several stitches in a finger, which he cut when it got caught in the folding mechanism of the chair.
Country of origin	People's Republic of China

Measures ordered by public
authorities

Other : Withdrawal from the market ordered by the authority.
Other

Alert number 0466/06

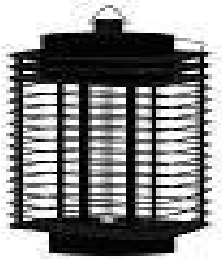

Notifying country The Netherlands

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Barcode 8711295 422300

Product description Electric Insect KillerDescription: Unknown

Risk type Electric shock

Risk description This product poses a risk of electric shock because: - live parts with a dangerous charge (68,0VACpeak) are accessible with the test finger, - charge of accessible live parts (52,9µC) exceeds limit indicated in the standard (45µC), - leakage current of 126 mApeak is too high (0,25mApeak is required by the standard) and is accessible. This product does not comply with the Low Voltage Directive and LVD Standard.

Country of origin People's Republic of China

Measures taken by economic operators Other : Placing of the product on the market voluntarily suspended. Voluntary recall from consumers.
Other

Alert number 0465/06



Notifying country United Kingdom

Product category Lighting equipment

Type Consumer

Product

Brand Unknown

Type / number of model Unknown

Product description Electrical “Tiffany” Turtle Lamp.

Risk type Electric shock

Risk description The product poses a risk of electric shock because: - it has inadequate protection against electric shock. The switch could be opened without the use of a tool and when opened there is direct access to live parts. - it has not been supplied with any user instructions, in particular details for lamp replacement. - it does not meet the marking requirements, including the maximum rated wattage and the symbol for class II construction. This product does not comply with the relevant European Standard EN 60598.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Sales ban and withdrawal from the market ordered by the authority.
Other

Alert number 0464/06



Notifying country	Spain
Product category	Motor vehicles
Type	Consumer
Product	Passenger car
Name	MERCEDES BENZ
Brand	Mercedes-Benz
EC-type approval/model	SLR MACLAREN
Product description	Unknown
Risk type	Fire
Risk description	In some model SLR MACLAREN vehicles, the design and construction of the alternator and its insufficient cooling, can cause it to reach temperatures outside the specified range. As a consequence the alternator may overheat and, in individual cases, produce smoke and flames.
Country of origin	Germany
Measures taken by economic operators	Other : Voluntary corrective actions taken by the distributor. Other

Alert number 0463/06



Notifying country	Spain
Product category	Kitchen/cooking accessories
Type	Consumer
Product	
Brand	Unknown
Product description	Espresso makers "OROLEY" Type/number of model: ERGO, 6- and 10-cup. Description: Espresso makers of various sizes with 6 or 10-cup capacity.
Risk type	Burns Injuries
Risk description	This product poses a risk of burns from the coffee and a risk of injury to anyone who is struck by the upper part of the coffee maker when it flies off. Some of the coffee makers (6- and 10-cup sizes) fail to close securely. When pressure builds up during the preparation of coffee, the upper part becomes detached from the base. This causes the coffee to spill and could potentially injure anyone near the coffee maker since in some cases the upper part can be projected upwards. There has been some reports of property damage but not of personal injury.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary recall from consumers by the distributor. Other

Alert number 0462/06



Notifying country	Spain
Product category	Motor vehicles
Type	Consumer
Product	Motorcycle
Brand	Kawasaki
EC-type approval/model	ER-6N
Product description	Motorcycle "KAWASAKI" (650 cc)
Risk type	Injuries
Risk description	On certain motorcycles, the cables running to the ignition connector located beneath the fuel tank can come into contact with the frame support. In continued use, the ignition cable can become damaged or can be cut through, resulting in a short circuit in the system that may cause the ignition to fail suddenly and cause the engine to cut out. This fault in the motorcycle's electrical installations may place the rider at risk and cause road traffic accidents.
Country of origin	Japan
Measures taken by economic operators	Other : Voluntary corrective actions taken by the importer. Other

Alert number 0461/06



Notifying country Austria

Product category Other

Type Consumer

Product

Brand Unknown

Barcode 4260050590418, 7108000512 LA

Product description Angular amber-coloured glass nuggets "Kristallgranulat DEKO" (cca 2 cm in diameter). Labelling: "DEKO - made in Germany, Kristallgranulat, Nicht zum Verzehr - not for consumption! Don't store with food! Nicht mit Lebensmitteln aufbewahren - Verwechslungsgefahr [risk of confusion]!"Glasnuggets 1DE307A, 500 ml, Amber.

Risk type Choking

Risk description Risk of confusion (especially for children) due to the fact that the amber nuggets look identically to commercially available candy sugar. The warnings on the label are in such small print as to be barely legible and in any event do not provide consumers and/or children with adequate warning.

Country of origin Germany

Measures taken by economic operators Other : Voluntary withdrawal from the market by the distributor.Although the product is available in a range of

colours THIS MEASURE CONCERNS ONLY THE "AMBER"
VERSION. Even though confusion cannot be entirely ruled out
in the case of versions in other colours, the risk is
substantially smaller.
Other

Alert number 0460/06



Notifying country	Spain
Product category	Clothing, textiles and fashion items
Type	Consumer
Product	Children's water shoes "H & M"
Brand	H&M
Type / number of model	364430 + 31 + 32 - 6569
Product description	Sizes 22-33.
Risk type	Injuries
Risk description	This product poses a risk of injuries due to the fact that the soles of these shoes may become slippery on wet surfaces.
Country of origin	People's Republic of China
Measures taken by economic operators	Other : Voluntary withdrawal from the market and information to consumers. Other

Alert number 0459/06



Notifying country	Portugal
Product category	Toys
Type	Consumer
Product	
Brand	Unknown
Type / number of model	Unknown
Product description	Watercolour paints without a brush - Pritt Kids Art Paint-Ball.
Risk type	Choking
Risk description	The quality of the paint can change, requiring extra pressure to the paint stick if the product has not been used for a certain period of time. This extra pressure may cause the product's 'roll-on ball' to come apart from the stick.
Country of origin	South Africa
Measures taken by economic operators	Other : Voluntary withdrawal from the market and recall from consumers. Other