
| | |
|--|--|
| Alert number | <u>0606/05</u> |
| Notifying country | Spain |
| Product category | Toys |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Product description | Various toys that include arrows with suction cups (8 different models and brands) |
| Risk type | Choking |
| Risk description | Risk of choking. The suction cup at the end of each projectile can easily be removed and may cause a risk of asphyxiation if a child puts it into its mouth; suction cup can be removed under traction of less than 60 N. Toys do not comply with the Toys Directive and European Standards. One fatal accident occurred in the past with similar toy (0460/05). |
| Country of origin | People's Republic of China |
| Measures ordered by public authorities | Other : Withdrawal the market ordered by the authorities. Other |

Alert number 0605/05



Notifying country Spain

Product category Toys

Type Consumer

Product Bow and arrows

Brand Unknown

Risk type Choking

Risk description Risk of choking. The projectiles, which have a suction cup, are less than 57 mm long and could therefore cause asphyxiation as they are not long enough to be removed if they blocked the respiratory tract. These toys do not comply with the Toys Directive and the relevant European Standards.

Country of origin Unknown

Measures ordered by public Other : Withdrawal from the market ordered by the

authorities authorities.
Other



Alert number

0604/05



Notifying country Spain

Product category Toys

Type Consumer

Product

Brand Unknown

Product description Various toys with arrows having suction cups (42 different models and brands).

Risk type Choking

Risk description The suction cup at the end of each projectile can easily be removed and may cause a risk of asphyxiation if a child puts it into mouth. These toys do not comply with the Toys Directive and the relevant European Standards. One fatal accident occurred in the past with similar toy (0460/05).

Country of origin Unknown

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authorities.
Other

Alert number 0603/05

Notifying country Czechia

Product category Gas appliances and components

Type Consumer

Product

Brand Unknown

Product description Gas boiler JUNKERS.Type/number of model: Cerastar-5KE/AE and Ceramini-5KE/AE,- 6KE/AE.Description: Wall-mounted gas boiler designed for chimney duct or for forced evacuated duct (turbo). The gas boiler is intended for heating and warming of water.

Risk type Injuries

Risk description Possible gas escape from leaky soldering joints of the pipes, posing a risk of explosion.

Country of origin Germany


Measures taken by economic operators Other : Voluntary corrective actions.
Other

Alert number 0602/05



| | |
|--------------------------------------|--|
| Notifying country | Denmark |
| Product category | Chemical products |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Product description | Guardian Textile Protection - Guardian Protection Products Type/number of model: Unknown. Description: 23 cm high beige brown spray with brown lid. The spray is 6, 4 cm in diameter. |
| Risk type | Health risk / other |
| Risk description | Risk of illness. 10 persons became sick in Denmark after using Guardian Textile Protection. The symptoms have been sputum, difficulty in breathing, and common symptoms as during influenza. Some have had changes in lungs by X-rays. |
| Country of origin | Denmark |
| Measures taken by economic operators | Other : Voluntary withdrawal from the market. Other |

Alert number 0601/05

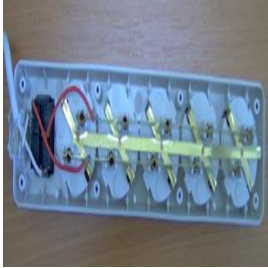

Notifying country Greece

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Product description Multiple socket with switch BORAX.Type/number of model: Unknown. Description: White five-way multi-socket with switch; packed in a plastic bag with stapled cardboard label, 16A/250V AC, 3500W, bears GS mark from SLG Chemnitz.

Risk type Electric shock
Fire

Risk description The cord extension set consists of only two conductors. The conductor cross-sections are too small. The earth contacts of the plug and the socket-outlet are not connected. The earth contacts are not fixed on the socket; they can be removed


without the help of a tool after it is dismantled. The assembly screws of the socket bar do not retain themselves on the body of the socket bar after its dismantling. The cable in the socket is not fixed. The Multiple Socket with switch does not comply with the Low Voltage Directive.

Country of origin Unknown

Measures ordered by public authorities Other : Withdrawal from the market ordered by the authorities.
Other

Alert number

0600/05

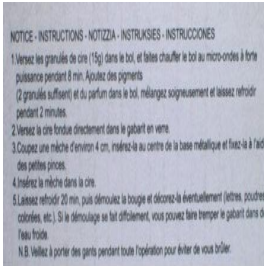

Notifying country France

Product category Decorative articles

Type Consumer

Product

Brand Unknown

Product description Candle making kit 'L'Art de Créer'. Type/number of model: Batch No 0705, Bar code 3 491 951 804 262. Description: Cardboard box (38 x 31.5 x 5 cm) closed by a transparent plastic lid. This box contains a selection of items needed to make candles: 1 bowl, 1 small bag of paraffin granules, 4 moulds, 1 small bag of wicks, 1 pair of gloves, scents, 4 tools, and glitter.

Risk type Fire

Risk description The problem posed by these kits resulted from a translation error of the length of time, which should be 2 minutes than 8 minutes. Following the instructions the bowl containing the paraffin granules should be heated in a microwave oven at high power for 8 minutes while the contents of the bowl catches fire after 5 minutes of heating.

Country of origin People's Republic of China

Measures taken by economic operators Other : Voluntary withdrawal from distribution.
Other

Alert number 0599/05



Notifying country Estonia

Product category Toys

Type Consumer

Product

Brand Unknown

Product description A pull-along toy "Yellow duck with three duckling on its back". Type/number of model: Unknown. Description: Yellow duck with orange wheels and three ducklings (green, red and violet) on its back. The toy has a cord. The size of this toy is 240x210x130 mm. The toy is packed in the transparent plastic bag with colourful label.

Risk type Injuries
Strangulation
Suffocation

Risk description Risk of injury, suffocation and strangulation. During the test the toy broke and small details detached from it. These small details fit completely within the small parts cylinder. Some edges and tips are sharp after smashing of the toy. The free length of cord is 1070 mm and there is a strangulation hazard. The warning "Not for children under 3 years" does not correspond to the nature of the product. Toys do not comply with the Toys Directive and European Standards.

Country of origin People's Republic of China

Measures ordered by public
authorities

Other : Placing on the market prohibited and recall from
consumers ordered by the authorities.
Other

Alert number 0598/05



Notifying country Estonia

Product category Toys

Type Consumer

Product

Brand Unknown

Product description A pull-along toy "Yellow duck CIAGADLO". Type/number of model: EAN 5901271020511. Description: Yellow duck with green wheels, green hat and transparent ball on its back. The toy has a cord. The size of the toy is 130x110x70 mm. The toy is packed in the transparent plastic bag with colourful label.

Risk type Injuries
Suffocation

Risk description Risk of injury and suffocation. During the test the toy broke and small details detached from it. These small details fit completely within the small parts cylinder. Some edges and tips are sharp after smashing of the toy. The warning "Not for children under 3 years" does not correspond to the nature of the product. Toys do not comply with the Toys Directive and European Standards.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Placing on the market prohibited and recall from consumers ordered by the authorities.
Other

Alert number 0597/05



| | |
|--------------------------------------|--|
| Notifying country | Sweden |
| Product category | Childcare articles and children's equipment |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Product description | Bicycle child seat Polisport. Type/number of model: Wallaroo CFSred model and black, bought before 01-08-2005 and produced in the beginning of 2005.Description: Unknown. |
| Risk type | Injuries |
| Risk description | The CFS bracket on the child seat can break at the first assembly to the bike. When this happened the child seat became loose from the bike, but the safety strap will prevent the child seat from touching the ground. Three accidents in the EU. |
| Country of origin | Portugal |
| Measures taken by economic operators | Other : Voluntary recall from dealers and consumers. Other |

Alert number 0596/05



Notifying country Estonia

Product category Toys

Type Consumer

Product

Brand Unknown

Product description Tumbler.Type/number of model: Unknown.Description: Yellow duckling like tumbler with red shirt and black shorts on the red wheels. Both wheels contain small details. The size of this toy is 120x140x70 mm. The toy is packed into the transparent plastic bag with colourful label.


Risk type Injuries
Suffocation

Risk description During the test the toy broke and small details detached from it. These small details fit completely within the small parts cylinder. Some edges and tips are sharp after smashing of the toy. The warning “Not for children under 3 years” does not correspond to the nature of the product. Toy does not comply with the Toys Directive and European Standards.

Country of origin People's Republic of China

Measures ordered by public authorities Other : Placing on the market prohibited and recall from consumers ordered by the authorities.
Other

Alert number 0595/05

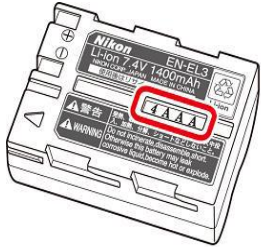

| | |
|--------------------------------------|--|
| Notifying country | Greece |
| Product category | Electrical appliances and equipment |
| Type | Consumer |
| Product | |
| Brand | Unknown |
| Product description | Ery nikontype/number of model: en-el3description: the ion-lithium rechargeable battery is provided as a supplementary accessory to the nikon digital cameras (slr d100, d70 and d50) and can be used with the nikon d70 range of products it is also sold separately the above-mentid batteries were manufactured between may-september 2004 |
| Risk type | Fire |
| Risk description | Risk of Fire. Possible inflammation for some of the batteries, due to overheating. There were reported 5 accidents, 2 of which in Europe. |
| Country of origin | Unknown |
| Measures taken by economic operators | Other : Voluntary recall from consumers and corrective actions. Other |

Alert number 0594/05



Notifying country Bulgaria

Product category Electrical appliances and equipment

Type Consumer

Product

Brand Unknown

Product description Connection-block UYE with four sockets. Type/number of model: YX-016. Description: Prolonging flex with flexible cable 1.7m 3x0.75mm², movable multiply dismantlable bipolar contact with four sockets with a defensive mechanism 10A 250V and undismountable bipolar plug with defensive mechanism 10/16A 250V.

Risk type Electric shock

Risk description When the power is on the conductors' and the supply cable' isolation soften inadmissibly, which leads to a risk of short circuit and occurrence of risk of electric current damage and thermal risks. It is possible to set a plug with nominal electric current 16A into the movable contact of the prolonging flex with nominal electric current 10A; the protective terminals do not comply with the requirements for thread terminals; the terminal junctions of the movable contact are filled by welding; there is no switch labelling.

Country of origin People's Republic of China

Measures taken by economic operators

Other : Voluntary withdrawal from the market and product destruction.
Other

Alert number 0593/05



Notifying country Bulgaria

Product category Childcare articles and children's equipment

Type Consumer

Product

Brand Unknown

Product description Bed with tubular construction. Description: Children’s cot, tubular construction, red colour, with a metal device for canopy, with 4 wheels without ratchet mechanisms.

Risk type Injuries

Risk description Risk of injury. Usage of this bed can result in cuttings or jamming. Edges of the pegs for attaching the bed and at the joining elements are sharp. All sides of the bed are not solid and the distance between the openings is not as required. The wheels haven’t got ratchet and on the frame rust was found.

Country of origin Türkiye

Measures taken by economic operators Other : Voluntary withdrawal from the market and product destruction.
Other

