

Alert number **0291/06**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Brand **Volvo**

EC-type approval/model **XC90**

Product description **The recall concerns vehicles produced in 2003-2006, with chassis numbers ending from 0000001 to 0273555.**


Risk type **Injuries**

Risk description **The outer ball joint stud on the steering gear may fracture. As a result, the driver may notice difficulty in handling manoeuvres which may cause an accident due to insufficient control of the car. The problem may appear after using the car under extreme driving conditions and intense strain of the direction system (off road driving or driving on a bumpy road). 80 accidents have been reported worldwide.**

Country of origin **Sweden**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the importer.  
Other**

Alert number **[0290/06](#)**

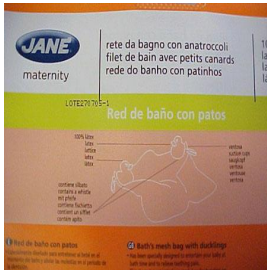

Notifying country **Hungary**

Product category **Toys**

Type **Consumer**

Product **&nbsp;**

Brand **Unknown**

Product description **hewable bath toy "JANE"Type/number of model: model: 40513; bar code: 8420421405130.**

Risk type **Choking**

Risk description **During the pull test, the suction-cup easily comes off the toy and fits in the small parts cylinder causing a serious choking hazard for children under 3 years. In addition, the product has a DINP content of 38g/100g which poses a serious health risk. Product does not comply with the Toys Directive and the relevant European standard.**

Country of origin **Spain**

Measures ordered by public authorities **Other : Sales ban and recall ordered by the authority. Other**

Alert number **0288/06**



Notifying country **The Netherlands**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **&nbsp;**

Brand **Unknown**

Type / number of model **Daatje set, nr. 4706100**

Product description **Baby set "DA - Daatje" - baby set, consisting of a bib, a bottle, 2 bottle brushes, a pacifier and a rattle.**

Risk type **Choking**

Risk description **The rattle presents a risk of choking because the small parts may become detached when the rattle is dropped. During the drop test it was found that the seam of the plastic ball containing the small rattling parts (pellets) was liable to burst. The small parts in question pass through the cylinder. One complaint reported by a consumer.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Other : Voluntary recall of the product from consumers.  
Sales ban ordered by the authority.  
Other**

Alert number **[0287/06](#)**



Notifying country	<b>Germany</b>
Product category	<b>Furniture</b>
Type	<b>Consumer</b>
Product	<b>&amp;nbsp;</b>
Brand	<b>Unknown</b>
Product description	<b>Glass chest of drawers/ highboard/sideboard "OTTO" Type/number of model: Glass chest of drawers Art.-Nos.: 655167 and 549168; highboard Art.-Nos 549209 and 655187; sideboard Art.-Nos 655109 and 655098. Description: Glass chest of drawers with a built-in luminaire at 53 cm; highboard with 2 built-in luminaires at 86 cm; sideboard with 2 built-in luminaires at 53 cm.</b>
Risk type	<b>Electric shock</b>
Risk description	<b>Danger of electric shock due to a faulty plug connection (plug-plug connection) for the electrical connection of the built-in luminaries.</b>
Country of origin	<b>Poland</b>
Measures taken by economic operators	<b>Other : Voluntary corrective actions taken by the supplier. Other</b>

Alert number **0286/06**



Notifying country **Germany**

Product category **Furniture**

Type **Consumer**

Product **&nbsp;**

Brand **Unknown**

Product description **Furniture "OTTO" - wall unit with 5 built-in luminaries.Type/number of model: Art.-Nos.: 549189 and 650464.**

Risk type **Electric shock**

Risk description **Danger of electric shock due to a faulty plug connection.**

Country of origin **Poland**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the supplier.  
Other**

Alert number **0285/06**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **&nbsp;**

Brand **Unknown**

Product description **Motorcycle “Kawasaki. - Ninja ZX-10R” Type/number of model: ZXT00D, e1\*2002/24\*0270\*00. Description: Motor vehicles from the model year 2006. Motor vehicle identification numbers:JKAZXT00DDA000071-018730, JKAZXCD1?6A000078-018735or ZXT00C-001209-018227.**

Risk type **Injuries**

Risk description **A screw which attaches the steering damper body to the frame bracket may come loose and the steering damper may work free of its fixing, thus the driver can lose control of the steering. That screw needs to be tightened to the correct specification. One accident has been reported.**

Country of origin **Japan**

Measures taken by economic operators **Other : Voluntary corrective actions taken by the producer.  
Other**

Alert number **0284/06**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Opel Vectra and Signum**

Brand **Opel**

EC-type approval/model **Signum (Z-C/S), Vectra (Z-C, Z-C/SW)**

Product description **EC-type approval e1\*98/14\*0187\*09 ff and e1\*2001/116\*0214\*05 and e1\*2001/116\*0238\*02ff and e1\*2001/116\*090\*00 ff and e1\*2001/116\*0291\*00 ff and e1\*2001/116\*0292\*00 ff. Cars from the model years 2004-2006 are affected.**

Risk type **Fire**

Risk description **Moisture ingress to the heatable spray nozzles can trigger a malfunction, which can result in the spray nozzles overheating. In unfavourable circumstances, overheating of the spray nozzles can lead to a fire in the engine compartment shortly after the engine has been stopped. Some fire damages have been reported without any injury to persons.**

Country of origin **Unknown**

Measures taken by economic operators **Other : Voluntary worldwide corrective actions taken by the producer.  
Other**

Alert number **0283/06**



Notifying country	<b>Spain</b>
Product category	<b>Electrical appliances and equipment</b>
Type	<b>Consumer</b>
Product	<b>&amp;nbsp;</b>
Brand	<b>Unknown</b>
Product description	<b>Kitchen Robot "Jocca" Type/number of model: Ref.: 5414.</b>
Risk type	<b>Injuries</b>
Risk description	<b>Risk of crash/jam/brake of fingers. This product poses serious risk to consumers because: - the dangerous moving parts are directly accessible - there is a switch that allows the appliance to operate when the lid is off . Moreover the appliance's specified voltage is not stated and it does not attain the specified voltage value of 230 volts and the following warning is not given "Do not use the appliance if the rotating sieve is damaged". This product does not comply with the LVD Directive and the relevant European Standards.</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Other : Withdrawal from the market ordered by the authority. Other</b>

Alert number **0282/06**



Notifying country	<b>Spain</b>
Product category	<b>Childcare articles and children's equipment</b>
Type	<b>Consumer</b>
Product	<b>&amp;nbsp;</b>
Brand	<b>Unknown</b>
Product description	<b>Dummy on a chain with a fastener in the form of a fish "D'Azucar Creaciones" Type/model: 05049, reference number 240764 also appears on the label on the product.</b>
Risk type	<b>Choking</b>
Risk description	<b>The product poses a risk of choking because: -during main traction between the chain and the clip for attaching it to clothes, one of the links in the middle of the chain broke in two at a force of less than 90 N constituting a small part; - the soft toy fish comes apart from the clip for attaching it to clothes with a force of less than 90 N, providing access to the adhesive device and this device, which can come off easily, constitutes a small part. The product does not comply with the relevant European Standards EN-12586 and EN-1400.</b>
Country of origin	<b>Spain</b>
Measures ordered by public authorities	<b>Other : Withdrawal of the product from the market ordered by the authority. Other</b>

Alert number

**0281/06**



Notifying country **Germany**

Product category **Chemical products**

Type **Consumer**

Product **&nbsp;**

Name **PAX RUBBER CEMENT(Rubber solution in a tube in a bicycle repair kit).**

Brand **“Work-it”**

Product description **Repair kit “Work-it” Name: PAX RUBBER CEMENT(Rubber solution in a tube in a bicycle repair kit).Type/number of model: 86020, EAN 8714892860209.**

Risk type **Chemical**

Risk description **This product presents risk to consumers because the rubber solution contains approximately 90% benzene which is classified as carcinogenic, mutagenic and toxic.**

Country of origin **Unknown**

Measures ordered by public authorities **Other : Withdrawal from the market ordered by the authority.  
Other**

Alert number **[0280/06](#)**



Notifying country	<b>Spain</b>
Product category	<b>Machinery</b>
Type	<b>Consumer</b>
Product	<b>&amp;nbsp;</b>
Brand	<b>Unknown</b>
Product description	<b>mini motorbikes “Dirt Bike” Type/number of model: Minimotard 116.</b>
Risk type	<b>Fire Injuries</b>
Risk description	<b>The use of the product is extremely dangerous posing a risk of injury for the rider or other persons in the vicinity of the product. The product is not in compliance with the Machinery Directive and the relevant standards: -there are sharp edges all over the bike; -the guards over the moving and hot parts are insufficient, posing a risk that the rider will come into contact with these parts; the material of the guard poses an additional risk of cutting the rider; -there is a danger that the rider will burn his/her foot if it comes into contact with the exhaust manifold at temperatures above 140°C; -there is a danger that the rider’s hands will get trapped since the handlebars have no steering stop; -the end of the petrol pipe passes over the engine without any protection posing a risk of overheating, which may cause a fire; the pipe is non-standardised for carrying petrol, which means there is a danger that petrol will leak onto the hot areas; -the design of the brake calliper prevents the engine from functioning properly by obstructing the gear; if the gear is forced the disc becomes red and deformed within a few meters and temperature of a touchable surfaces reaches 200 °C; -the levers have little mechanical</b>

**resistance and the cables get stuck when the handlebars are turned; there is no steering stop; -the materials have low mechanical resistance and the means of signalling are not long-lasting; - the noise level is excessive; -the warning information is incomplete and not given in Spanish, there is nor Spanish instruction manual, neither necessary markings.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Other : Sales ban and withdrawal from the market ordered by the authority.  
Other**

Alert number **0279/06**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **&nbsp;**

Brand **Unknown**

Product description **Motorcycle “BMW” Models R1200GS, R1200GS Adventure, R1200RT, R1200ST and HP2. Type/number of model: type R12 (EC type-approval e1\*2002/24\*0199), type R12T (EC type-approval e1\*2002/24\*0228), type R1ST (EC type-approval e1\*2002/24\*0230), type RHP2 (EC type-approval e1\*2002/24\*0254). Description: The recall applies only to motorcycles constructed between December 2005 and February 2006 with clutches made by Valeo.**

Risk type **Injuries**

Risk description **A faulty thread in the clutch casing could break the clutch while the vehicle is in operation and fragments of the broken clutch could pierce the engine housing and injure the driver.**

Country of origin **Germany**

Measures taken by economic operators **Other : Voluntary worldwide recall of the product by the producer.  
Other**

Alert number **[0278/06](#)**



Notifying country **Germany**

Product category **Cosmetics**

Type **Consumer**

Product **&nbsp;**

Brand **Unknown**

Product description **Lightening Body Lotion "NIUMA" Type/number of model:  
Manufacturing code 50649; EAN-Code: 8410874100287.**

Risk type **Chemical**

Risk description **This product contains hydroquinone: 5.7 % (+/- 0.1 %).**

Country of origin **Spain**

Measures taken by economic operators **Other : Voluntary withdrawal from the market.  
Information/warning displayed in the retailer shop.  
Other**

Alert number **[0277/06](#)**



Notifying country	<b>Spain</b>
Product category	<b>Machinery</b>
Type	<b>Consumer</b>
Product	<b>&amp;nbsp;</b>
Brand	<b>Unknown</b>
Product description	<b>Racing mini motorbikes RR TCC.Type/number of model: Granate 109.</b>
Risk type	<b>Fire Injuries</b>
Risk description	<b>The use of the product is extremely dangerous posing a risk of injury for the rider or other persons in the vicinity of the product. The product is not in compliance with the Machinery Directive and the relevant standards: -there are sharp edges all over the bike; -the chain guard is insufficient, posing a risk that the rider will come into contact with the chain; the material of the guard poses an additional risk of cutting the rider; -there is a danger that the rider's hands will get trapped and a risk of the steering stop getting stuck, causing the bike to overturn and fall; - the end of the petrol pipe passes over the engine without any protection posing a risk of overheating, which may cause a fire; the pipe is non-standardised for carrying petrol, which means there is a danger that petrol will leak onto the hot areas; -the design of the brake calliper prevents the engine from functioning properly, as a result of which a touchable surface could reach temperatures of 200 °C within a few metres; -the levers have little mechanical resistance and the cables get stuck when the handlebars are turned; the steering column is weakened; - the materials have low mechanical resistance and the</b>

**means of signalling are not long-lasting; - the noise level is excessive; -the warning information is incomplete and not given in Spanish, there is no Spanish instruction manual nor necessary markings.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Other : Sales ban and withdrawal from the market ordered by the authority.  
Other**

Alert number **0276/06**



Notifying country	<b>Spain</b>
Product category	<b>Childcare articles and children's equipment</b>
Type	<b>Consumer</b>
Product	<b>&amp;nbsp;</b>
Brand	<b>Unknown</b>
Barcode	<b>12100001892552</b>
Product description	<b>Child's car seat "Renolux- Rehausser Optimal Orcade child's car seat".</b>
Risk type	<b>Injuries</b>
Risk description	<b>Product poses a risk of serious, even fatal injuries, if the car in which the child is travelling is subjected to a strong impact, as the child is not fastened securely enough in the seat. The product does not comply with the relevant standard UN ECE 44.03: the seat does not provide the necessary protection in any situation; once the Group 1 child restraint system is in place, the child can easily loosen the part of the seat that restrains the pelvis; the visibility of the weight range information does not meet the requirements; there are no clear pictures showing how the seat should be used nor a diagram permanently attached to the seat showing the correct way of fastening the seat's straps.</b>
Country of origin	<b>France</b>
Measures ordered by public authorities	<b>Other : Withdrawal of the product from the market ordered by the authority.</b>

## Other