

Alert number **[A12/1626/14](#)**



Notifying country	<b>Belgium</b>
Product category	<b>Toys</b>
Type	<b>Consumer</b>
Product	<b>Birthday candles with toys</b>
Name	<b>Birthday Candles</b>
Brand	<b>Unknown</b>
Type / number of model	<b>188436</b>
Batch number	<b>8711295935848</b>
Product description	<b>8 candles and 4 toy sports cars (candle holders)</b>
Risk type	<b>Choking</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The small wheels of the plastic cars can easily detach. If children put them into the mouth, they may obstruct the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>05/09/2014</b>

Alert number **[A12/1618/14](#)**



Notifying country **Bulgaria**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's dress**

Name **Unknown**

Brand **Cichlid**

Type / number of model **Model Kodu: C4Y09E14250010 AD, Renk, EKRU; Model Adi: CHILID E 1425, DOKUMA KIZ ELIBISE;**

Batch number **1385609266545**

Product description **Children's dress, intended for small children up to 7 years of age, no sleeves, with a zipper at the back, with a printed pattern of ships and white lining made of cotton.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The dress has a belt in the waist area, intended to be tied at the back, which hangs below the hem of the garment when untied. The belt may become trapped during various activities of a child, causing injuries. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Türkiye**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number **[A12/1625/14](#)**



Notifying country	<b>Belgium</b>
Product category	<b>Toys</b>
Type	<b>Consumer</b>
Product	<b>Birthday candles with toys</b>
Name	<b>Birthday Candles</b>
Brand	<b>Unknown</b>
Type / number of model	<b>188436</b>
Batch number	<b>8711295935848</b>
Product description	<b>Set of 8 birthday candles with holders in the shape of a toy plastic train and 5 wagons.</b>
Risk type	<b>Choking</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The small wheels of the plastic train wagons can easily detach. If children put them into the mouth, they may obstruct the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>05/09/2014</b>

Alert number **[A12/1624/14](#)**

Notifying country **Spain**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Verso**

Brand **Toyota**

EC-type approval/model **Verso (1.6 Diesel), code WAR20**

Production dates **Production period 2 January 2014 to 20 March 2014**

Product description **Passenger car**

Risk type **Fire**

Legal provisions (at EU level)  
and European standards  
against which the product was  
tested and did not comply

**In the fuel filter, the resin moulding surrounding the O-ring of the water level sensor is unsuitable, causing insufficient compression of the ring. This means that when the engine is started at low outside temperatures, the fuel might leak into the sensor and then out through the ventilation hole. This could lead to a fire.**

Country of origin **Japan**

Measures taken by economic  
operators **Recall of the product from end users  
Other**

Date of entry into force **20/06/2014**

Products were found and  
measures were taken also in  
**Germany  
Denmark  
Finland  
Croatia  
Ireland  
The Netherlands  
Portugal  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number **[A12/1602/14](#)**



Notifying country	<b>Cyprus</b>
Product category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Product	<b>Girls' dress</b>
Name	<b>Unknown</b>
Brand	<b>Somas Accessories</b>
Type / number of model	<b>FP 103</b>
Batch number	<b>Unknown</b>
Product description	<b>Multi-coloured dress intended for girls up to 2 years of age. The dress can be tied and adjusted with shoulder straps.</b>
Risk type	<b>Strangulation</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The shoulder straps have free ends and may become trapped during various activities of a child. Since they are close to the neck, this may cause strangulation. The product does not comply with the relevant European standard EN 14682.</b>
Country of origin	<b>Indonesia</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Other</b>
Products were found and	<b>Greece</b>

measures were taken also in



Alert number **[A12/1603/14](#)**



Notifying country **Luxembourg**

Product category **Toys**

Type **Consumer**

Product **Water shooter**

Name **Water Shooter**

Brand **BLBE**

Type / number of model **Item n°:15.37.961B; Lot n°: 400182**

Batch number **8716201775457**

Product description **Plastic water shooter for young children with a soft plastic grip in shape of a football. No special packaging.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The soft plastic grip in shape of a football contains di-(2-ethylhexyl) phthalate (DEHP) above the permitted levels (measured values: up to 34% by weight). These phthalates may harm the health of children, causing possible damage of the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**


Date of entry into force **24/09/2014**

Measures ordered by public authorities **Recall of the product from end users**  
**Other**

Alert number **[A12/1604/14](#)**

Notifying country	<b>Germany</b>
Product category	<b>Motor vehicles</b>
Type	<b>Consumer</b>
Product	<b>Passenger car</b>
Name	<b>ATS / CTS</b>
Brand	<b>Cadillac</b>
EC-type approval/model	<b>Type: A1SL and GMT166 (1), A1LL(2) Model: ATS 2013-14, CTS 2014. EC-Type approval number: (1) ATS 2013 (A1SL) e13*2007/46*1338*00 - Variant codes AAAA (RWD) and AABA (AWD); (2) ATS 2014 (GMT166) .....</b>
Production dates	<b>2013 and 2014 vehicles</b>
Product description	<b>Passenger car</b>
Risk type	<b>Injuries</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The vehicles concerned may have been built with an incomplete weld on the seat hook bracket assembly for either front seat. If the weld is incomplete and the assembly is exposed to a high load condition in a crash the hook may separate from the seat track, increasing the risk of occupant injury.</b>
Country of origin	<b>United States</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Products were found and measures were taken also in	<b>Bulgaria The Netherlands</b>

Alert number **[A12/1605/14](#)**

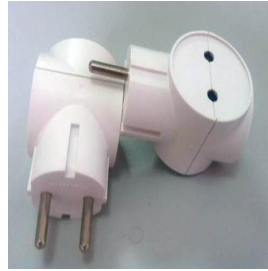

Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Plug adaptor**

Name **Unknown**

Brand **YAWCITAI**

Type / number of model **Unknown**

Batch number **Unknown**

Product description **3-way plug adaptor supplied in a transparent plastic bag.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The adaptor is designed with no recess. Consequently, it is possible to insert one plug pin into the socket of the adaptor leaving the other one accessible. This may pose a risk of electric shock to the users. The product does not comply with the relevant national standard.**

Country of origin **Hong Kong**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **22/09/2014**

Alert number **[A12/1606/14](#)**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Plug adaptor**

Name **Unknown**

Brand **ZEBERG**

Type / number of model **Unknown**

Batch number **Unknown**

Product description **White 3-way plug adaptor. Packaging: transparent plastic bags with the brand indicated at the top.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A connection can be established between one pin of a plug and the hole of a live socket while the other pin of the plug is accessible, thus causing a risk of electric shock for the user. The product does not comply with the relevant national standard.**

Country of origin **Hong Kong**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **22/09/2014**

Alert number **[A12/1607/14](#)**



Notifying country **Germany**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Ladies' shoes**

Name **Unknown**

Brand **5th Avenue**

Type / number of model **Item No 1145637**

Batch number **1145637**

Product description **Ladies' shoes, low heel, orange. Size of the sample: 38.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The leather of the lining contains Chromium (VI) above the permitted levels (measured value up to 10 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions.**

Country of origin **Vietnam**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Date of entry into force **01/09/2014**

Alert number **[A12/1601/14](#)**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product **Toy cement mixer**

Name **Car 225**

Brand **Unknown**

Type / number of model **Item No.: 98-1009**

Batch number **Unknown**


Product description **Blue plastic toy cement mixer with four red wheels and a yellow mixer made of hard plastic, with processing mechanism. A screw on one side enables the truck to move while rolling the eyes and the tongue moves.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Small parts (the mixer and the mounting part) can easily come off. If small children put them in the mouth, they can obstruct the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

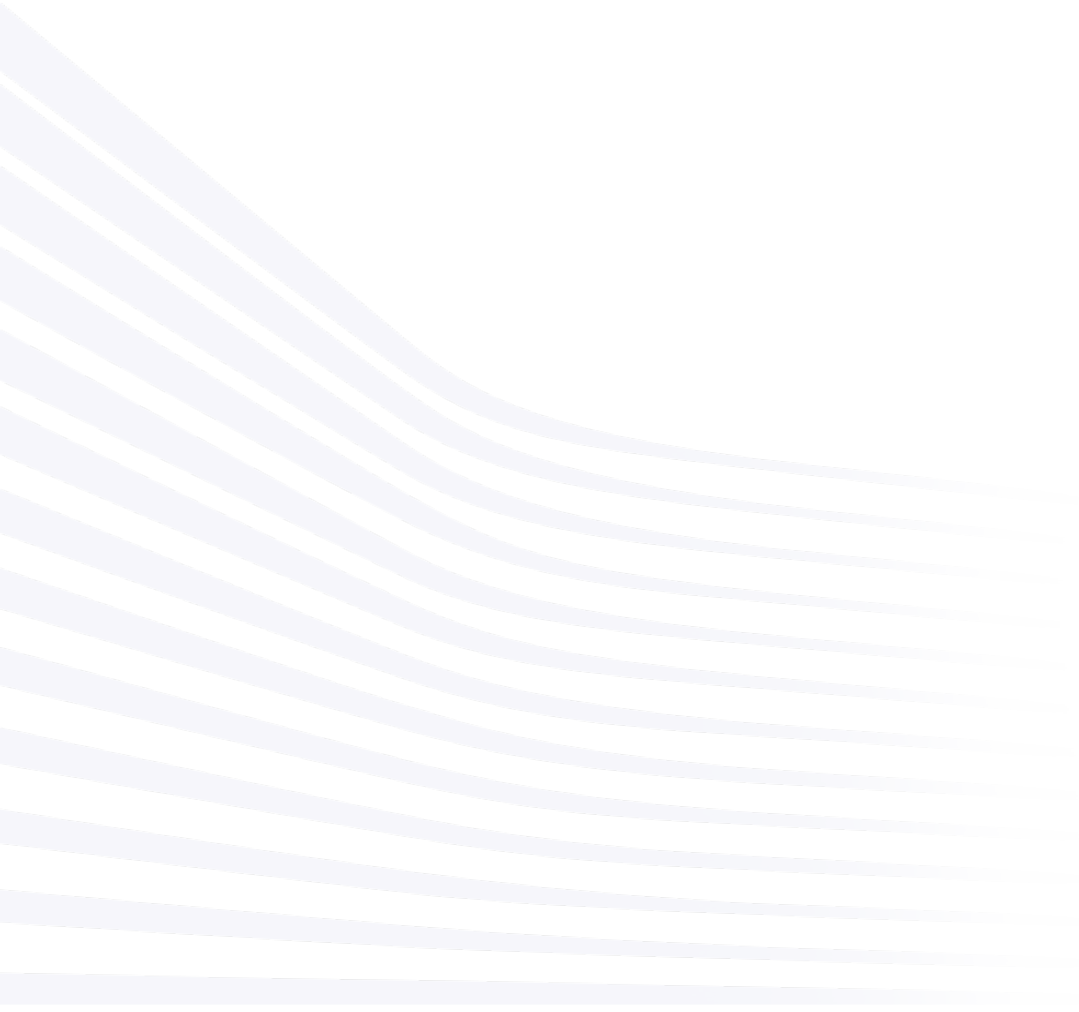

Alert number

**A12/1623/14**



Notifying country

**Spain**

Product category

**Toys**

Type

**Consumer**

Product

**Plastic horse with sweets**

Name

**Mini Horse**

Brand

**Sweet Toys**

Type / number of model

**Item n°: B 1202201, ref. 2170;**

Batch number

**8436033021705**

Product description

**Purple plastic horse with pink mane and tail, carrying a little bag with sweets. Packaged in a transparent plastic box, the front of which displays the product. The back of the box shows the label information, CE marking, graphic age warning symbol, etc.**

Risk type

**Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The toy contains di-(2-ethylhexyl) phthalate (DEHP) above the permitted levels (measured values: up to 25% by weight). These phthalates may harm the health of children, causing possible damage of the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin

**Hong Kong**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

Date of entry into force

**02/09/2014**

Alert number

**A12/1612/14**



Notifying country

**Spain**

Product category

**Toys**

Type

**Consumer**

Product

**Set of dolls with accessories**

Name

**Girls Briskness**

Brand

**Unknown**

Type / number of model

**Reference n°: 8558A-9 N°:8865A**

Batch number

**2208698177235**

Product description

**Set of two dolls (one big and one small) in different dresses. Description of packaging: A cardboard box with a transparent window. The back of the box has a label showing the importer's details, the CE marking, the barcode and the warning "not suitable for children under the age of three years".**

Risk type

**Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The head of the bigger doll, the head and the feet of the small doll contain di-(2-ethylhexyl) phthalate (DEHP) above the permitted levels (measured values: up to 25 % by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border**  
**Other**

Date of entry into force

**22/10/2014**

Alert number **[A12/1621/14](#)**



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' sandals**

Name **Unknown**

Brand **Coral**

Type / number of model **References: White, Peach, Pink**

Batch number **Unknown**


Product description **Girls' synthetic sandals in various colours: white, pink and peach. Little flowers decorated with strass stones are sewn onto the shoes. Description of packaging: cardboard boxes indicating the make, model and size. A sticker shows the reference "Made in China" and the importer's details.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The girls' sandals have strass or sparkling stone trimmings which come loose easily. There is a risk of choking if small children detach and swallow them. The products do not comply with the relevant national standard UNE 40902.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

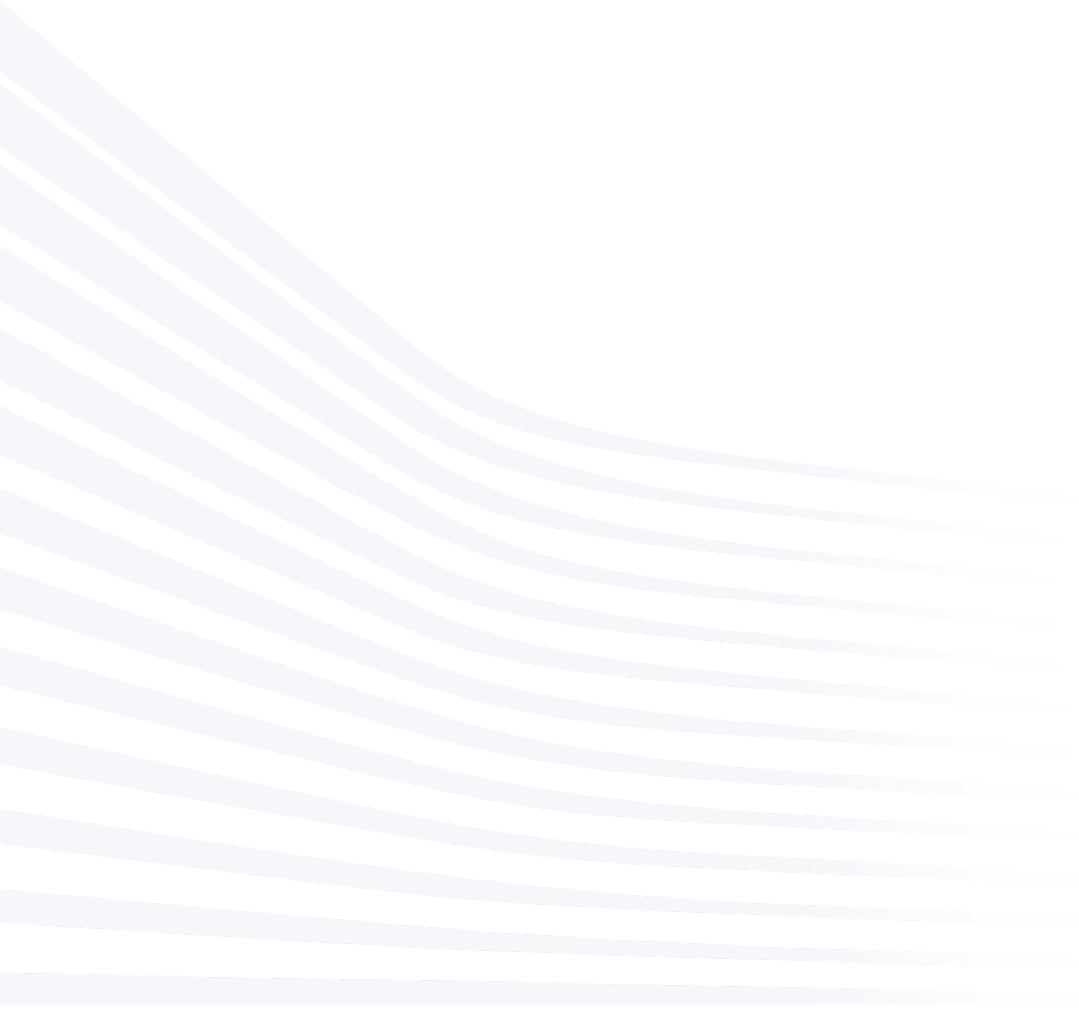

Alert number **[A12/1608/14](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Soft rubber ball**

Name **Unknown**

Brand **H&M**

Type / number of model **O/N 767680 P/N 0212555**

Batch number **Unknown**

Product description **Small, soft, foam rubber ball decorated with classic black and white football design. The balls are approximately 9 cm and are supplied in a plastic bag.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The ball may break in small parts if bitten. If children put these pieces in the mouth, they may obstruct the airways. Three incidents reported. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users  
Other**

Date of entry into force

**12/09/2014**

Products were found and  
measures were taken also in

**Austria  
Denmark  
Finland  
France  
Greece  
Ireland  
Norway  
Portugal  
Sweden  
Slovenia  
Slovakia**

Alert number **[A12/1609/14](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **i30, i30 cw**

Brand **Hyundai**

EC-type approval/model **type: FDe e11\*2001/116\*0343 and type: FD e11\*2001/116\*0313**

Production dates **Vehicles from the following production periods are affected: FD: 25.04.2007 - 31.03.2008; FDe: 01.09.2010 - 24.05.2012.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The vehicle becomes impossible to steer as a result of the loosening of a bolt on the steering column universal joint.**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Bulgaria  
Spain  
Finland  
Greece  
Croatia  
Hungary  
Ireland  
Portugal  
Sweden  
Slovenia  
Slovakia**

Alert number **[A12/1627/14](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **C-class**

Brand **Mercedes-Benz**

EC-type approval/model **Type: 205 Model: C180; C200; C250; C180 BlueTec; C200 BlueTec; C220 BlueTec; C250 BlueTec; C250 BlueTec 4 MATIC; C300 BlueTec HYBRID; C63 AMG (includes Limousine and T-model (estate)); EC type-ap.....**

Production dates **Vehicles produced between 8.10.2013 and 22.09.2014.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The steering coupling locking mechanism may not have been correctly fitted during vehicle manufacture. This could restrict the steering of the vehicle and in extreme cases may lead to loss of steering control.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Denmark  
Spain  
Finland  
Greece  
Croatia  
Hungary  
Ireland  
The Netherlands  
Norway  
Portugal  
Sweden  
Slovenia  
United Kingdom**

Alert number **[A12/1610/14](#)**



Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' dress**

Name **Unknown**

Brand **L.S. - Louis Fashion Accessories**

Type / number of model **GU 61**

Batch number **Unknown**

Product description **White dress intended for baby girls up to six months. Dress can be tied and adjusted with shoulder straps.**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The shoulder straps have free ends and may become trapped during various activities of a child. Since they are close to the neck, this may cause strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **India**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Products were found and **Greece**

measures were taken also in



Alert number **[A12/1611/14](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's trousers**

Name **Unknown**

Brand **Grace**

Type / number of model **1. model: B41046 2. model: B40461**

Batch number **1. 5999011410463; 2. 5999011404615**

Product description **The front of the children's trousers is made of denim while the back is made of knitted fabric. The waistband of the trousers includes an unattached drawstring with free ends. 1.model: decorated with a logo and an inscription: "CALIFORNIA FAVORITES". 2. model: decorated with an inscription: "Hig"**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The unattached drawstrings in the waist area can become trapped and cause injuries. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

authorities

**Other**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**27/08/2014**

Alert number **[A12/1622/14](#)**



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' sandals**

Name **Unknown**

Brand **Kun Fu / Jous**

Type / number of model **References n°: ND-L06, ND-X01, ND-L05, ND-X12, ND-X09, ND-X20 and ND-X07. Lot n°:03/LT32/14**

Batch number **8433383660073 (Ref n°: ND-X07).**


Product description **Girls' sandals with synthetic straps, in various colours: pink, black, white and peach. Small flowers with strass stones are sewn onto them. Description of packaging:cardboard boxes showing the reference, model, colour and size.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The girls' sandals have trimmings which may easily detach and be swallowed by small children. The products do not comply with the relevant national standard UNE 40902.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

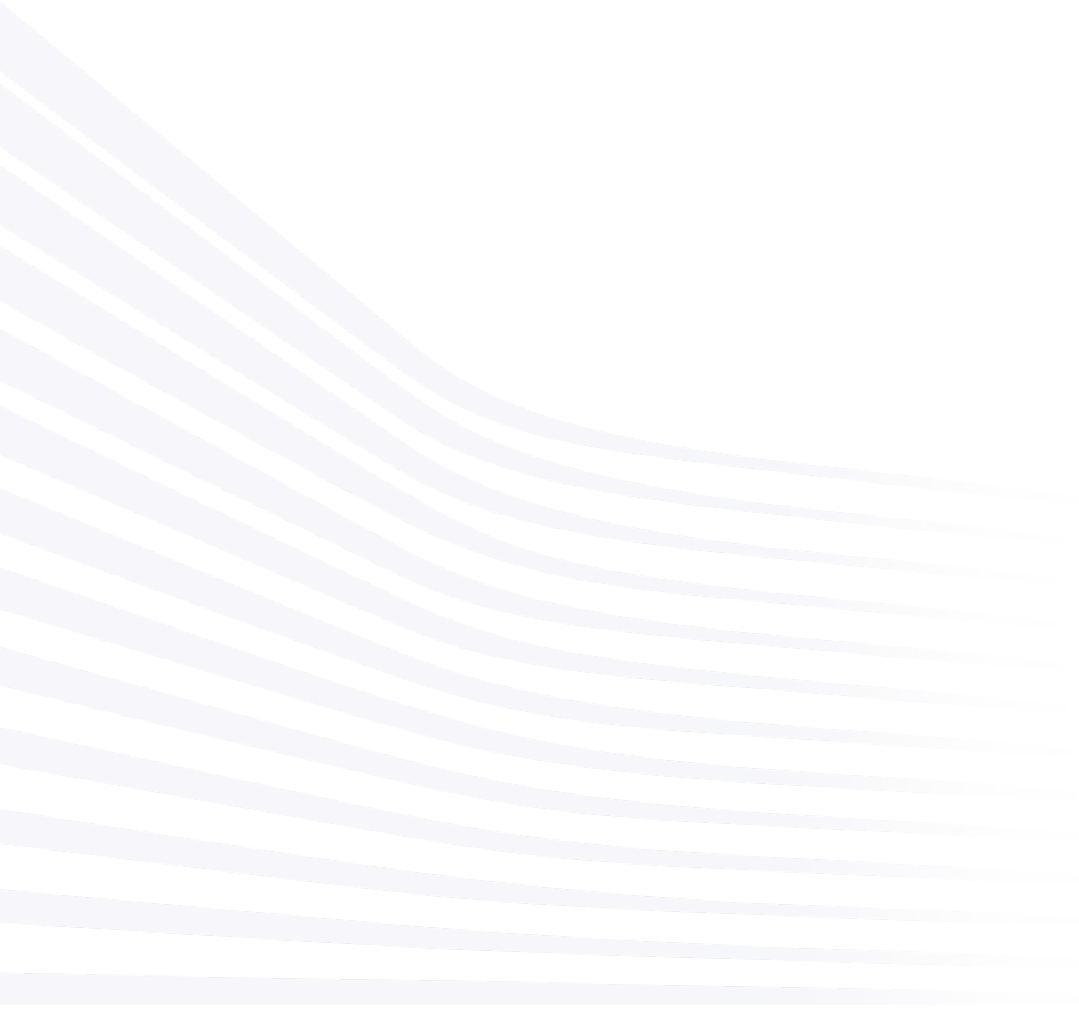

Alert number **[A12/1628/14](#)**



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Babies' shoes**

Name **Unknown**

Brand **Deb & Dan**

Type / number of model **Models: A1035S, A1037S, A1038S, A1040S, A1042S and Y578S.**

Batch number **Unknown**

Product description **Synthetic boots for babies in various sizes and colours, all with decorative trimmings.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small trimmings on the shoes can easily detach. If small children put them in the mouth, they may obstruct the airways. The product does not comply with the national standard UNE 40902.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **22/09/2014**

Alert number

**A12/1620/14**

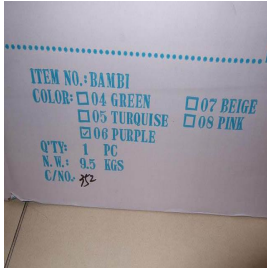

Notifying country

**Slovakia**

Product category

**Childcare articles and children's equipment**

Type

**Consumer**

Product

**High-chair**

Name

**Bambi**

Brand

**Baby Design**

Type / number of model

**Item n°.: BAMB1 COLOR: 06 PURPLE**

Batch number

**5901750290510**

Product description

**Babies' high-chair with tray, packed in a cardboard box. Packaging contains information about the brand, model, colour and dimensions of the product.**

Risk type

**Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply


**There are holes and gaps between side protections and the tray in which babies' fingers could be trapped, causing injuries. In addition, stuffing material may become accessible and a child could put it into the mouth which could lead to a risk of choking. The product does not comply with the relevant European standard EN 14988.**

Country of origin

**Taiwan**

Measures ordered by public authorities


**Ban on the marketing of the product and any accompanying measures  
Other**

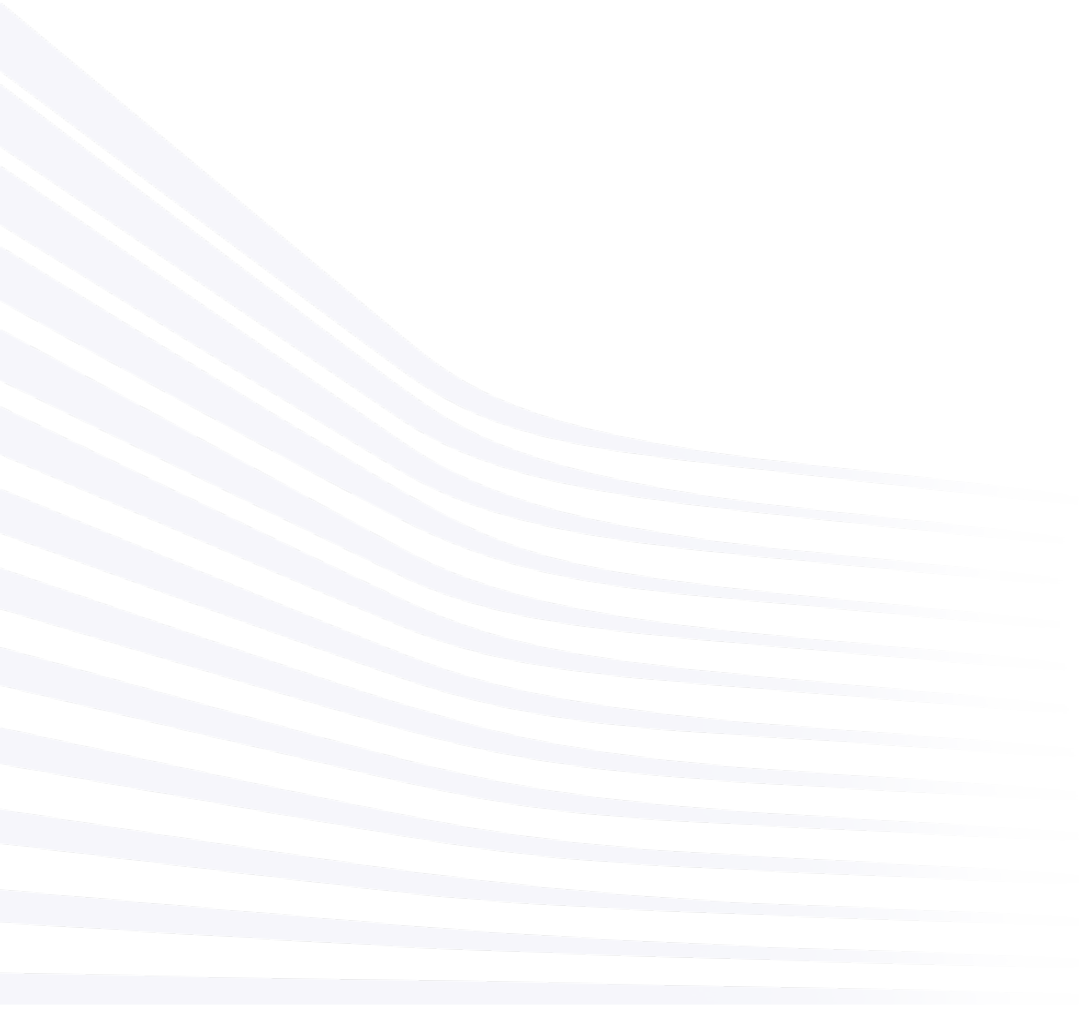

Alert number **[A12/1613/14](#)**

Notifying country	<b>Romania</b>
Product category	<b>Motor vehicles</b>
Type	<b>Consumer</b>
Product	<b>Passenger car</b>
Name	<b>Outlander &amp; Grandis</b>
Brand	<b>Mitsubishi</b>
EC-type approval/model	<b>CW0W &amp; NA0W</b>
Production dates	<b>Models from years 2007 - 2009 for the Outlander; and models from 2008 - 2010 for the Grandis.</b>
Product description	<b>Passenger cars.</b>
Risk type	<b>Injuries</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>Due to a defect in the brake light switch, the brake lights might not light up when the brakes are applied. This could lead to an accident.</b>
Country of origin	<b>Japan</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>17/09/2014</b>
Products were found and measures were taken also in	<b>Bulgaria Denmark Spain Finland Greece Lithuania The Netherlands Norway Poland Portugal Sweden Slovenia Slovakia</b>

Alert number **[A12/1614/14](#)**

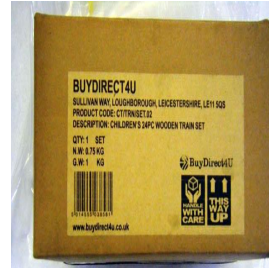

Notifying country **United Kingdom**

Product category **Toys**

Type **Consumer**

Product **Toy train set**

Name **Children's 24 Piece Wooden Train Set**

Brand **Buy Direct 4U**

Type / number of model **CT/TRN/SET.02**

Batch number **Bar code: 5014555038581**

Product description **24 piece wooden train set in a plain cardboard box containing track, carriages, locomotive and accessories. Described on web site as suitable for age 2 and above.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The train chimney detaches easily and could be swallowed by small children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users  
Other**

Date of entry into force **29/09/2014**

Alert number **[A12/1615/14](#)**



Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's outfit**

Name **Unknown**

Brand **Schoolmates Schoolwear**

Type / number of model **823L**

Batch number **5 290625 016998**

Product description **Outfit intended for children up to 10 years old. The set consists of a pair of grey leisure trousers and a grey sweatshirt with a hood with drawstrings.**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The drawstrings in the hood have free ends. They can become trapped during various activities of the child, causing strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Pakistan**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number **[A12/1616/14](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girl's winter coat**

Name **Unknown**

Brand **Guan Da Yuan**

Type / number of model **1. model: N9-65; 2. model: N9-63; 3. model: N9-92**

Batch number **Unknown**

Product description **Lined and hooded coats with zip in three different models for girls. The hood is decorated with artificial fur and can be removed with a zip. The hood includes non-fixed drawstrings with knots and plastic toggles on the ends. Size: 116- 122**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains a drawstring with knots on the ends in the hood that may become trapped causing the child to be strangled. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**08/08/2014**

Alert number **[A12/1619/14](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Fiesta**

Brand **Ford**

EC-type approval/model **Fiesta, Diesel**

Production dates **Certain vehicles built between 01/01/2010 and 31/12/2011.**

Product description **Passenger car with diesel engine.**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The Glow Plug Control Module for the engine is not waterproof and water ingress into the module may cause overheating creating a potential risk of fire. This can happen both when the vehicle is attended or unattended.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Germany  
Denmark  
Spain  
Finland  
Greece  
Croatia  
Hungary  
Ireland  
The Netherlands  
Norway  
Portugal  
Sweden  
Slovenia  
Slovakia**

Alert number **[A12/1629/14](#)**



2014 GT FURY TEAM  
All sizes



2014 GT FURY EXPERT  
All sizes

Notifying country	<b>Spain</b>
Product category	<b>Hobby/sports equipment</b>
Type	<b>Consumer</b>
Product	<b>Bicycle</b>
Name	<b>Fury Team and Fury Expert</b>
Brand	<b>GT</b>
Type / number of model	<b>2014</b>
Batch number	<b>Unknown</b>
Product description	<b>Mountain bicycle.</b>
Risk type	<b>Injuries</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The original factory-fitted wheel hubs may break and the disc brake rotor could separate from the hub. If this happens, control of the bicycle could be lost.</b>
Country of origin	<b>Taiwan</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>06/06/2014</b>
	<b>Denmark</b>

Products were found and  
measures were taken also in

**Greece**  
**Sweden**  
**Slovenia**



Alert number

**A12/1630/14**



Notifying country **Germany**

Product category **Toys**

Type **Consumer**

Product **Toy car**

Name **Transporter "Racing" Set of 2**

Brand **Small foot Company**

Type / number of model **Art. 7663**

Batch number **4020972076632**

Product description **A wooden transporter with two small wooden cars**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Small parts can easily detach and be swallowed by small children obstructing the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Products were found and measures were taken also in **Denmark  
Spain  
United Kingdom**

Alert number **[A11/0080/14](#)**



Notifying country	<b>Finland</b>
Product category	<b>Machinery</b>
Type	<b>Consumer</b>
Product	<b>Trolley jack</b>
Name	<b>Hydraulic Floor Jack</b>
Brand	<b>Motonet</b>
Type / number of model	<b>2 t, 140-330 mm, item 80-7522</b>
Batch number	<b>EAN 6438025100322, Serial number 820033RD003263A</b>
Product description	<b>Trolley jack with red frame and four black plastic wheels.</b>
Risk type	<b>Injuries</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The jack, when it is loaded with the rated load, lowers too fast and in an uncontrolled manner which could lead to the user being injured. The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 1494.</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Other</b>

Alert number **[A12/1631/14](#)**

Notifying country **Spain**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **FL Touring, Trike and CVO Softail**

Brand **Harley Davidson**

EC-type approval/model **Types FLHTCU, FLHTK, FLHX, FLHTKSE, FLHRSE and FLHR CVO (model 2014)**

Production dates **Manufactured between 25/03/2013 and 20/08/2014**

Product description **Large-cylinder motorcycle**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The piston seal of the hydraulic clutch system may break causing the clutch to lose the capacity to generate sufficient elevation to uncouple the clutch. This could result in the motorcycle moving after having been stopped, thereby causing loss of control of the vehicle.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Other**

Date of entry into force **10/09/2014**

Products were found and measures were taken also in **Germany  
Finland  
Greece  
Croatia  
Hungary  
Ireland  
The Netherlands  
Sweden  
United Kingdom**

Alert number **[A12/1632/14](#)**



Notifying country **Spain**

Product category **Other**

Type **Consumer**

Product **Wall mount for flat-screen televisions**

Name **Unknown**

Brand **SANUS - Simplicity**

Type / number of model **SLF5**

Batch number **793795526076**

Product description **Wall mount for flat-screen televisions, which can be adapted to most common devices (from 37" to 80"). It permits tilting.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The nylon bolt that secures the television may come loose. Consequently, the TV may detach from the arm, fall and cause injuries. Two incidents reported.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users  
Other**

Date of entry into force **06/09/2014**

Alert number **[A12/1633/14](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car / van**

Name **Corsa, Adam**

Brand **Opel**

EC-type approval/model **Corsa Van: Vehicle Type: S-D/V EC-Type approval number: e50\*2007/46\*0055\*03, e50\*2007/46\*0055\*04.  
Corsa Van: Vehicle Type: S-D/Van EC-Type approval number: e1\*2007/46\*0505\*07, e1\*2007/46\*0505\*08.  
Corsa, Adam: Vehicle Type: S-D EC-Type approval number: e1\*2001/116\*0379\*25, e1\*2001/116\*0379\*26, e1\*2001/116\*0379\*27, e1\*2001/116\*0379\*28, e1\*2001/116\*0379\*29.**

Production dates **Vehicles produced from 6 February 2014 to 23 September 2014.**

Product description **Passenger car / van**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The intermediate shaft of the steering system may break while driving, resulting in the loss of steering control.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Denmark  
Spain  
Finland  
Greece  
Croatia  
Hungary  
Ireland  
Lithuania  
Malta  
The Netherlands**

**Norway  
Poland  
Portugal  
Sweden  
Slovenia  
Slovakia  
United Kingdom**



Alert number

**A12/1617/14**



Notifying country

**Lithuania**

Product category

**Electrical appliances and equipment**

Type

**Consumer**

Product

**Rechargeable torch**

Name

**LED Super Capacity Torch.**

Brand

**YT - Yatian**

Type / number of model

**YT-2558**

Batch number

**6940825552558**

Product description

**Hand-held, rechargeable torch. The torch is charged via built-in mains pins. Plastic packaging with cardboard.**

Risk type

**Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The torch can be disassembled by hand without tools giving access to live parts at mains voltage whilst the torch is being charged. The insulating materials of the torch are not sufficiently resistant to heat. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities


**Ban on the marketing of the product and any accompanying measures  
Other**



Alert number **[A12/1634/14](#)**



Notifying country	<b>Slovakia</b>
Product category	<b>Toys</b>
Type	<b>Consumer</b>
Product	<b>Plastic gun with accessories</b>
Name	<b>New Toys Super Combined</b>
Brand	<b>Nowa</b>
Type / number of model	<b>NO. 6633 Product number NGZ6011406</b>
Batch number	<b>6991260114061</b>
Product description	<b>A plastic gun, tube, three projectiles with suction cups for the tube, three projectiles for the gun and two rings with suction cups. Packed in a transparent plastic blister with paper back.</b>
Risk type	<b>Choking</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The suction cups can be easily removed from the projectiles and from the rings, could be put in the mouth and block the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Other</b>

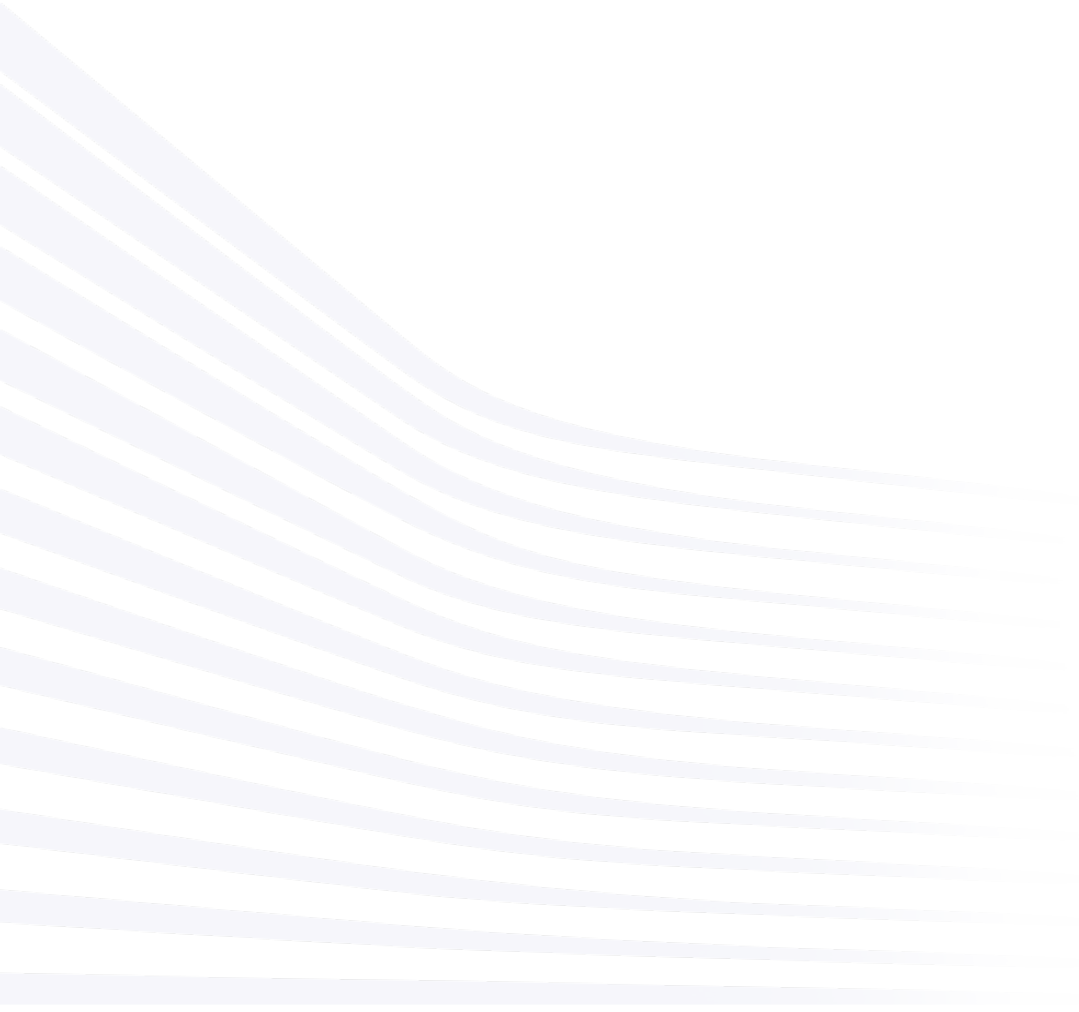

Alert number **[A12/1635/14](#)**



Notifying country **Hungary**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Children's bicycle seat**

Name **Unknown**

Brand **HTP**

Type / number of model **CS 203**

Batch number **5999550395214**

Product description **A blue plastic child's seat with a red seat pad intended to be mounted on the rear luggage carrier of a bicycle. The safety belts are black. The product has height-adjustable footrests. Capacity: 22 kg. Packaging: transparent plastic bag.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The fixing solution of the child seat is inappropriate so the seat may slip down from the bicycle frame and the child may fall off. The height of the sides and backrest of the seat is too low and the adjustment range of the footrest is less than required by the standard. The fixing straps of the footrest can easily break. The product does not comply with the relevant European standard EN 14344.**

Country of origin **Italy**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**17/07/2014**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

Alert number

**[A12/1636/14](#)**



Notifying country

**Hungary**

Product category

**Lighting equipment**

Type

**Consumer**

Product

**Table lamp**

Name

**LED Super Capacity Desk Lamp**

Brand

**Keyang**

Type / number of model

**KY-6618**

Batch number

**6 952201 066184**

Product description

**Rechargeable, portable table lamp with 21 LEDs. The base of the lamp is in the shape of a monkey which includes a yellow operating button and a red charge indicator lamp. The lamp can be charged by plugging the pins of the built-in plug into the mains. Packaging: transparent blister pack.**

Risk type

**Electric shock  
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The lamp is appealing to children who may play with the lamp when it is plugged into a mains socket. The pins of the built-in plug are not properly designed and the user can touch the live pins of the lamp when plugging the lamp into a mains socket. The insulation between the live parts and the accessible parts of the product is not sufficient. The cross-sectional area of the core of the wires is too small and in case of a short circuit the wires may overheat and cause a fire. The product does not comply with the requirements of the Low Voltage Directive, the relevant**

**European standard EN 60598 and the relevant national standard.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Other**

Measures ordered by public authorities

**Recall of the product from end users  
Other**

Date of entry into force

**04/03/2014**

Alert number **[A12/1637/14](#)**



Notifying country **Bulgaria**

Product category **Cosmetics**

Type **Consumer**

Product **Lipstick**

Name **Unknown**

Brand **Baolishi**

Type / number of model **No. 72**

Batch number **6933836120526**

Product description **Lipstick in a black tube with transparent cap. Best before date: 04.2017.**

Risk type **Chemical**


Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains excessive amounts of lead and cadmium (measured values above 10 mg/kg). Lead and cadmium are harmful to human health and hazardous to the environment. No safe level has been established for lead, all additional exposure must be avoided. Cadmium is harmful if swallowed, if inhaled and if in contact with the skin. The product does not comply with the Cosmetic Products Regulation.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures**

**Other**

Date of entry into force **19/09/2014**

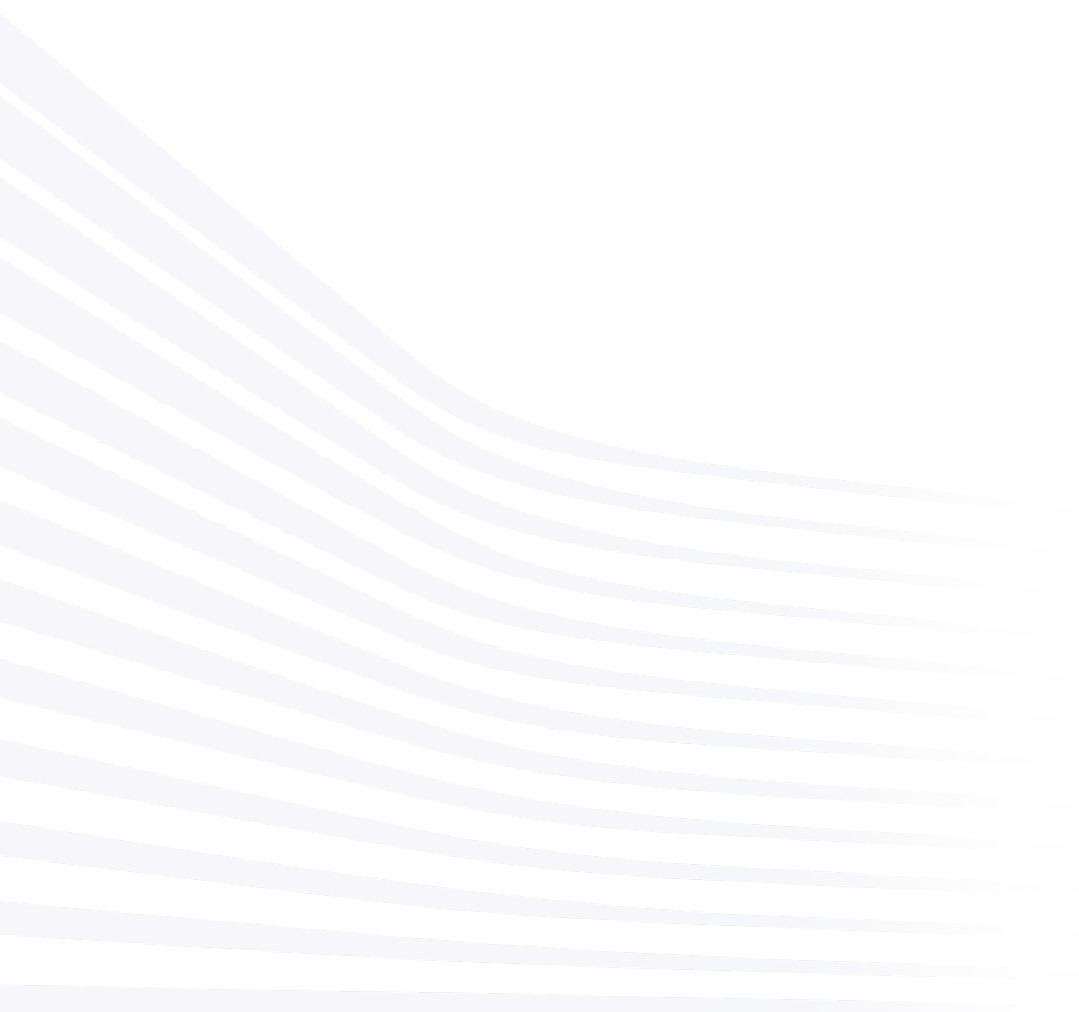

Alert number **[A12/1638/14](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' bikini**

Name **Unknown**

Brand **Hai Jing**

Type / number of model **021**

Batch number **Unknown**

Product description **Girls' bikini in light blue colour decorated with different patterns and glued sequins. The bottom part of the bikini is decorated with ruffles. The top can be tied with functional cords in the neck area. Sizes: 4-8, 8-12.**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Due to the presence of functional cords that are tied in the neck area, the child may be strangled. The product does not comply with the relevant European standard EN-14682.**

Country of origin **Unknown**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **05/08/2014**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number **[A12/1639/14](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's jacket**

Name **Unknown**

Brand **Qifeng**

Type / number of model **G3149C**

Batch number **Unknown**

Product description **Wind breaker jacket with hood, available in grey-pink, blue-pink and green-blue colour combinations. The hood can be removed from the jacket. The hood includes an elastic drawstring with plastic toggles. Sizes of the samples: 98,104,110,116,122,128**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The drawstring in the hood could become trapped and lead to strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**13/08/2014**

Alert number **[A12/1640/14](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' bikini**

Name **Unknown**

Brand **Power Flower**

Type / number of model **F450**

Batch number **Unknown**

Product description **Girls' bikini in blue colour with white polka dots. The top part of the bikini is decorated with flowers. The top can be tied with functional cords on the back. The bottom of the bikini can be tied with cords that have knotted ends in the waist area. Size: 6/8, 8/10, 10/12, 12/14**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The presence of free-end cords that are tied at the back of bikini and functional cords with knots at the waist area may lead to injuries. The bikini does not comply with the relevant European standard EN-14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**15/07/2014**

Alert number **[A12/1641/14](#)**



Notifying country **France**

Product category **Construction products**

Type **Consumer**

Product **Smoke detector**

Name **Détecteur de Fumée**

Brand **Arev technic**

Type / number of model **500500 - HS - 104**

Batch number **Lot 227310003: EAN 3182771051713; Lot 227590002: EAN 3182771051713**

Product description **Smoke detector**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The smoke detector is not sufficiently sensitive. As a result, it fails to detect commonly occurring types of fire. The product does not comply with the relevant European standard EN 14604.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Measures taken by economic operators **Recall of the product from end users  
Other**

Alert number **[A12/1642/14](#)**



Notifying country **Bulgaria**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's dress**

Name **Unknown**

Brand **Asilgüç**

Type / number of model **K:2361-2**

Batch number **1601050236129**

Product description **Children's dress intended for girls up to 7 years of age, in pink and white colour. Designed and supplied with attached shoulder straps to be tied on the left shoulder. Attached textile labels.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The presence of shoulder straps which are too long can lead to injuries. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Türkiye**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

