

Alert number **[A12/0314/15](#)**



Notifying country **Latvia**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Hairdryer**

Name **Fashion Hair Dryer**

Brand **LECAI**

Type / number of model **LC-2237**

Batch number **4008880010764**

Product description **Hairdryer packed in a cardboard box.**

Risk type **Burns  
Electric shock  
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The hairdryer can overheat during use and catch fire and cause burns. The heat can also deform insulating parts leading to the risk of electric shock. The appliance does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN60335.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **14/01/2015**

Alert number

**[A12/0291/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Pet toy**

Name **Dog Supplies**

Brand **HAPPY DOG**

Type / number of model **81509**

Batch number **8011682115090**

Product description **Cylindrical-shaped dog toy containing a whistle. The top part is in the form of an animal's head.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product appeals to children and so should also be safe for them. The whistle in the dog toy is a small part that may be easily detached causing choking if a small child puts it in the mouth and swallows it. The product does not comply with the requirements of the Toy Safety Directive or the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **01/12/2014**



Alert number

**[A11/0015/15](#)**



Notifying country

**Latvia**

Product category

**Electrical appliances and equipment**

Type

**Consumer**

Product

**Hair straightener**

Name

**Intellectual Ionic Hair Permer**

Brand

**Guang Ming**

Type / number of model

**RCT-528**

Batch number

**1717621155024**

Product description

**Hair straightener packed in a cardboard box.**

Risk type

**Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**Information about the maintenance, repair and replacement of the supply cord is not provided. The consumer could try to replace the supply cord and as result receive an electrical shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Other**

Date of entry into force

**14/01/2015**

Alert number

**[A12/0270/15](#)**



Notifying country

**Belgium**

Product category

**Toys**

Type

**Consumer**

Product

**Magnetic toy**

Name

**Magnetic Constructors**

Brand

**Nanodots**

Type / number of model

**Nanodots Electroplated; MEGA Nanodots; Nanodots Coated;**

Batch number

**Unknown**

Product description

**Toy with magnetic balls packed in plastic cylinders.**

Risk type

**Injuries**

Legal provisions (at EU level)  
and European standards  
against which the product was  
tested and did not comply

**The magnets have high magnetic flux and if two or more magnets are swallowed, they could attract one another and cause intestinal perforation or blockage. The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.**

Country of origin

**Unknown**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any accompanying measures  
Other**

Date of entry into force

**23/01/2015**

Products were found and  
measures were taken also in

**Denmark**  
**United Kingdom**



Alert number **[A12/0295/15](#)**



Notifying country **Ireland**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Air hockey table**

Name **Unknown**

Brand **Smyths Toys**

Type / number of model **Item No. SUA 3618SM**

Batch number **Unknown**

Product description **Table for playing air hockey.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There is not sufficient space between the pins of the plug and a person can touch part of the product that is at high voltage and receive an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Country of origin **Taiwan**

Measures taken by economic operators **Recall of the product from end users  
Other**


Date of entry into force **30/12/2014**

Products were found and  
measures were taken also in

**United Kingdom**



Alert number **[A12/0299/15](#)**

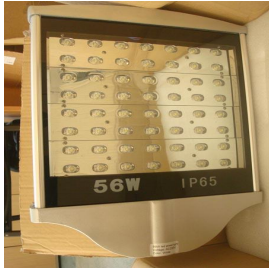

Notifying country **Latvia**

Product category **Lighting equipment**

Type **Consumer**

Product **LED light**

Name **LED Street Light**

Brand **Unknown**

Type / number of model **ASL-F056**

Batch number **Unknown**

Product description **LED light in brown cardboard box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cable entries are not properly protected. If the cable insulation was damaged as a result, accessible parts could become live. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**



Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **05/09/2014**

Alert number

**A12/0300/15**

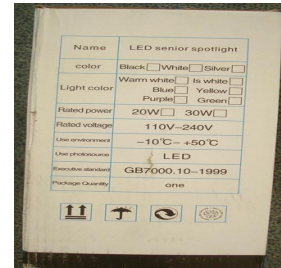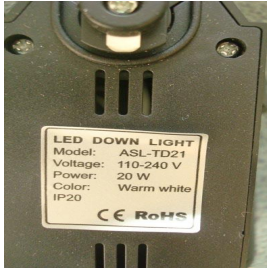

Notifying country **Latvia**

Product category **Lighting equipment**

Type **Consumer**

Product **LED spotlight**

Name **LED Down Light / LED Senior Spotlight Series**

Brand **Unknown**

Type / number of model **ASL-TD21**

Batch number **Unknown**

Product description **Black LED spotlight in cardboard box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The insulation of the wires where they pass through metal parts is not adequate. The supply cable is not properly anchored. Internal wiring is not properly fixed. Insulating material retaining current carrying parts is not sufficiently resistant to heat. As a result of these defects live parts could become accessible. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**



Alert number **[A12/0271/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **918 Spyder**

Brand **Porsche**

EC-type approval/model **Type: 918 / Variants: ZZ22 EC type approval: e13\*KS07/46\*0014\*03**

Production dates **The vehicles concerned are 2015 models.**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The durability of certain chassis components on the front axle may not be sufficient. The components concerned could break, leading to loss of control of the vehicle.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Spain  
The Netherlands  
Portugal  
Sweden  
United Kingdom**

Alert number **[A12/0272/15](#)**



Notifying country **United Kingdom**

Product category **Toys**

Type **Consumer**

Product **Wooden toy**

Name **Fire Engine Toy**

Brand **Habitat**

Type / number of model **Article code 125991. Argos Cat: 141/6844**

Batch number **All batches**

Product description **Wooden fire engine with wooden firemen. Supplied in cardboard box with CE mark, warnings. Age range 10 months +**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains small parts (radiator of the toy fire engine and the helmets on the wooden firemen) that can be easily detached. A young child could put them in the mouth and choke on them The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users  
Other**



Alert number **[A12/0273/15](#)**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Travel plug adapter**

Name **Travel Universal Adapter**

Brand **FH FOHILL**

Type / number of model **FH-931**

Batch number **8518151609314**

Product description **White travel plug adapter with surge protection. Plastic blister pack.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Various pins which are accessible to the user could be live when other pins are inserted in the socket. The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **18/11/2014**

Alert number **[A12/0296/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Magnetic fishing toy**

Name **Fishing Game**

Brand **Ousdy**

Type / number of model **Item No 156A**

Batch number **5661810027080**

Product description **Plastic fishing game, with one pink, one red and one orange fish, a green and red fishing rod and a little red basket. The game is packaged in plastic attached to cardboard.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small blue fish attached to the fishing rod contains a small magnet with a high magnetic flux and can become easily detached. If a child swallows this small blue fish and other metallic objects, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

authorities

**Other**

Date of entry into force

**18/11/2014**

Alert number

**[A12/0316/15](#)**



Notifying country **Germany**

Product category **Other**

Type **Consumer**

Product **Decorative item**

Name **Frosted berries**

Brand **Nana**

Type / number of model **unknown**

Batch number **EAN Code 2000754001283**

Product description **Imitation red berries, frosted, and brown mini pine cones in a transparent sachet.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**Due to its characteristic form, colour and size, the products may be mistaken for foodstuffs. This may lead children to put them in the mouth and obstruct the airways, posing a risk of choking. The product does not comply with the requirements of Directive 87/357/EEC on products which, appearing to be other than they are, endanger the health or safety of consumers.**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Ban on the marketing of the product and any accompanying measures  
Other**

Date of entry into force **04/02/2015**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Alert number **[A12/0274/15](#)**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Travel plug adapter**

Name **Adaptador Ingles**

Brand **Primera**

Type / number of model **ref. BAP033**

Batch number **7899055277603**

Product description **White travel plug adapter. It comes in a transparent blister pack on an orange and black card.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **It is possible to establish a connection between the pin of a plug and the hole of a live socket while the other pin is accessible. The product does not comply with the requirements of the relevant national standard.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **30/10/2014**

Alert number **[A12/0297/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Magnetic fishing toy**

Name **Funny Fishing**

Brand **Unknown**

Type / number of model **ref. JRS14110, batch JORS1401**

Batch number **2567726141106**

Product description **The product consists of a fishing rod with a small magnet at the end and four coloured fish. The packaging is a fish-shaped piece of cardboard covered in plastic.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy contains a small magnet with a high magnetic flux that can become easily detached. If a child swallows the magnet and other metallic objects, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number **[A12/0269/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Professional**

Product **Heavy goods vehicle**

Name **R 500, P400, G400 and others**

Brand **Scania**

EC-type approval/model **Type: A 4x2, B 4x2, B 4x4, A 6x2, B 6x2, A 6x2/4, B 6x2/4, A 6x2\*4, B 6x2\*4, A 6x4, B 6x6, B 8x2, B 8x2/4, B 8x2\*6, B 8x4, B 8x4\*4, B 10x4\*6**

Production dates **Vehicles manufactured in 2014 are affected.**

Product description **Heavy goods vehicle**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A distribution box fitted in the vehicle was not secured correctly. This might lead to a short-circuit in the vehicle's electrical system and damage associated electrical components. The risk of fire following the short-circuit and even after the engine has been switched off cannot be ruled out.**

Country of origin **Sweden**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Bulgaria  
Denmark  
Finland  
Croatia  
Hungary  
Norway  
Slovenia  
United Kingdom**

Alert number **[A12/0275/15](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **XF**

Brand **Jaguar**

EC-type approval/model **XF - SAJKC05M7DPS61362 - SAJWA0ES4DPS64029**

Production dates **Manufacture dates: 11/9/12 - 8/10/12.**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A fault with the fuel pump driver module can cause the fuel pump to stop thereby starving the vehicle of fuel. As a result the vehicle will cut out without warning.**

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users  
Other**

Date of entry into force **12/02/2015**

Products were found and measures were taken also in **Germany  
The Netherlands**

Alert number **[A12/0315/15](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Cruze and Orlando**

Brand **Chevrolet**

EC-type approval/model **Unknown**

Production dates **Production years: 2008-2012 Cruze / 2010-2012 Orlando.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The front brake hose might be misassembled/twisted. This could increase the stress on the brake hose, eventually leading to a leak of brake fluid. If this happens, the vehicle may experience an increased braking distance and potential degradation of braking performance.**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Germany  
Denmark  
Spain  
Greece  
Croatia  
Hungary  
Malta  
The Netherlands  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number **[A12/0276/15](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Yaris**

Brand **Toyota**

EC-type approval/model **Model codes: KSP130, NHP130, NLP130, NSP130.**

Production dates **Production year: 2014 - 2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**There is a possibility that one or more of the rear axle bearing bolts could have been tightened insufficiently during the manufacturing process. In this condition, the bolt(s) could become loose during vehicle operation and could eventually detach. The detached bolt(s) could damage rear brake components during rotation, resulting in a reduction of brake performance or a potential wheel lock up, which could increase the risk of a crash.**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Germany  
Denmark  
Spain  
Finland  
Greece  
Croatia  
Hungary  
Ireland  
Iceland  
Lithuania  
The Netherlands  
Sweden  
Slovenia  
Slovakia**

**United Kingdom**



Alert number **[A12/0277/15](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **Van / pick-up truck**

Name **Transit and Ranger**

Brand **Ford**

EC-type approval/model **Ranger: 6FPPXXMJ2PER31211 - AFAPXXMJ2PFC45249  
Transit: NMOPXXTTGPEB80049-WF0XXXTTGXEG58317**

Production dates **Ranger: 24/10/14 - 13/1/15  
Transit: 12/9/14 - 26/1/15**

Product description **Van / pick-up.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The fuel injector may have a detached internal valve which would lead to failure and reduction in fuel pressure leading to engine shut down.**

Country of origin **Türkiye**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Bulgaria  
Germany  
Denmark  
Spain  
Greece  
Croatia  
Hungary  
Ireland  
Lithuania  
The Netherlands  
Norway  
Sweden  
Slovenia**

Alert number **[A12/0293/15](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Eco-Sport**

Brand **Ford**

EC-type approval/model **WF0BXXMRKBDC66853 - WF0BXXMRKB EY33381**

Production dates **Built 22/2/13 - 22/2/14**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Vehicle fuel and fuel vapour lines do not have adequate corrosion-resistant, protective coating which may result in a fuel leak and cause skid hazards for other road users.**

Country of origin **India**

Measures taken by economic operators **Recall of the product from end users  
Other**

Date of entry into force **05/02/2015**

Products were found and measures were taken also in **Germany**

Alert number

**[A12/0278/15](#)**



Notifying country **Slovakia**

Product category **Decorative articles**

Type **Consumer**

Product **Oil lamp**

Name **Futurelife**

Brand **Unknown**

Type / number of model **ITEM NO.: 03-1010**

Batch number **8581390514916**

Product description **Decorative oil lamp made of transparent glass and metal. Packed in a blue and white cardboard box with marking and photo of the product.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The design of the product allows easy access to the lamp oil which can cause lung damage if swallowed. The product does not comply with the relevant standard EN 14059.**

Country of origin **Unknown**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**


Measures taken by economic operators

**Withdrawal of the product from the market**  
**Other**



Alert number

**[A11/0013/15](#)**

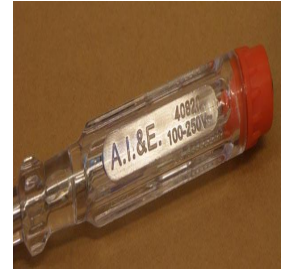

Notifying country **Hungary**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Voltage tester**

Name **Spannungsprüfer / Voltage Meter**

Brand **A.I.&E.**

Type / number of model **1. Model: 40820 (on the product); 713115-40705 (on the packaging)  
2. Model: 40821 (on the product); 710788-39699 (on the packaging)**

Batch number **1. 4 009017 288360  
2. 4 009017 240443**

Product description **Voltage tester. Packaging: blister.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The protection rim on the handle is too small. As a result, the user could accidentally touch the live metal tip during normal use. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61243.**

Country of origin **The Netherlands**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **06/11/2014**

Products were found and  
measures were taken also in **The Netherlands**

Alert number **[A12/0279/15](#)**



Notifying country **France**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Ma jolie poupée "Justine" (my pretty doll, "Justine")**

Brand **Unknown**

Type / number of model **Ref.: 612701**

Batch number **Batch: 41774**

Product description **Doll made of hard plastic, with slight odour of chocolate and dressed in a little sailor's outfit.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic red shoe of the doll contains di-isononyl phthalate (DINP) (measured values up to 13.9% by weight). According to the REACH Regulation the phthalates DINP, DNOP and DIDP are prohibited in toys or childcare articles that can be placed in the mouth by children.**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users  
Other**

Measures taken by economic operators **Withdrawal of the product from the market**

operators **Other**



Alert number **[A12/0298/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Magnetic Fishing Toy**

Name **Fishing Series**

Brand **La Gran Familia**

Type / number of model **Model: F92349, Ref. 555**

Batch number **8433760923494**


Product description **Magnetic game consisting of four parts (two sea animals and a rod). It is packaged in a plastic and cardboard blister pack.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy contains a small magnet with a high magnetic flux that can become easily detached. If a child swallows the magnet and other metallic objects, they could attract one another causing intestinal blockage or perforation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

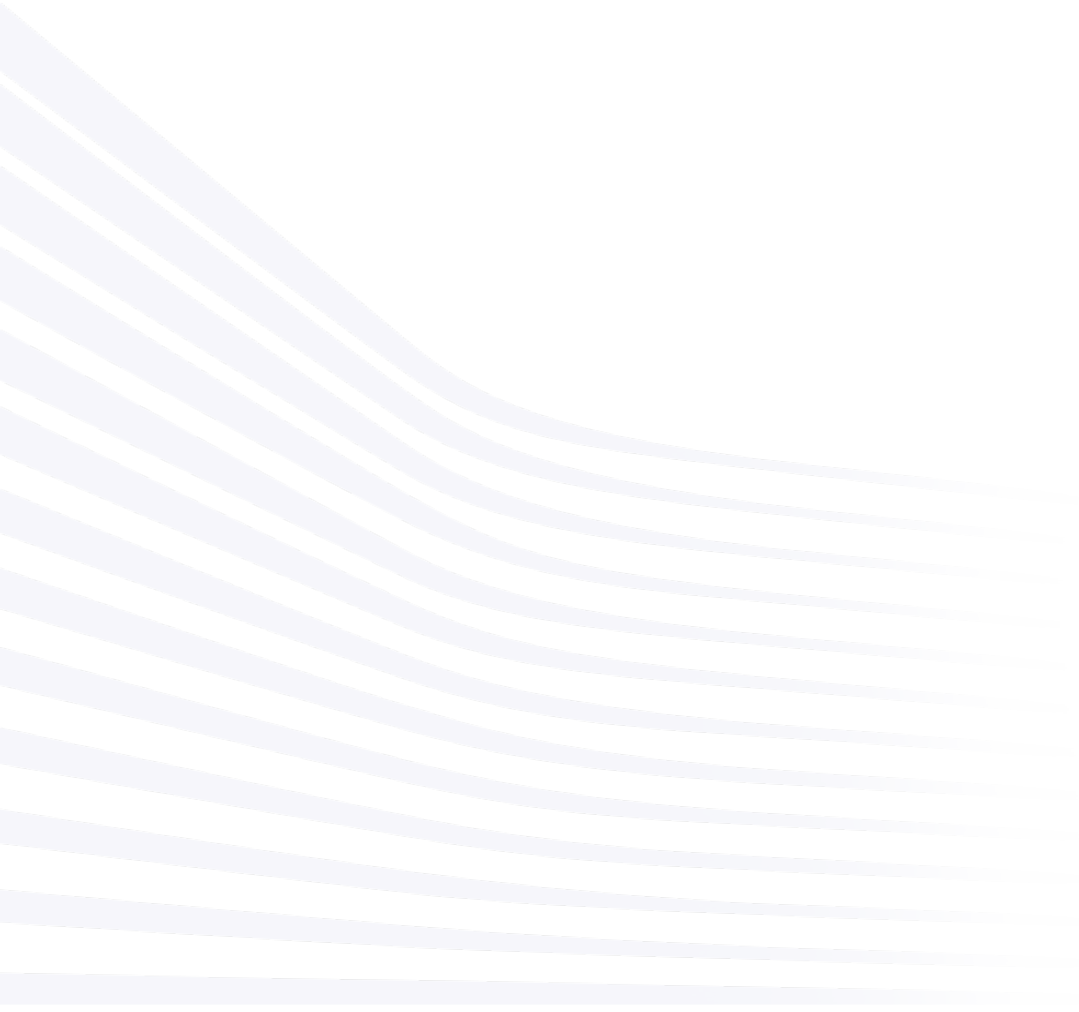

Alert number **[A12/0280/15](#)**



Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Miao miao**

Brand **Unknown**

Type / number of model **NO.LS10090**

Batch number **6904501101201**

Product description **Plastic doll with pink hair, shiny dress decorated with white fur and blue shoes. Package also includes three different plastic dogs. Packed in a pink cardboard box with a transparent plastic window on the front side.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains di-(2-ethylhexyl) phthalate (DEHP) above the permitted levels (measured values: up to 23.9 % by weight in the brown dog) which may harm the health of children, causing possible damage to the reproductive system. It also contains di-isononyl phthalate (DINP) (measured value 1.11% in the hands of the doll). According to the REACH Regulation, DEHP is prohibited in all toys and childcare articles and DINP is prohibited in toys or childcare articles that can be placed in the mouth by children.**

Country of origin **People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Other**

Date of entry into force

**09/01/2015**

Measures ordered by public authorities

**Ban on the marketing of the product and any  
accompanying measures  
Other**

Date of entry into force

**16/12/2014**

Alert number **[A11/0014/15](#)**



Notifying country **Hungary**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Voltage tester set**

Name **Voltage Tester Set**

Brand **A.I.&E. (on the product); LIFETIME TOOLS (on the p**

Type / number of model **40822 (on the packaging); FHT-106 (on the shorter product); FHT-202 (on the longer product)**

Batch number **8 711252 408224**

Product description **The set consists of 2 voltage testers with transparent covering. Packaging: blister.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The protection rim on the handle is too small. As a result, the user could accidentally touch the live metal tip during normal use. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 61243.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **06/11/2014**

Products were found and  
measures were taken also in

**The Netherlands**



Alert number **[A12/0281/15](#)**

Notifying country **Spain**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **Dyna**

Brand **Harley Davidson**

EC-type approval/model **FXDF and FXDF 103**

Production dates **Manufactured between 22-8-11 and 24-2-12.**

Product description **Large-cylinder motorcycle.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There may be corrosion in the banjo bolt threads of the front brake. The thread might consequently break and the banjo bolts loosen. This could cause deterioration in brake performance and a possible collision.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Other**

Date of entry into force **26/01/2015**

Products were found and measures were taken also in **Germany  
Denmark  
Finland  
Greece  
Hungary  
Ireland  
The Netherlands  
Norway  
Sweden  
United Kingdom**

Alert number **[A12/0282/15](#)**



Notifying country **Spain**

Product category **Protective equipment**

Type **Consumer**

Product **Safety shoes**

Name **Chaussure de sécurité (Safety shoes)**

Brand **Yiming**

Type / number of model **YM9775**

Batch number **Unknown**


Product description **Category II protective shoes; the brand, model number, size appear on a label stitched to the tongue. Description of the packaging: a cardboard box showing the brand.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains Chromium VI (measured value 5.8 mg/kg). Chromium VI is classified as sensitising and may trigger allergic reactions. The product does not comply with the requirements of the Personal Protective Equipment Directive (PPE).**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

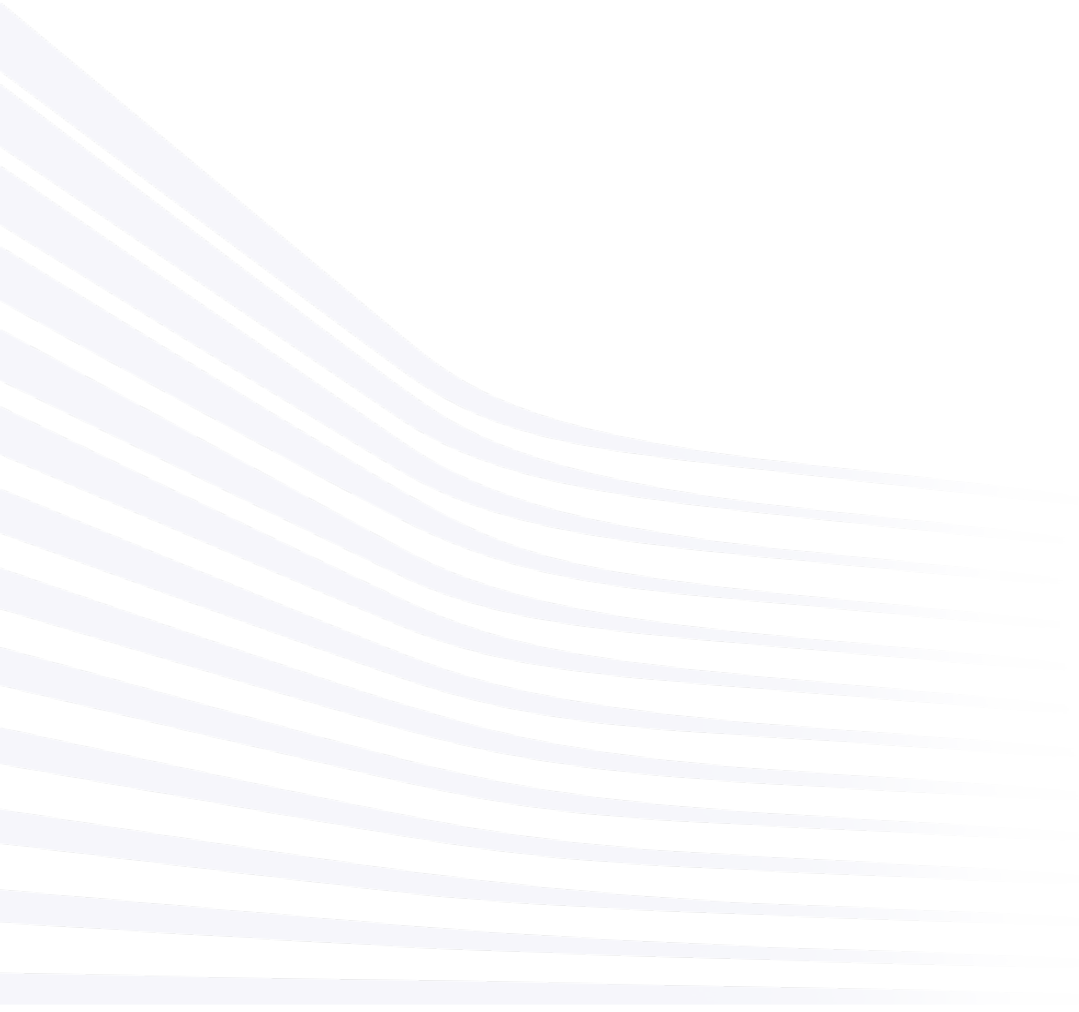

Alert number **[A12/0292/15](#)**



Notifying country	<b>Romania</b>
Product category	<b>Electrical appliances and equipment</b>
Type	<b>Consumer</b>
Product	<b>Electric lamp</b>
Name	<b>Lava Lampe (COUNTERFEIT PRODUCT)</b>
Brand	<b>Unknown</b>
Type / number of model	<b>Unknown</b>
Batch number	<b>Unknown</b>
Product description	<b>Decorative electric lamp packed in a cardboard box.</b>
Risk type	<b>Electric shock</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>Live parts are easily accessible when the lamp is plugged in. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Other</b>
Date of entry into force	<b>19/02/2015</b>

Alert number **[A12/0301/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Escalade**

Brand **Cadillac**

EC-type approval/model **Type: GMT926 EC type-approval number: e13\*2001/116\*0191\*05 - 07**

Production dates **European vehicles from 9 May 2011 to 21 May 2012.**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**It is possible for the ignition key to get stuck in the 'start' position if the vehicle's interior ambient temperature is sufficiently high. If the vehicle is driven under these conditions and the vehicle's interior temperature then cools, or if the vehicle experiences a significant jarring event, the ignition lock cylinder could move out of the 'start' position, rotate past the 'run' position, and move into the 'accessory' position. If this were to occur, engine power, power steering, and power braking would be affected, increasing the risk of a crash.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Spain  
The Netherlands**

Alert number **[A12/0283/15](#)**



Notifying country **Slovenia**

Product category **Construction products**

Type **Consumer**

Product **Carbon monoxide detector**

Name **Carbon Monoxide Alarm**

Brand **COMMEL**

Type / number of model **440-201**

Batch number **EAN 3858883835205**

Product description **Carbon monoxide detector packed in PVC blister.**

Risk type **Asphyxiation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product is not sufficiently sensitive with respect to the detection of carbon monoxide. The product does not comply with the relevant European standard EN 50291-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Date of entry into force **22/11/2013**

Alert number **[A12/0284/15](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's sweatshirt**

Name **Unknown**

Brand **Heavy Tools**

Type / number of model **W14-453**

Batch number **5 996400 564004**

Product description **Light grey children's sweatshirt with hood and kangaroo pocket. The product is decorated with a black inscription: "Keep Calm & Shine on HtLS". Size: 122-164**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product has a drawstring placed in the hood with free ends that may cause strangulation to children. The product does not comply with the relevant European standard EN 14682.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **11/12/2014**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

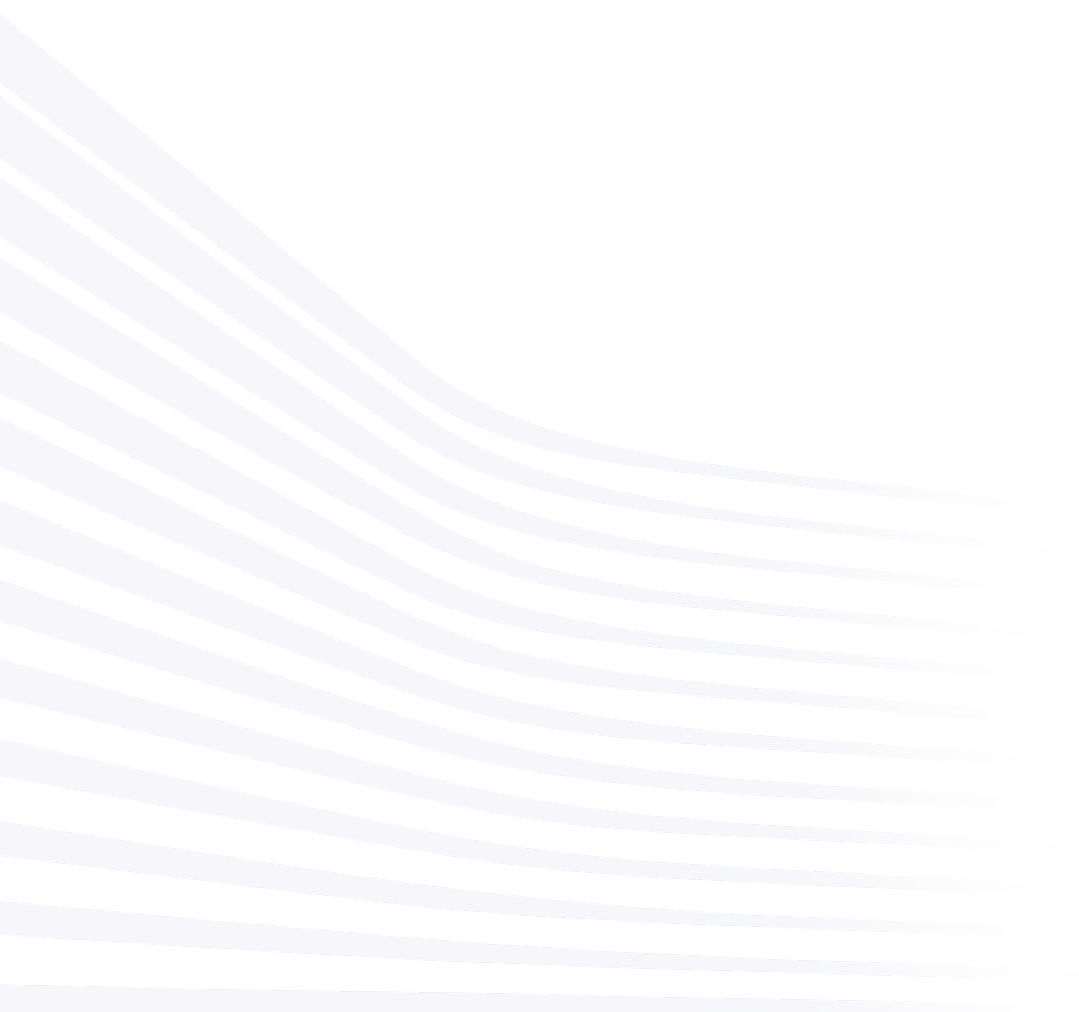

Alert number **[A12/0285/15](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's sweatshirt**

Name **Unknown**

Brand **Childhood**

Type / number of model **BA05**

Batch number **3660664067428**

Product description **Children's sweatshirt with hood and zip-fastener. The product is decorated with embroidered inscriptions: "PROS PORTS", "GOLDEN AGE", "52 CHAMPIONS PRO BOWL". The product is available in blue, grey and black colour. Size: 98-128**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The presence of cords with free ends in the hood can lead to strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Unknown**

Measures ordered by public authorities **Recall of the product from end users  
Other**


Alert number **[A12/0294/15](#)**



Notifying country	<b>Hungary</b>
Product category	<b>Childcare articles and children's equipment</b>
Type	<b>Consumer</b>
Product	<b>Soother</b>
Name	<b>I Love My Mommy Pacifier</b>
Brand	<b>Billy-Bob</b>
Type / number of model	<b>MOMMY</b>
Batch number	<b>658890900193</b>
Product description	<b>A pink and white, ergonomic, orthodontic, silicone pacifier. Packaging: blister.</b>
Risk type	<b>Chemical</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The product contains peroxide residues and Volatile Organic Compounds (VOC) - measured value of VOC: 0.82 %. The use of the pacifier can cause gastrointestinal irritation. The product does not comply with the relevant national legislation.</b>
Country of origin	<b>Taiwan</b>
Measures ordered by public authorities	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>01/09/2014</b>

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

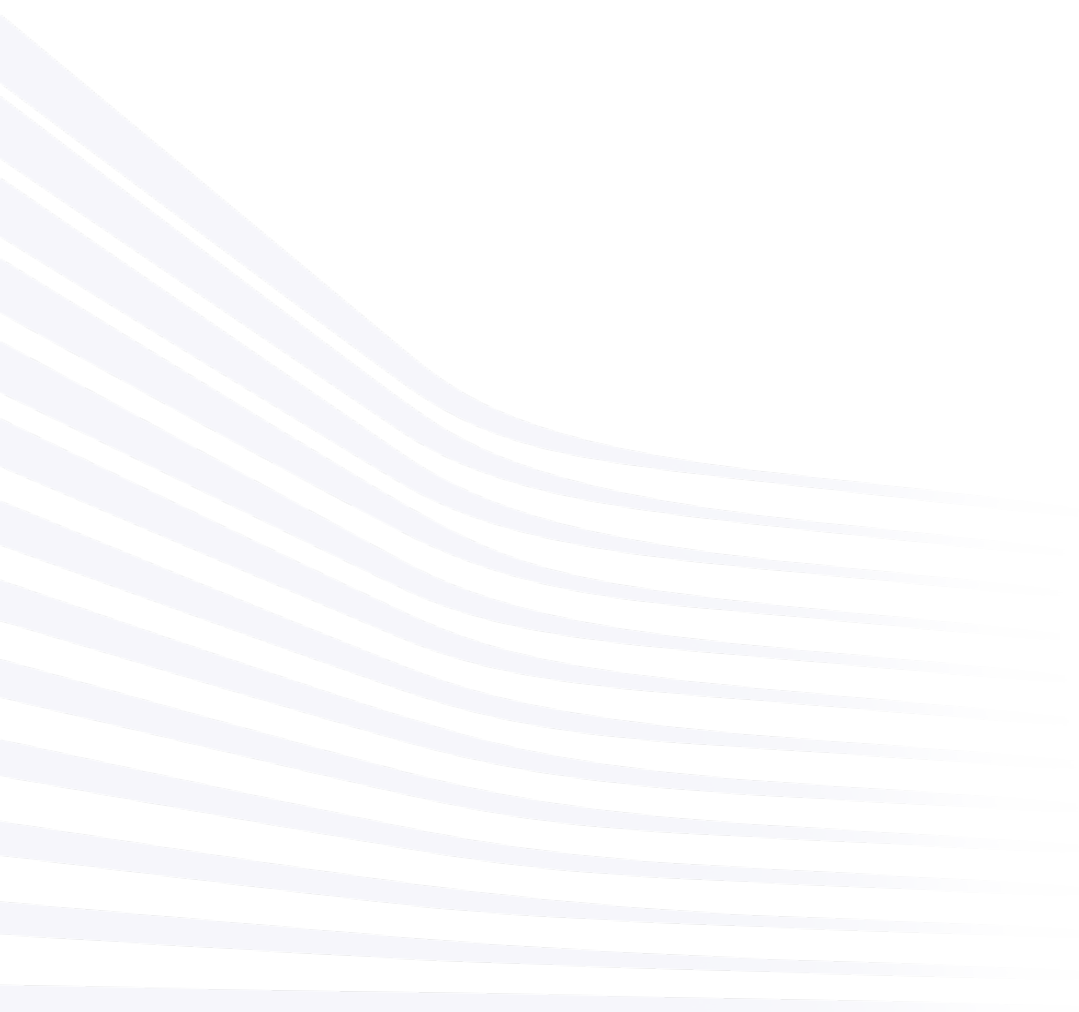

Alert number **[A12/0286/15](#)**



Notifying country	<b>Hungary</b>
Product category	<b>Toys</b>
Type	<b>Consumer</b>
Product	<b>Soap bubbles</b>
Name	<b>Spider Sense SPIDER-MAN Bubble wand</b>
Brand	<b>Marvel</b>
Type / number of model	<b>Réf. 106003, JL11A</b>
Batch number	<b>3760001674873</b>
Product description	<b>The red and blue toy soap bubble sword includes liquid (170 ml) and a ball skill game on the top. Size: 38 cm.</b>
Risk type	<b>Microbiological</b>
Risk description	<b>The total aerobic microbial count in the soapy water is too high and it contains Pseudomonas aeruginosa.</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>There is a risk of infection if the liquid is swallowed or comes into contact with the skin or eyes. The product does not comply with the requirements of the Toy Safety Directive.</b>
Country of origin	<b>France</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Other</b>

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**28/12/2014**

Alert number **[A12/0302/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Van**

Name **VIVARO-B**

Brand **Opel**

EC-type approval/model **Type: F7 EC-type approval: e1\*2007/46\*0575\*12, e1\*2007/46\*0575\*13; e1\*98/14\*0170\*30.**

Production dates **The vehicles affected were manufactured from May 2014 to October 2014.**

Product description **Van**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The seat mounting might fail in the event of an accident.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Croatia  
Hungary  
Ireland  
The Netherlands  
Norway  
Portugal  
Sweden  
Slovakia  
United Kingdom**

Alert number **[A12/0287/15](#)**



Notifying country **Bulgaria**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's sweatshirt**

Name **Unknown**

Brand **QUENNY GIRL- California 1985**

Type / number of model **N3-633**

Batch number **Unknown**


Product description **Sweatshirt designed for small children of up to 7 years of age, with a zip fastener, two pockets at the front and a hood. In the chest area, the following inscription is embroidered: "California HELLO STAR 1982".**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product poses a risk of strangulation due to the presence of an unattached drawstring with free ends in the hood. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

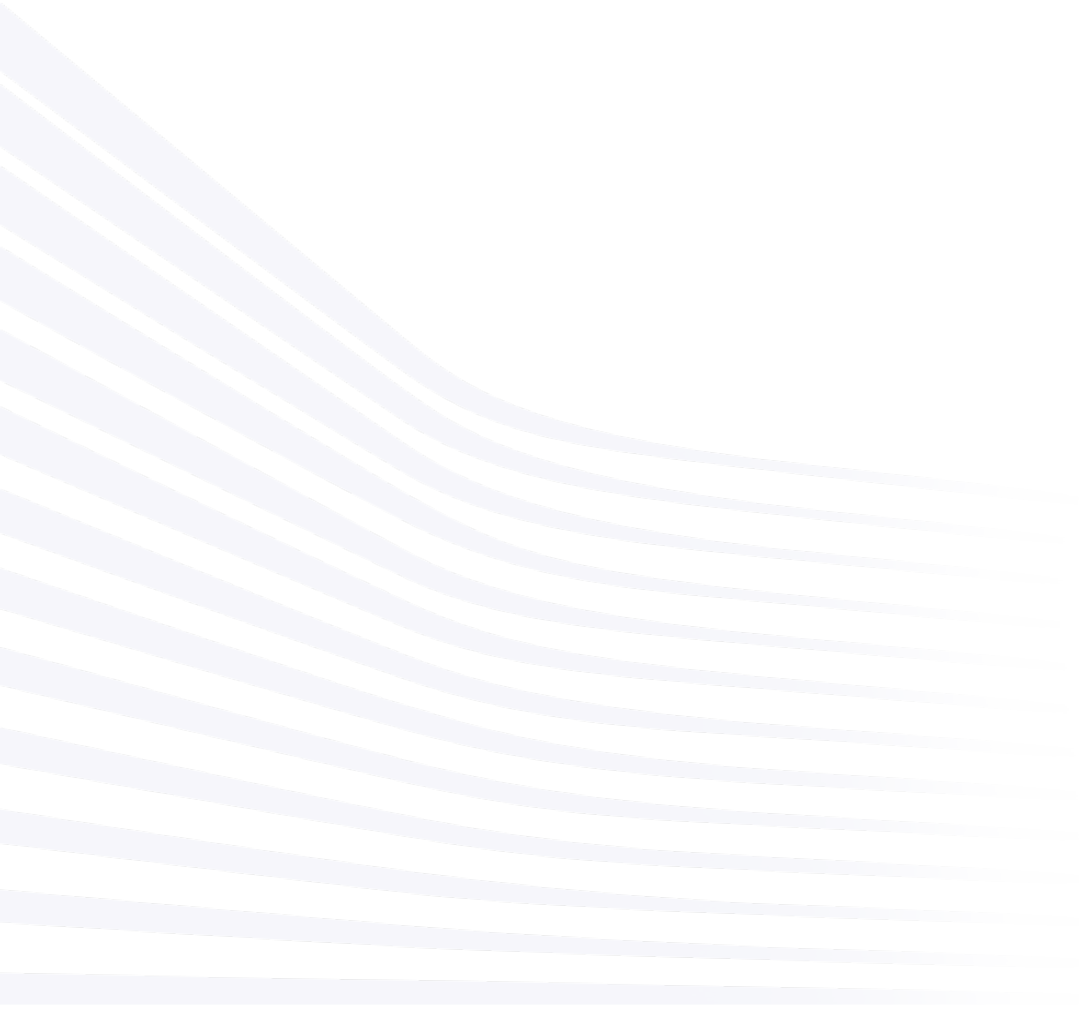

Alert number

**A12/0288/15**



Notifying country

**Bulgaria**

Product category

**Clothing, textiles and fashion items**

Type

**Consumer**

Product

**Children's trousers**

Name

**Unknown**

Brand

**J.N.S**

Type / number of model

**S-916**

Batch number

**Unknown**

Product description

**Children's trousers, designed for small children of up to 7 years of age, with an elastic cord at the waist and at the ends of the legs, with two pockets at the front and two at the back, embroidered with sequins.**

Risk type

**Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The presence of a functional cord in the waist area could lead to injuries. The product does not comply with the relevant European standard EN 14682.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities


**Withdrawal of the product from the market  
Other**



Alert number **[A12/0289/15](#)**



Notifying country	<b>Bulgaria</b>
Product category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Product	<b>Girls' dress</b>
Name	<b>Unknown</b>
Brand	<b>STELA</b>
Type / number of model	<b>Unknown</b>
Batch number	<b>Unknown</b>
Product description	<b>Dress designed for girls of up to 3 years of age. The dress is in grey colour, with pink and white checks and red or violet printed flowers. It has a flared skirt and functional cords.</b>
Risk type	<b>Injuries</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The product has functional elastic cords, with free ends in the waist area, which are too long and can become trapped during various activities of a child. A loop can be created that could lead to injuries to the child. The product does not comply with the relevant European standard EN 14682.</b>
Country of origin	<b>Bulgaria</b>
Measures ordered by public authorities	<b>Ban on the marketing of the product and any accompanying measures Other</b>

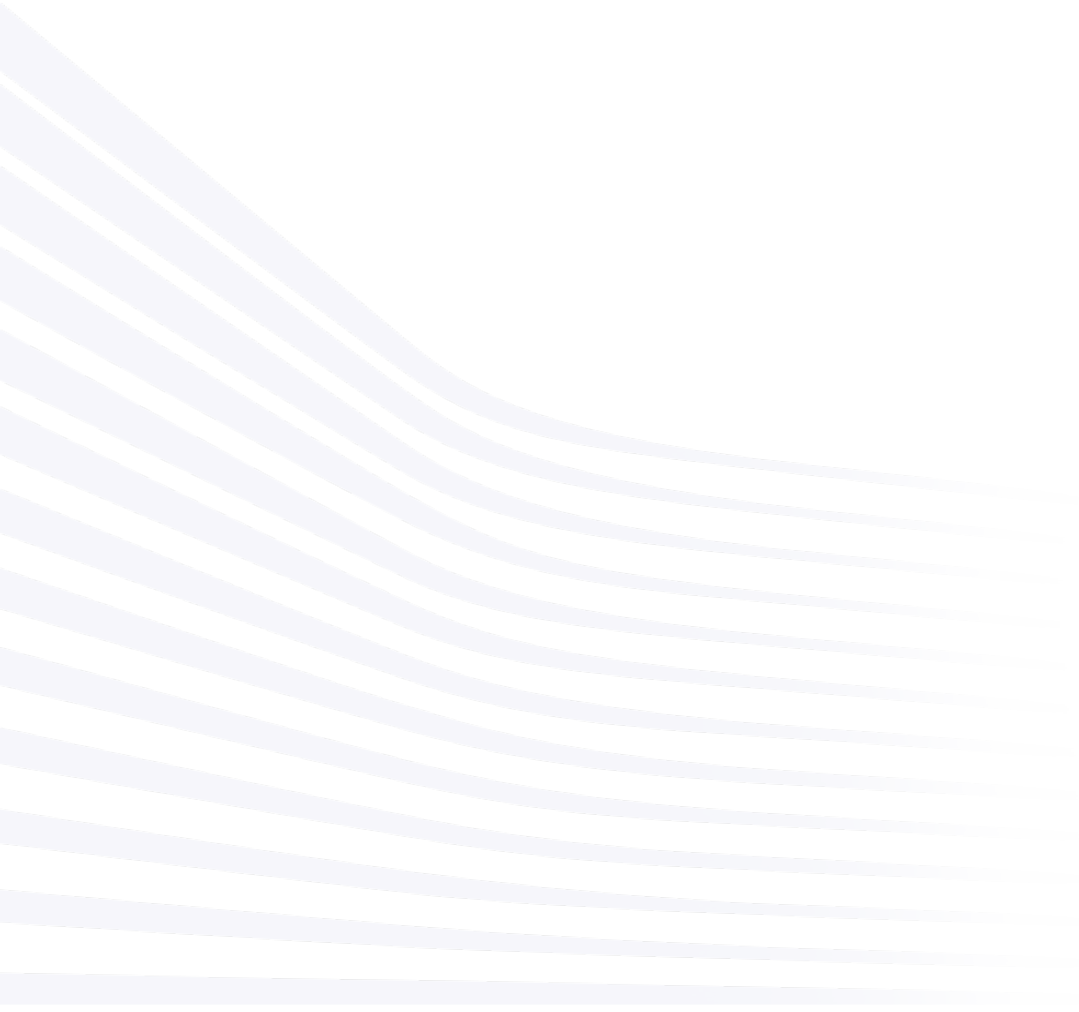

Alert number **[A12/0290/15](#)**



Notifying country **Bulgaria**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's sweatshirt**

Name **Unknown**

Brand **Dalef Wear Fashion**

Type / number of model **D-14136TE**

Batch number **Unknown**

Product description **Sweatshirt with long sleeves, designed for older children between 7 to 14 years of age. Available in various colours with two pockets at the front, a zip fastener and press studs for fastening at the front, and a hood provided with a functional cord. The letter B is sewn on the front and there are**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product has a functional cord with free ends in the neck area which is too long and may become trapped during various activities of a child, causing strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Unknown**

Measures ordered by public **Withdrawal of the product from the market**

authorities

**Other**

Date of entry into force

**29/01/2015**

Alert number **[A12/0303/15](#)**

Notifying country	<b>Portugal</b>
Product category	<b>Motor vehicles</b>
Type	<b>Consumer</b>
Product	<b>Passenger car</b>
Name	<b>S80, S60, V70, V60, XC60 and XC70</b>
Brand	<b>Volvo</b>
EC-type approval/model	<b>Vehicles with manual transmission.</b>
Production dates	<b>Production year: 2011 - 2015.</b>
Product description	<b>Passenger car with manual transmission.</b>
Risk type	<b>Injuries</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The handbrake may under certain conditions release inadvertently.</b>
Country of origin	<b>Sweden</b>
Measures taken by economic operators	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>26/02/2015</b>
Products were found and measures were taken also in	<b>Bulgaria Germany Denmark Spain Greece Hungary Ireland The Netherlands Sweden Slovenia Slovakia United Kingdom</b>

Alert number **[A12/0305/15](#)**



Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product **Rattle**

Name **Unknown**

Brand **Bao Bei Zhiyue**

Type / number of model **Item No: SK-3640**

Batch number **2012020536405**

Product description **Yellow and orange plastic rattle with three green balls, supplied in a transparent plastic bag.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The rattle may easily break and release small balls. A small child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

Products were found and  
measures were taken also in

**Denmark**

Alert number **[A12/0304/15](#)**

Alert number **[A12/0306/15](#)**



Notifying country **Sweden**

Product category **Jewellery**

Type **Consumer**

Product **Necklace**

Name **Unknown**

Brand **Lotta Design**

Type / number of model **LN3100**

Batch number **Unknown**

Product description **Silver coloured necklace with a pendant in the shape of a pram.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains 8.9% by weight of cadmium. Cadmium is classified as harmful if in contact with the skin. The product does not comply with the REACH Regulation.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Date of entry into force **27/08/2014**

Alert number **[A12/0307/15](#)**



Notifying country	<b>Sweden</b>
Product category	<b>Jewellery</b>
Type	<b>Consumer</b>
Product	<b>Necklace</b>
Name	<b>Unknown</b>
Brand	<b>Lotta Design</b>
Type / number of model	<b>VN216</b>
Batch number	<b>Unknown</b>
Product description	<b>Silver-coloured necklace consisting of three micro ball chains, rings with rhinestones and a lobster claw clasp with a silver plate indicating the trademark.</b>
Risk type	<b>Chemical</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The metal rings and the plate contain 37-41 % by weight of lead. Lead is harmful to human health. The product does not comply with the REACH Regulation.</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Other</b>
Date of entry into force	<b>27/08/2014</b>

Alert number **[A12/0308/15](#)**



Notifying country **Slovakia**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Pushchair**

Name **Unknown**

Brand **Strong Kids**

Type / number of model **B 310**

Batch number **Unknown**

Product description **Foldable pushchair with metallic frame and pink textile. The backrest is decorated with white patterns. It has a pink canopy, a shopping basket at the bottom, 4x2 plastic wheels, the front ones are revolving, the rear ones equipped with a red braking device. It has foam handles.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The pushchair is not designed with an appropriate locking device in the folding mechanism. This may result in accidental folding of the pushchair and consequent injuries for a child due to entrapment of fingers between moving parts. Furthermore the restraint system is not adequate to protect a child from falling. This may cause injuries to children. The product does not comply with the relevant European standard EN 1888.**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures**  
**Other**

Alert number **[A12/0309/15](#)**



Notifying country **Sweden**

Product category **Jewellery**

Type **Consumer**

Product **Necklace**

Name **Unknown**

Brand **Lotta Design**

Type / number of model **LN415**

Batch number **Unknown**

Product description **Blue micro ball chain with a pendant in the shape of a cat and with a silver coloured plate indicating the trademark.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The trademark plate on the necklace contains 15% by weight of cadmium and 33 % by weight of lead. Cadmium is classified as harmful if in contact with the skin and lead is harmful to human health. The product does not comply with the REACH Regulation.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Date of entry into force **27/08/2014**

Alert number

**[A12/0310/15](#)**



Notifying country **Sweden**

Product category **Jewellery**

Type **Consumer**

Product **Necklace**

Name **Unknown**

Brand **Lotta Design**

Type / number of model **VN223**

Batch number **Unknown**

Product description **Silver coloured necklace with five different heart-shaped pendants attached to a ring, some hearts with rhinestones and some in printed metal. A silver plate with the trademark.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The metal in the ring and the heart pendants contains 14 % by weight of cadmium and the trademark plate contains 34 % by weight of lead. Cadmium is classified as harmful if in contact with the skin and lead is harmful to human health. The product does not comply with the REACH Regulation.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Other**

Date of entry into force **27/08/2014**



Alert number

**[A12/0311/15](#)**



Notifying country **Sweden**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Pushchair**

Name **Unknown**

Brand **Adil**

Type / number of model **JX2510/2512**

Batch number **Unknown**

Product description **Baby pushchair with reversible handle and swivel front wheels. The textile of the pushchair is in different colour patterns such as grey with white flowers and grey with white and blue squares.**

Risk type **Entrapment  
Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The restraint system is not adequate to protect a child from falling, which may result in injuries. In the front part there are shears and compression points between moving parts which pose a risk of entrapment. The product does not comply with the relevant European standard EN 1888.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **07/01/2015**

Measures ordered by public authorities **Destruction of the product  
Other**

Date of entry into force **07/01/2015**

Alert number **[A12/0312/15](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' outfit**

Name **Unknown**

Brand **H.Plenty**

Type / number of model **ZF-1148**

Batch number **Unknown**

Product description **Grey leisure outfit made of trousers and a sweatshirt with a lined hood. The product is decorated with pink stripes and inscriptions. Size: 6-14 years.**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The drawstrings with free ends in the hood may become trapped during various activities of a child, causing strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Unknown**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **12/12/2014**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

