

Alert number **[A12/0636/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **1) Beauty In Marine Trip, 2) Rejoice baby Mermaid, 3) Xinbeier**

Brand **Samefa**

Type / number of model **Ref. 1) 4448, 2) 4445, 3) 4490**

Batch number **1) 8435114944483, 2) 8435114944452, 3) 8435114944902**

Product description **Mermaid dolls with accessories in blister packaging and with cardboard label indicating the importer's details, CE marking, barcode and age (3+ years).**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The dolls contain di-(2-ethylhexyl) phthalate (DEHP) (measured value 20% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The doll "Xinbeier" contains additionally di-isononyl phthalate (DINP) (measured value 12.6% by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles while the phthalates DINP, DNOP and DIDP are prohibited in toys or childcare articles that can be placed in the mouth by children.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Other**

Date of entry into force

**27/04/2015**

Alert number **[A12/0632/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **CBR1000RR SP**

Brand **Honda**

EC-type approval/model **Type: SC59; EC type-approval: E4\*2002/24\*1726**

Production dates **Vehicles manufactured in 2014 and 2015 are concerned.**

Product description **Motorcycle.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Due to insufficient tightening, the connecting rod nut for the shock absorber may become detached and thus impair the shock-absorbing effect. In the worst-case scenario the rider may lose control over the motorcycle.**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Denmark  
France  
Greece  
Croatia  
Hungary  
Ireland  
Malta  
The Netherlands  
Portugal  
Sweden  
United Kingdom**



Alert number **[A12/0647/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Shock absorbers**

Name **Unknown**

Brand **Öhlins Racing**

EC-type approval/model **Type: TTX36**

Production dates **Unknown**

Product description **Shock absorbers manufactured between 5 November 2013 and 24 March 2015 and originally equipped on certain motorcycles.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Due to insufficient tightening, the connecting rod nut for the shock absorber may become detached and thus impair the shock-absorbing effect. In the worst-case scenario the rider may lose control over the motorcycle.**

Country of origin **Sweden**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Denmark  
Greece  
The Netherlands  
Norway  
Slovenia  
United Kingdom**

Alert number

**[A12/0638/15](#)**



Notifying country **United Kingdom**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **USB power supply**

Name **iTech USB Mains Power Adapter**

Brand **PMS International**

Type / number of model **925019**

Batch number **Bar code 5025572131513**

Product description **White USB mains power adaptor with a red light and USB port, supplied without a USB lead.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The internal wiring connections are not sufficient and rely upon solder to maintain their position; a loose wire could reduce creepage distances and clearances. The adaptor pins are inadequately sized which could cause damage to the socket and the adaptor resulting in live parts being exposed. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950 and the relevant national standard.**

Country of origin **People's Republic of China**

Measures taken by economic **Recall of the product from end users**

operators **Other**

Date of entry into force **24/04/2015**

Alert number **[A12/0649/15](#)**



Notifying country **Spain**

Product category **Protective equipment**

Type **Consumer**

Product **Safety boots**

Name **Unknown**

Brand **Bellota**

Type / number of model **1) Model 72205SP; 2) Model 72208B, 72221, 72226, 72227 and 72209B**

Batch number **1) BES 197; 2) BES191  
8414299279214 and 8414299597431**

Product description **Safety boots in cardboard boxes showing contact details of the importer, with a label indicating the model, barcode, size and CE marking.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains Chromium (VI) (measured value up to 45.3 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the requirements of the Personal Protective Equipment Directive.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **23/04/2015**



Alert number **[A12/0635/15](#)**



Notifying country **United Kingdom**

Product category **Other**

Type **Consumer**

Product **Shotgun**

Name **Shotgun 887**

Brand **Remington**

Type / number of model **Model 887**

Batch number **Products manufactured between 1 December 2013 and 24 November 2014.**

Product description **Shotgun**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The shotgun may unintentionally discharge when chambering a live round when the safety mechanism is on. This is due to the firing pin which may bind in the forward position within the bolt.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Ireland**

Alert number **[A12/0645/15](#)**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product **Bath toys**

Name **Lovely Collection**

Brand **Unknown**

Type / number of model **Unknown**

Batch number **Unknown**

Product description **The bath toy set consists of 6 different animals: giraffe, zebra, camel, elephant, tiger, lion, made of coloured soft plastic with inserted whistle. Toys packed in a transparent plastic bag stapled to a cardboard label.**

Risk type **Chemical Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toys contain di-isononyl phthalate (DINP) (measured value 40% by weight) and di-isodecyl phthalate (DIDP) (measured value 6.8% by weight). According to the REACH Regulation the phthalates DINP, DNOP and DIDP are prohibited in toys or childcare articles that can be placed in the mouth by children. Furthermore, the heads of the giraffe, camel and zebra protrude and may block the airways when put in the mouth. Moreover, small parts can detach (whistles of lion and elephant). A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety**

**Directive and the relevant European standard EN 71-1.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Ban on the marketing of the product and any accompanying measures  
Other**

Date of entry into force

**29/04/2015**

Alert number **[A12/0633/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Antara**

Brand **Opel**

EC-type approval/model **Type:L-A; EC type-approval: e4\*2001/116\*0118\*03, e4\*2001/116\*0118\*08, e4\*2001/116\*0118\*09**

Production dates **Vehicles manufactured between 2007 and 2010 are concerned.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There is a possibility of the vehicle starting unintentionally when the ignition key is in the 'off' position in the ignition lock, in which case the starter motor may be activated if the vehicle is in gear, so that the vehicle starts to move. This could lead to persons, in particular outside the vehicle, being injured.**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Bulgaria  
Denmark  
Spain  
Croatia  
Hungary  
Ireland  
Norway  
Portugal  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number

**[A12/0637/15](#)**



Notifying country **Bulgaria**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's trousers**

Name **Unknown**

Brand **Holly Work**

Type / number of model **Art. No. XW-9892**

Batch number **Unknown**

Product description **Children's sports trousers with drawstrings in the waist area, intended for children from 8 to 14 years.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The long drawstrings in the waist area may become trapped during various activities of a child, causing injuries. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **05/05/2015**

Alert number **[A12/0639/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Captiva**

Brand **Chevrolet**

EC-type approval/model **Type: KLAC; EC type-approval: e4\*2001/116\*0113\*08; e4\*2001/116\*0113\*15.**

Production dates **Vehicles manufactured between 2007 and 2010 are concerned**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There is a possibility of the vehicle starting unintentionally when the ignition key is in the 'off' position in the ignition lock, in which case the starter motor may be activated if the vehicle is in gear, so that the vehicle starts to move. This could lead to persons, in particular outside the vehicle, being injured.**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Denmark  
Spain  
Greece  
Croatia  
Hungary  
Ireland  
Malta  
The Netherlands  
Norway  
Portugal  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number **[A12/0641/15](#)**



Notifying country	<b>United Kingdom</b>
Product category	<b>Furniture</b>
Type	<b>Consumer</b>
Product	<b>Wooden bunk bed</b>
Name	<b>Emily</b>
Brand	<b>Unknown</b>
Type / number of model	<b>Unknown</b>
Batch number	<b>Unknown</b>
Product description	<b>Solid wood bunk bed with vertical and horizontal slats. It is available in pine, white, pink or blue, and it can be sold optionally with mattresses and under bed storage.</b>
Risk type	<b>Entrapment</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The space between the vertical bars in the head and foot boards of the bed is large enough for children to insert their head, which can become trapped. The product does not comply with the relevant European standard EN 747.</b>
Country of origin	<b>Poland</b>
Measures ordered by public authorities	<b>Temporary ban on the supply, offer to supply and display of the product Other</b>



Alert number

**[A12/0642/15](#)**



Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product **Bath toys**

Name **Lovely Collection**

Brand **Unknown**

Type / number of model **Unknown**

Batch number **Unknown**

Product description **The bath toy set consists of 6 different animals: cat, goose (swan), duck, chicken, cow, made of coloured soft plastic with inserted whistle. The toys are packed in a transparent plastic bag stapled to a cardboard label.**

Risk type **Chemical  
Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The toys contain di-isononyl phthalate (DINP) (measured value up to 47% by weight) and di-isodecyl phthalate (DIDP) (measured value 6.0% by weight). According to the REACH Regulation the phthalates DINP, DNOP and DIDP are prohibited in toys or childcare articles that can be placed in the mouth by children. Furthermore, the head of the cat, hen, swan and duck, as well as the cow's horns and swan's wing, protrude and may block the airways when put in the mouth. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Ban on the marketing of the product and any  
accompanying measures  
Other**

Date of entry into force

**29/04/2015**

Alert number

**A12/0640/15**



Notifying country **Estonia**

Product category **Toys**

Type **Consumer**

Product **Plastic dolls**

Name **FROZENFR**

Brand **LE WAN JIA**

Type / number of model **Unknown**

Batch number **4694902075523**


Product description **Set of four plastic dolls, a snowman and a reindeer.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The dolls contain dibutyl phthalate (DBP) (measured value: 10% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

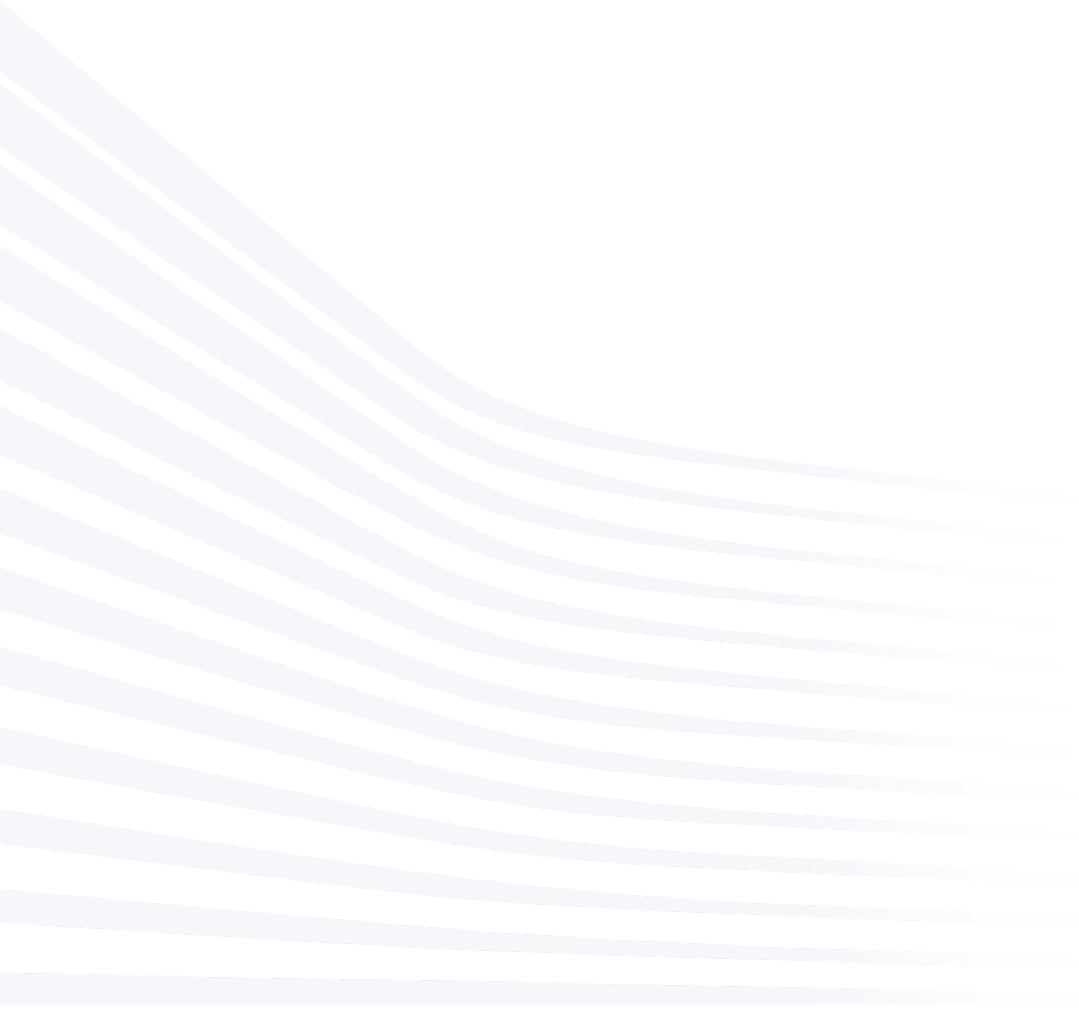

Alert number **[A12/0646/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **YZF-R1M**

Brand **Yamaha**

EC-type approval/model **EC type approval: e13\*2002/24\*0740  
Type: RN32**

Production dates **Unknown**

Product description **The vehicles concerned are manufactured in 2015.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Due to insufficient tightening, the connecting rod nut for the shock absorber may become detached and thus impair the shock-absorbing effect. In the worst-case scenario the rider may lose control over the motorcycle.**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users  
Other**

Products were found and measures were taken also in **Denmark  
France  
Greece  
Croatia  
The Netherlands  
Norway  
Portugal  
Sweden  
Slovenia  
United Kingdom**

Alert number

**A12/0648/15**



Notifying country **Portugal**

Product category **Cosmetics**

Type **Consumer**

Product **Skin-lightening product**

Name **Caro white**

Brand **Unknown**

Type / number of model **Unknown**

Batch number **6181100531008**

Product description **Skin-lightening cream in 30 ml white plastic tube with orange, green and white inscriptions and orange cap.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **According to the label, the product contains hydroquinone, which may cause skin irritation and dermatitis. The product does not comply with the Cosmetic Products Regulation.**

Country of origin **Ivory Coast**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **27/03/2015**

Alert number

**A12/0643/15**



Notifying country **Portugal**

Product category **Cosmetics**

Type **Consumer**

Product **Skin-lightening product**

Name **Skin Light**

Brand **Unknown**

Type / number of model **Expiry date: 14/02/17  
Lot no.: u/CSL 015 STD  
Production date: 14/02/15**

Batch number **Barcode: 6043000032804**

Product description **Skin-lightening cream in 250 ml plastic bottle with orange cap and blue and orange inscriptions.**

Risk type **Chemical**


Legal provisions (at EU level) and European standards against which the product was tested and did not comply **According to the label, the product contains hydroquinone, which may cause skin irritation and dermatitis. The product does not comply with the Cosmetic Products Regulation.**

Country of origin **Ivory Coast**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **27/03/2015**

Alert number **[A12/0634/15](#)**

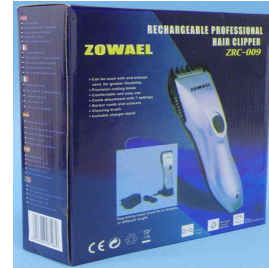

Notifying country **Hungary**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Hair clippers**

Name **Professional Clipper (on the product), Rechargeable Professional Hair Clipper (on the packaging)**

Brand **TOSHIKO (on the product), ZOWAEL (on the packaging)**

Type / number of model **TK9000HQ (on the product), ZRC-009 (TK9000HQ (on the packaging)**

Batch number **6 928686 481989**

Product description **Hair clipper with built-in rechargeable battery. A battery charger is supplied with the product. Packaging: cardboard box.**

Risk type **Electric shock  
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cross sectional area of the internal wires of the charger is insufficient, in case of a short circuit, the wires could overheat. The dimension of the plug and the socket outlet of the battery charger are inadequate and as a result live parts are accessible during connection. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**04/12/2014**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**