

Alert number **[A12/0925/15](#)**



Notifying country **Finland**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Highchair**

Name **Sofus**

Brand **Carena**

Type / number of model **Art. no 62000
Serial no: 6200515907411315003**

Batch number **7321599001081**

Product description **Highchair which can also be used as a combination of a chair and small table.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The restraint system does not sufficiently protect the child from falling (e.g. leg openings are too large). In addition, there are accessible moving parts operated by springs in which the fingers of a child may become trapped. The product does not comply with the relevant European standard EN 14988.**

Country of origin **Latvia**

Measures taken by economic operators **Withdrawal of the product from the market
Other**

Alert number **[A12/0940/15](#)**



Notifying country **Norway**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Child's bicycle seat**

Name **Zenith Relax**

Brand **Hamax**

Type / number of model **HAM 553053, HAM 553052, HAM553062**

Batch number **N/A**

Product description **Grey child-seat for bicycles with red seat padding and a grey recliner knob at the front.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The seat has a weak point underneath, which could result in the seat breaking and falling off the bike.**


Country of origin **Norway**

Measures taken by economic operators **Recall of the product from end users
Other**

Date of entry into force **29/05/2015**

Products were found and
measures were taken also in

Finland
Sweden

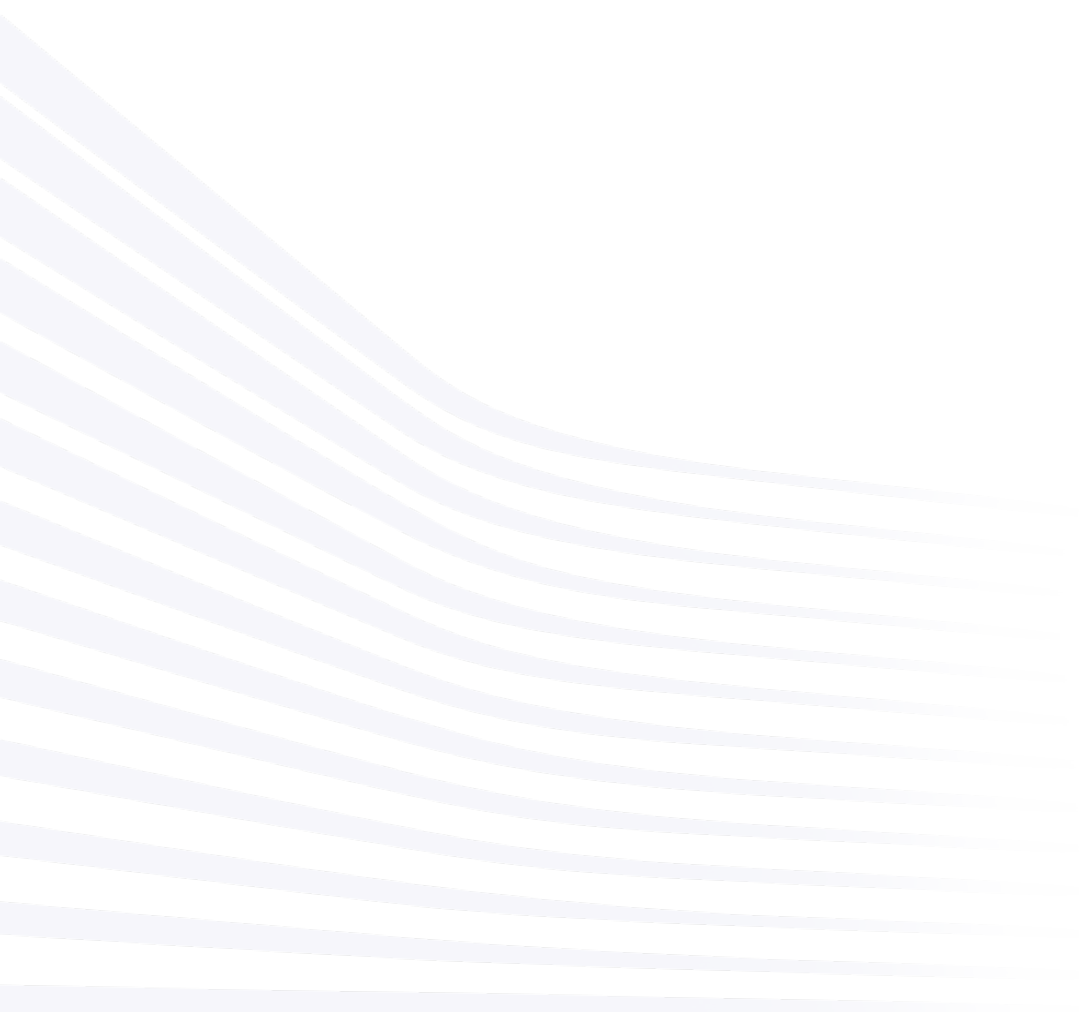

Alert number **[A12/0903/15](#)**



Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' swim set**

Name **Unknown**

Brand **Katia**

Type / number of model **XA 13006**

Batch number **5873415750069**

Product description **Yellow swim set consisting of a bikini and a skirt. The set is intended for girls up to 4 years old and has functional cords to be tied at the back.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cords in the back area can become trapped and cause injuries to children. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Alert number

[A12/0921/15](#)



Notifying country **Germany**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Fog machine**

Name **Showlite SN-400**

Brand **Unknown**

Type / number of model **Serial number: 00028944**

Batch number **Unknown**

Product description **Fog machine supplied with a remote control that plugs into a socket outlet on the fog machine.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The remote-control socket outlet on the fog machine is of the type used for the mains and the earth connection is used as the power supply for the remote-control. If another device, the housing of which is earthed, is connected to the remote-control socket outlet, the housing of the second device will be live. The product does not comply with the requirements of the Low Voltage Directive and the relevant standard EN 60320.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Other**

Date of entry into force **10/06/2015**



Alert number **[A12/0926/15](#)**



Notifying country **Norway**

Product category **Machinery**

Type **Consumer**

Product **Electrical scissor jack**

Name **Scissor Jack**

Brand **Hamron**

Type / number of model **601033**

Batch number **Unknown**

Product description **Electrical scissor jack in a case.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The jack, if raised to half-position or more, can break when lowering the rated load causing injuries to the user. The product does not comply with the requirements of the Machinery Directive and the relevant European standard EN 1494.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Other**

Date of entry into force **10/06/2015**

Alert number **[A12/0904/15](#)**

| | |
|---|--|
| Notifying country | Austria |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | Motorcycle |
| Name | 1290 Super Duke R |
| Brand | KTM |
| EC-type approval/model | 1290 |
| Production dates | Model year 2014 |
| Product description | Motorcycle, engine capacity 1301 cc, 2-cylinder, 4-stroke V 75° engine, liquid-cooled. |
| Risk type | Fire |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | Small amounts of fuel may leak from two threaded inserts on the fuel tank where the internal part of the overflow pipe is secured to the inside of the fuel tank. |
| Country of origin | Austria |
| Measures taken by economic operators | Recall of the product from end users Other |
| Date of entry into force | 02/07/2015 |
| Products were found and measures were taken also in | Germany Denmark Greece Croatia Ireland The Netherlands Norway Portugal Sweden Slovenia United Kingdom |

Alert number **[A12/0924/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Caravan/motorhome**

Name **Various**

Brand **Dethleffs**

EC-type approval/model **EG/CE 001; e1*2007/46*0046*
EG/CT 001; e1*2007/46*0047*
EG/DF 003; e1*2001/116*0416*
EG/DF 004; e1*2001/116*0442*
EG/Di 001; e1*2001/116*0250***

Production dates **Vehicles from model year 2011 until the end of May 2015 are affected.**

Product description **Caravan / motorhome.**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A defect in the control mechanism for the waste water pipe and waste water tank heating system could lead to a fire.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Other**

Products were found and measures were taken also in **Spain
Croatia
Slovenia**

Alert number **[A12/0936/15](#)**



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's sandals**

Name **Unknown**

Brand **My Beach Spirit**

Type / number of model **CHAN 282**

Batch number **8431116522827**

Product description **Plastic sandals with flower-shaped decorations (footwear for children under 3 years of age: sizes 22 and 23).**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains small parts (the flower-shaped decorations) that can be easily detached. A child could put them in the mouth and choke on them.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **24/06/2015**

Alert number **[A12/0905/15](#)**

| | |
|---|---|
| Notifying country | Germany |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | Passenger car |
| Name | Viper |
| Brand | Dodge |
| EC-type approval/model | Type: ZD EC type-approval: individual approval |
| Production dates | Vehicles manufactured between 28 November 2012 and 25 June 2014 are affected. |
| Product description | Passenger car. |
| Risk type | Injuries |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | Incorrect distance between the seat rail position sensors can result in incorrect speed of inflation of the airbags. |
| Country of origin | United States |
| Measures taken by economic operators | Recall of the product from end users Other |
| Products were found and measures were taken also in | The Netherlands |

Alert number **[A12/0906/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Soft toy**

Name **Unknown**

Brand **Naibert**

Type / number of model **Item 2291**

Batch number **8436041423652**

Product description **Plush dice with rhinestones and a suction cup. Packaging: transparent bag containing 12 units in different colours.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The rhinestones and suction cup may come off the dice, generating small parts. A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **24/06/2015**

Alert number **[A12/0907/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Soft toy key-ring**

Name **Unknown**

Brand **Unknown**

Type / number of model **Ref 19-082**

Batch number **8400000010627**

Product description **Green plush, four-leaf clover with a smiley face. A key-ring is attached to the toy.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The ring attached to the toy may come loose, generating a small part. A child could put it in the mouth and choke on it. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **29/06/2015**

Alert number

[A12/0908/15](#)

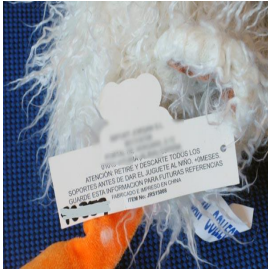

Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Soft toy**

Name **Unknown**

Brand **Jorsan**

Type / number of model **JRS15008**

Batch number **Unknown**

Product description **Soft toy in the form of a cockerel. A label bearing information on the importer and origin is attached to the toy.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy's eyes can detach, generating small parts. A child could put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **29/06/2015**

Alert number **[A12/0920/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Trailer**

Name **WEB 14, WEB 20, WEB 30**

Brand **Unsinn**

EC-type approval/model **Type: K 10-13, P 10-18; EC type-approval: e1*2007/46*0140*02, e1*2007/46*0893*01**

Production dates **The trailers concerned were manufactured between 2013 and 2015.**

Product description **Vehicle trailer.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The support bracket on the drawbar is missing. As a result, the emergency brake function of the trailer could fail when the vehicles are separated, because the drawbar first touches the road surface with the lower end of the brake lever after separation from the towing vehicle.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Other**

Products were found and measures were taken also in **The Netherlands**

Alert number **[A12/0909/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorhome**

Name **K 400 Van Exclusive, K 400, K 500, TI 640, TI 680, TI 685, TI 690**

Brand **Fendt**

EC-type approval/model **e13*2001/116*0263*, e13*2007/46*0263*, e13*2001/116*0998*, e13*2007/46*0998*, e13*2001/116*0263***

Production dates **Motorhomes manufactured between 2007 and 2012.**

Product description **Motorhome.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The adhesive bond between the acrylic pane of the panoramic window fitted above the driver's cab and the roof body may break when the vehicle is in motion, with the consequent danger of the window falling out.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Other**

Products were found and measures were taken also in **The Netherlands**

Alert number

A12/0910/15



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Plug adaptor**

Name **Adaptador Multivia de 3 Tomas**

Brand **Kde**

Type / number of model **model 16Z00006, ref. 160065**

Batch number **8435147160065**

Product description **White, 3-way plug adaptor with switch; packed in a blister pack.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Live parts of the sockets are accessible. The product does not comply with the relevant national standard.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **22/09/2014**

Alert number **[A12/0937/15](#)**



Notifying country **Spain**

Product category **Protective equipment**

Type **Consumer**

Product **Safety shoes**

Name **Unknown**

Brand **Super Ego**

Type / number of model **KTA 1002**

Batch number **8414162091578**

Product description **Safety shoes Category II supplied in cardboard boxes.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of Chromium VI in the upper of the shoes is too high (measured value: 4.6 mg/kg). Chromium VI is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **29/06/2015**

Alert number **[A12/0911/15](#)**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Travel plug adaptor**

Name **Unknown**

Brand **Primera**

Type / number of model **ref. BAP003**

Batch number **7899055277306**

Product description **White travel plug adaptor in a transparent blister pack.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Live parts of the socket are accessible. The product does not comply with the relevant national standard.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **06/04/2015**

Alert number **[A12/0912/15](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **NX200t**

Brand **Lexus**

EC-type approval/model **Type: AGZ; EC type-approval: e6*2007/46*0111***

Production dates **The vehicles concerned were built between 2014 and 2015. Hybrid models are not affected.**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Plastic residues in the ABS actuator may cause delays in the hydraulic pressure regulation for the braking system. Drivers may consequently lose control of the vehicle, thus increasing the risk of an accident.**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Other**

Products were found and measures were taken also in **Bulgaria
Hungary
Lithuania
Romania
Sweden
United Kingdom**

Alert number

[A11/0062/15](#)



Notifying country **Germany**

Product category **Lighting equipment**

Type **Consumer**

Product **LED light strip**

Name **1) LED Strip and 2) LED Strip Light**

Brand **Unknown**

Type / number of model **Model: SMD 3528 - 60 / M
No: 5050**

Batch number **Unknown**

Product description **LED light strip.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The mains plug does not have sufficient plug pin insulation. Contact with the live part of the plug pins is therefore possible when inserting or removing the plug from the mains socket. The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **28/04/2015**

Measures taken by economic operators **Destruction of the product**
Other

Alert number **[A12/0913/15](#)**



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's shirt**

Name **Unknown**

Brand **Dr. Kid**

Type / number of model **ref. B69.DK375.C160**

Batch number **9000002133707**

Product description **Checked shirt for children (sample size 12M).**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small buttons may easily detach. A child could put them in the mouth and choke. The product does not comply with the relevant national standard UNE 40902.**

Country of origin **Portugal**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **12/05/2015**

Alert number **[A11/0063/15](#)**



| | |
|---|---|
| Notifying country | Germany |
| Product category | Lighting equipment |
| Type | Consumer |
| Product | LED light strip |
| Name | Decoration Light |
| Brand | Unknown |
| Type / number of model | Type 5050 |
| Batch number | 69 25 44 88 15 136 |
| Product description | LED light strip. |
| Risk type | Electric shock |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The mains plug does not have sufficient plug pin insulation. Contact with the live part of the plug pins is therefore possible when inserting or removing the plug from the mains socket. The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard. |
| Country of origin | People's Republic of China |
| Measures ordered by public authorities | Ban on the marketing of the product and any accompanying measures Other |

Date of entry into force **28/04/2015**

Measures taken by economic operators **Destruction of the product**
Other

Alert number **[A12/0914/15](#)**



| | |
|---|--|
| Notifying country | Spain |
| Product category | Electrical appliances and equipment |
| Type | Consumer |
| Product | Plug adaptor |
| Name | Adaptador 3 Vias Tipo Cruz |
| Brand | Unknown |
| Type / number of model | REF. 00007 |
| Batch number | 8401886000078 |
| Product description | Black, three-way plug adaptor with markings 'MAX. 2200W 10A 250V. CE'. Supplied in a a blister pack. |
| Risk type | Electric shock |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | One pin of a plug can be inserted leaving the other live pin accessible. The product does not comply with the relevant national standard. |
| Country of origin | Unknown |
| Measures ordered by public authorities | Withdrawal of the product from the market Other |
| Date of entry into force | 15/04/2014 |

Alert number

[A11/0064/15](#)



Notifying country **Germany**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Power supply**

Name **Power Adaptor**

Brand **Unknown**

Type / number of model **S-100 D**

Batch number **Unknown**

Product description **Power adaptor intended for charging a mobile phone or other devices. The output is a USB connector.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The mains pins do not have sufficient insulation. Contact with the live part of the pins is therefore possible when inserting or removing the adaptor from the mains socket. The product does not comply with the requirements of the Low Voltage Directive and the relevant national standard.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **19/05/2015**

Measures taken by economic operators **Destruction of the product**
Other

Alert number **[A12/0915/15](#)**

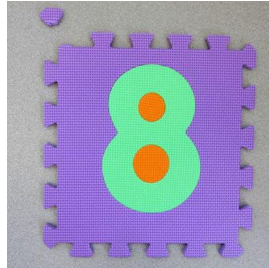

| | |
|---|---|
| Notifying country | Spain |
| Product category | Toys |
| Type | Consumer |
| Product | Puzzle mat |
| Name | Unknown |
| Brand | Arregui |
| Type / number of model | Code: A-1044240 |
| Batch number | 8425181727621 |
| Product description | Foam (EVA) puzzle mat with numbers; supplied in plastic packaging. |
| Risk type | Choking |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | Small parts can break off from the puzzle pieces. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1. |
| Country of origin | People's Republic of China |
| Measures ordered by public authorities | Import rejected at border Other |
| Date of entry into force | 29/06/2015 |

Alert number

[A12/0927/15](#)



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's cardigan**

Name **Unknown**

Brand **Charanga**

Type / number of model **Ref.102/52095/852**

Batch number **Unknown**

Product description **White cotton cardigan for babies with red and blue stripes and four buttons.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small buttons of the cardigan may easily come off. A small child may put them in the mouth and choke. The product does not comply with the relevant national standard UNE 40902.**

Country of origin **Bangladesh**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **30/06/2015**

Alert number

A12/0928/15



| | |
|---|--|
| Notifying country | Sweden |
| Product category | Cosmetics |
| Type | Consumer |
| Product | Tooth whitening gel |
| Name | Dentaworks Tooth Whitening System |
| Brand | Dentaworks |
| Type / number of model | Unknown |
| Batch number | EAN 7350072150015 |
| Product description | Tooth whitening gel and 3 soft mouth trays in a cardboard box. |
| Risk type | Chemical |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The product contains Sodium Perborate. The product does not comply with the Cosmetic Products Regulation. |
| Country of origin | The Netherlands |
| Measures ordered by public authorities | Withdrawal of the product from the market Other |
| Date of entry into force | 08/06/2015 |

Products were found and
measures were taken also in

Sweden

Alert number **[A12/0929/15](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Soft toy dog**

Name **Unknown**

Brand **Pelucheto**

Type / number of model **1. Ref. 700-213
2. Ref. 700-223**

Batch number **1. 0207000021329
2. 0207000022326**

Product description **Two different models of soft toy dogs, with a plastic carrier (one pink, the other yellow). The product is supplied with various plastic accessories (a bone, food bowl, etc.). The products are supplied in a plastic bag.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small nose of the toy dog may easily detach. A small child could put it in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **30/06/2015**



Alert number **[A12/0938/15](#)**



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Men's sandals**

Name **Sandals**

Brand **FEREVA**

Type / number of model **Ref 320-01 (black) and 320-08 (brown)**

Batch number **-**

Product description **Men's brown or black sandals in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of Chromium VI in the lining and insole of both models of men's sandals is too high (measured values up to 46 mg/kg). Chromium VI is classified as sensitising and may trigger allergic reactions.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **06/07/2015**

Alert number **[A12/0922/15](#)**



Notifying country **Bulgaria**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's clothing sets**

Name **Unknown**

Brand **Marions**

Type / number of model **1. Art. No. MGB-1077-BM 2. Art. No. MTK-1137-BM**

Batch number **1. 8980000002889 2. 8980000001264**


Product description **1. Sleeveless top with sewn-on, decorative cords (length 31 cm) in the lower part. 2. Children's two-piece clothing set consisting of two tops with sewn-on drawstrings (length 31 cm) in the waist area.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The long cords in the waist area can become trapped and cause injuries to children. The product does not comply with the European standard EN 14682.**

Country of origin **Türkiye**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

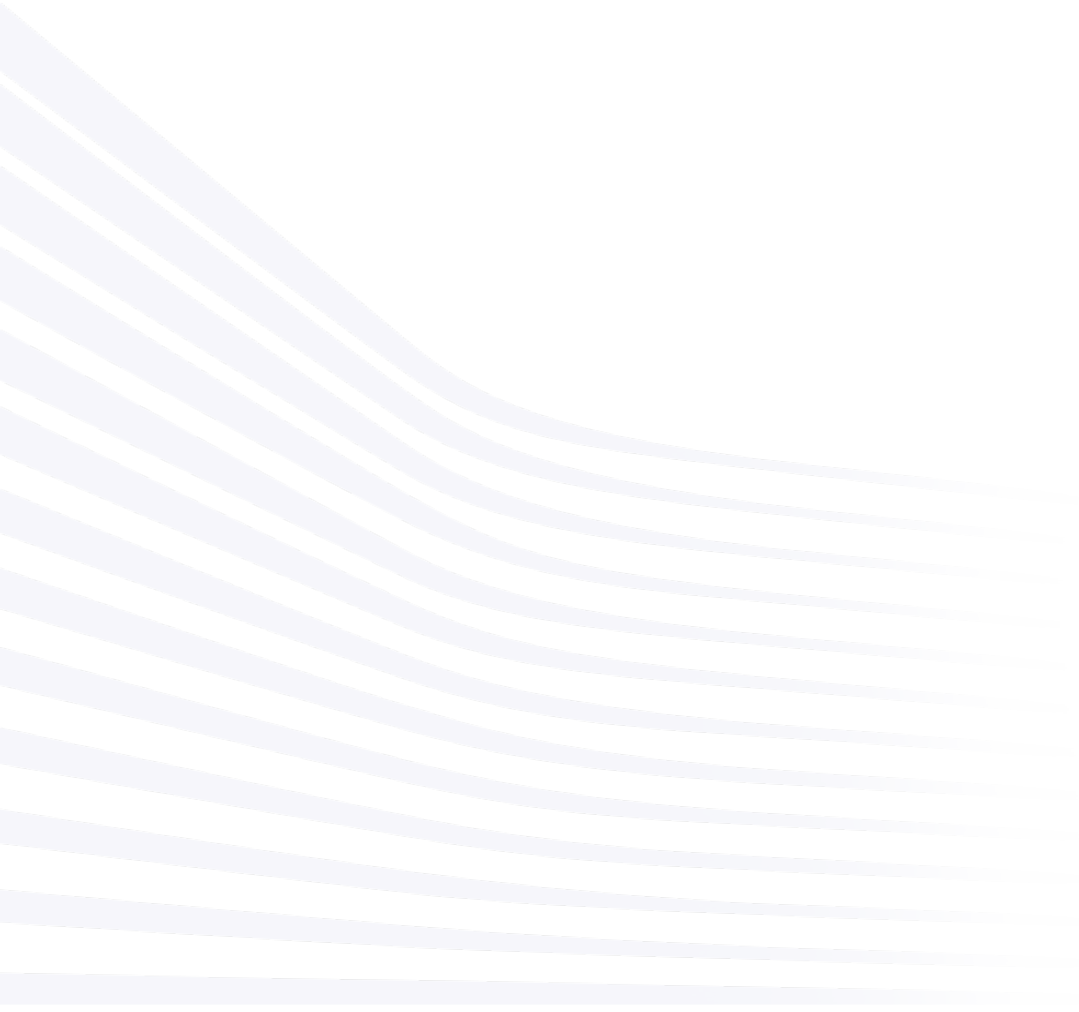

Alert number

[A12/0930/15](#)



| | |
|---|--|
| Notifying country | Spain |
| Product category | Childcare articles and children's equipment |
| Type | Consumer |
| Product | Girls' sandals |
| Name | Unknown |
| Brand | Inca |
| Type / number of model | Ref 67002 |
| Batch number | Unknown |
| Product description | Girls' sandals with decorative coloured beads, size 23. |
| Risk type | Choking |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The small beads may easily detach from the sandal straps. A small child could put them in the mouth and choke. The product does not comply with the relevant national standard UNE 40902. |
| Country of origin | India |
| Measures ordered by public authorities | Import rejected at border Other |
| Date of entry into force | 06/07/2015 |

Alert number **[A12/0923/15](#)**



Notifying country **Bulgaria**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's clothing set**

Name **Unknown**

Brand **Marions**

Type / number of model **Art. No. MTK-1015-BM,**

Batch number **Bar code 8980000001004**

Product description **A long, sleeveless dress and a sleeveless blouse. The sleeveless blouse has a hood and functional cords at the back with a length of 30 cm. On the front part of the blouse there are sequins in the form of a dolphin, an anchor and a ship's rope.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The functional cords on the back of the garment can become trapped during various activities of a child. The product does not comply with the relevant European standard EN-14682.**

Country of origin **Türkiye**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures**

Other

Date of entry into force **07/07/2015**



Alert number **[A12/0931/15](#)**



| | |
|---|---|
| Notifying country | Germany |
| Product category | Other |
| Type | Consumer |
| Product | Molasses tobacco |
| Name | Molasses Gum |
| Brand | Start Now |
| Type / number of model | Unknown |
| Batch number | Batch: P3/2015 E3/2017 1/2015 |
| Product description | 200g of tobacco for water-pipes in a blue plastic tin. |
| Risk type | Chemical |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The product contains an excessive amount of glycerine (measured value up to 53.8 % by weight). The product does not comply with the relevant national legislation. |
| Country of origin | Jordan |
| Measures taken by economic operators | Withdrawal of the product from the market Other |
| Date of entry into force | 02/07/2015 |

Measures taken by economic operators

**Withdrawal of the product from the market
Other**

Date of entry into force

17/06/2015

Alert number **[A12/0939/15](#)**



Notifying country **Spain**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Women's shoes**

Name **Unknown**

Brand **Xti Tertutions**

Type / number of model **Mod. 29712**

Batch number **297120337 2401464/155**

Product description **Women's shoes with wedge heel. Size of the sample: 37.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of Chromium VI in the wedge is too high (measured value: 66.2 mg/kg). Chromium VI is sensitising and may trigger allergic reactions.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **06/07/2015**

Alert number **[A12/0932/15](#)**



Notifying country **Denmark**

Product category **Chemical products**

Type **Consumer**

Product **Nail glue**

Name **Qiangtegu Nail Glue**

Brand **TREND Accessories**

Type / number of model **CM058**

Batch number **Unknown**

Product description **Small plastic bottle of nail glue, supplied in plastic packaging on pink cardboard.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The glue contains an excessive amount of chloroform (measured value 5.7 % by weight). Exposure to chloroform fumes can cause damage to internal organs, mainly the liver and kidney, as well as risk of cancer. The product does not comply with the REACH Regulation.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Warning consumers of the risks
Other**

Date of entry into force **23/07/2015**

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

Date of entry into force

23/07/2015

Alert number **[A12/0916/15](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycles**

Name **CB / CBF / CBR / CRF / CTX / FES / FJ / NC / NSS / NT / SH / ST / VFR / VT / XL**

Brand **Honda**

EC-type approval/model **CB1300SAA, CB500FAE, CB500XAE, CB650FAE, CBF1000FAC, CBF1000FTC, CBR125RD, CBR300RAF, CBR500RAE, CBR600RAD, CBR650FAE, CRF250LD, CRF250ME, CTX700DE, CTX700NDE, FES125AC, FJS600A7, NC700SDE, NC700.....**

Production dates **Affected motorcycles are those manufactured between September 2013 and June 2015.**

Product description **Motorcycles.**

Risk type **Fire
Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A manufacturing problem with the starter relay switch could 1) affect the electrical system causing the engine to stall while riding leading to a road accident; or 2) cause the starter relay switch to catch fire.**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Other**

Products were found and measures were taken also in **Estonia
France
Greece
Croatia
Hungary
Ireland
The Netherlands
Sweden
Slovenia
Slovakia**

Alert number

A12/0917/15



Notifying country

Hungary

Product category

Lighting chains

Type

Consumer

Product

Lighting chains

Name

1. 100LED Christmas Light; 2. 240LED Christmas Light

Brand

Unknown

Type / number of model

1. LED 100L; 2. LED 240L

Batch number

-

Product description

Lighting chains with non-replaceable, blue LED lamps, flashing switch and control unit. Packaging: a colourful cardboard box.

Risk type

**Electric shock
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The cross-sectional area of the external and internal wires is too small and the wires could overheat. The wire ends soldered to the terminals of the flashing unit and the LEDs are not adequately protected against pulling and twisting. The accessible basic insulated wires can come into contact with sharp edges of the flashing switch and control unit. The insulation provided by the shrink tubing for the bulbs is inadequate. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Country of origin

Unknown

Measures ordered by public
authorities

Recall of the product from end users
Other

Date of entry into force

24/03/2015

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

Alert number **[A12/0918/15](#)**



Notifying country **Hungary**

Product category **Lighting chains**

Type **Consumer**

Product **Lighting chain**

Name **Égő beltéri - 100 LED**

Brand **Unknown**

Type / number of model **100LED (on the product)
633538 (on the label)**

Batch number **6908011088014 (on the label)
9794102576198**

Product description **Lighting chain with control unit made of 100 LED lamps. The colours of the lamps are blue, red, green and yellow. The product is supplied in a transparent plastic box.**

Risk type **Electric shock
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The cross-sectional area of the external and internal wires is too small and the wires could overheat. The wire ends soldered to the terminals of the control unit and the LEDs are not adequately protected against pulling and twisting. The socket of the extension lead enables single-pole insertion of a plug with the free remaining live pin accessible. The accessible basic insulated wires can come into contact with sharp edges of the control unit and could be damaged. The insulation provided by the shrink tubing for the bulbs is inadequate. The product is not protected against moisture yet is recommended for outdoor use. The product does not comply with the requirements of the Low

Voltage Directive and the relevant European standard EN 60598.

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **07/03/2015**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Alert number **[A12/0919/15](#)**



Notifying country **Hungary**

Product category **Lighting chains**

Type **Consumer**

Product **Lighting chain**

Name **100L RICE LIGHTS**

Brand **Unknown**

Type / number of model **Unknown**

Batch number **Unknown**

Product description **Lighting chain of 100 lights and a control unit. The colours of the lamps are blue, red, green and yellow. The products are supplied in a colourful cardboard box.**

Risk type **Electric shock
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The wire ends soldered to the terminals of the control unit and to the lamps are not adequately protected against pulling and twisting. The wires can come into contact with the sharp edges of the control unit. The insulation provided by the shrink tubing for the bulbs is inadequate. The product is not protected against moisture although recommended for outdoor use. The wires can overheat as they are too thin. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **Unknown**

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

Date of entry into force

31/03/2015


Alert number **[A12/0933/15](#)**



| | |
|---|---|
| Notifying country | Lithuania |
| Product category | Furniture |
| Type | Consumer |
| Product | Office chair |
| Name | Unknown |
| Brand | Igo |
| Type / number of model | C112B01 |
| Batch number | 000051095573 |
| Product description | Office chair packed in a corrugated cardboard box. |
| Risk type | Injuries |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The chair has insufficient stability and strength. It could consequently fall over or break during use injuring the user. The product does not comply with the relevant European standard EN 1335. |
| Country of origin | People's Republic of China |
| Measures ordered by public authorities | Ban on the marketing of the product and any accompanying measures Other |
| Date of entry into force | 06/03/2015 |

Alert number

[A12/0934/15](#)

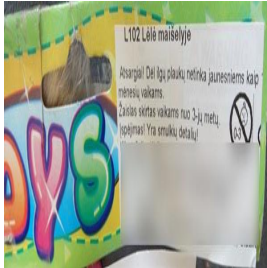

Notifying country **Lithuania**

Product category **Toys**

Type **Consumer**

Product **Plastic toy set**

Name **Unknown**

Brand **Unknown**

Type / number of model **L102**

Batch number **Unknown**

Product description **Toy set with a doll, yellow pony, pink comb, 2 palm trees and a small purple dragon, all made of plastic, packaged in a clear plastic bag.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toys contain di-(2-ethylhexyl) phthalate (DEHP) (measured value 15.95% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **10/07/2015**



Alert number **[A12/0935/15](#)**

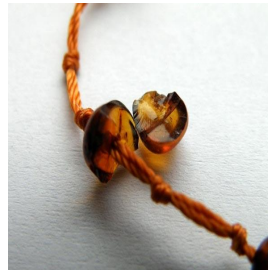

| | |
|---|---|
| Notifying country | Hungary |
| Product category | Childcare articles and children's equipment |
| Type | Consumer |
| Product | Amber necklace |
| Name | Borostyán gyermeknyaklánc ("Amber children's necklace") |
| Brand | Brendon |
| Type / number of model | 1. model: 256235; 2. model: 256240 |
| Batch number | 1. 5999884607113; 2. 5999884607168 |
| Product description | Necklace with joint clasp made of colourful (model 1)/ brown (model 2) amber-coated beads. The product is supported on printed card. Length of necklace approx. 35 cm. |
| Risk type | Choking |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The beads on the necklace may break easily creating small parts and small children could choke on them. |
| Country of origin | Hungary |
| Measures ordered by public authorities | Withdrawal of the product from the market Other |

Measures ordered by public
authorities

Recall of the product from end users
Other

Date of entry into force

07/07/2015