

Alert number **[A12/0591/16](#)**



| | |
|---|--|
| Notifying country | Slovakia |
| Product category | Electrical appliances and equipment |
| Type | Consumer |
| Product | Mains extension lead |
| Name | 3-WAY SOCKET WITH SURGE PROTECTION |
| Brand | TITANUM |
| Type / number of model | TL 101 |
| Batch number | 5901299902257 |
| Product description | White mains extension lead with three sockets, supplied in a transparent plastic bag stapled with a cardboard label. Length: 1,5 m. |
| Risk type | Electric shock |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | There is no earth conductor which could lead to a risk of electric shock if an appliance which should be earthed was connected. |
| Country of origin | People's Republic of China |
| Measures ordered by public authorities | Withdrawal of the product from the market Other |
| Date of entry into force | 14/12/2015 |

Measures ordered by public
authorities

Recall of the product from end users
Other

Date of entry into force

14/12/2015

Alert number **[A11/0045/16](#)**



Notifying country **The Netherlands**

Product category **Other**

Type **Consumer**

Product **Sky lantern**

Name **Lanterne Volante ('Flying lantern')**

Brand **Sky Lantern**

Batch number **3700498930571**

Product description **Paper sky lantern wrapped in transparent packaging.**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The air inside the lantern is heated by an open burner (lacking protective system for the flame). If the lantern lands on a rooftop or on other flammable material, this may cause a fire.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **17/03/2016**

Products were found and measures were taken also in **France**

Alert number **[A12/0626/16](#)**



Notifying country **Finland**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Bedsread**

Name **Cotton Printed Bed Sheet Double**

Brand **Unknown**

Type / number of model **Zodiac printed**

Product description **Big cotton bedsread (size: 210 x 240 cm) with zodiac patterns and inscriptions. The bedsread is dyed with red and black colours. It is packed in a transparent plastic bag.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The red textile material contains azo dyes releasing aromatic amine benzidine (measured value: 870 mg/kg). When the product is in direct and prolonged contact with the skin, this aromatic amine may be absorbed by the skin. Aromatic amines can cause cancer, cell mutations and affect reproduction. The product does not comply with the REACH Regulation.**

Country of origin **India**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **01/04/2016**

Alert number **[A12/0592/16](#)**



Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product **Set of rattles**

Name **Baby Toys**

Brand **Fei Pan**

Type / number of model **NO.326-475 (on the cardboard label) NO.326-944 (on the attached paper label)**

Product description **A set of ten plastic rattles of different shapes and colours, supplied in a transparent plastic bag stapled with a cardboard label.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The rattles can easily break, generating small parts which could be put in the mouth by a small child and cause choking. Moreover, the handles of some rattles are too long. A small child could put them in the mouth where they can get stuck and obstruct the airways. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Warning consumers of the risks
Other**

Date of entry into force **22/12/2015**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **22/12/2015**

Alert number **[A11/0046/16](#)**



Notifying country **The Netherlands**

Product category **Other**

Type **Consumer**

Product **Sky lantern**

Name **HIMMELSLATERNE ('Sky lantern')**

Brand **Rainbow**

Batch number **4250137504285**

Product description **Paper sky lantern, wrapped in transparent packaging.**

Risk type **Fire**


Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The air inside the lantern is heated by an open burner (lacking protective system for the flame). If the lantern lands on a rooftop or other flammable material, this may cause a fire.**

Country of origin **Unknown**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **17/03/2016**

Alert number **[A11/0047/16](#)**

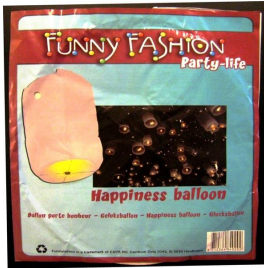

| | |
|---|--|
| Notifying country | The Netherlands |
| Product category | Other |
| Type | Consumer |
| Product | Sky lantern |
| Name | Happiness balloon |
| Brand | Funny Fashion |
| Batch number | 8712364840292 |
| Product description | Paper sky lantern, wrapped in transparent packaging. |
| Risk type | Fire |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The air inside the lantern is heated by an open burner (lacking protective system for the flame). If the lantern lands on a rooftop or other flammable material, this may cause a fire. |
| Country of origin | Unknown |
| Measures ordered by public authorities | Ban on the marketing of the product and any accompanying measures Other |
| Date of entry into force | 17/03/2016 |
| Products were found and measures were taken also in | Belgium |

Alert number **[A12/0593/16](#)**



Notifying country **Austria**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Via ferrata set**

Name **Easy Rider and Iron Cruiser**

Brand **Black Diamond**

Type / number of model **Easy Rider: model number 620105; Iron Cruiser: model number 620110; Iron Cruiser Via Ferrata Packages: model number 620122.**

Batch number **Manufactured between 26 October 2015 and 18 January 2016, with production codes from 5293 to 5350.**

Product description **Climbing equipment: via ferrata set.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The safety stitching may be missing. This would cause the immediate failure of the product when loaded. The user could consequently fall from a height resulting in serious or fatal injury. The product does not comply with the Personal Protective Equipment Directive.**


Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **13/04/2016**

Products were found and
measures were taken also in **France
Poland**

Alert number **[A12/0594/16](#)**

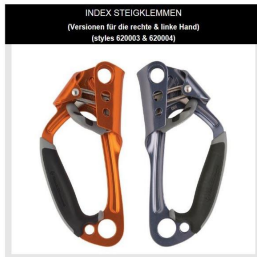

Notifying country **Austria**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Ascender**

Name **Index**

Brand **Black Diamond**

Type / number of model **Right (model number 620003) and left (model number 620004) versions.**

Batch number **Manufactured between 22 December 2014 and 25 February 2016; manufacturer's codes from 4356 to 6015.**

Product description **Climbing equipment: ascender**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The rivets attaching the toothed cam to the ascender body may not have been fitted correctly. The cam and indeed the entire ascender may therefore become detached from the rope. There is also a risk that the rivets which attach the safety catch to the toothed cam have not been fitted correctly, thus increasing the risk that the ascender may become detached from the rope. If the ascender becomes detached from the rope, the user could fall from a height resulting in serious or fatal injury. The product does not comply with the Personal Protective Equipment Directive.

Country of origin **United States**

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

13/04/2016

Products were found and measures were taken also in

**Estonia
Spain
Finland
France
Malta**

Alert number

A12/0627/16



Notifying country

Finland

Product category

Lighting equipment

Type

Consumer

Product

Torch

Name

High Intensity LED Flashlight

Brand

Ferei

Type / number of model

**Battery charger: GM-042120
Torch: 730**

Batch number

6951620500644

Product description

**Rechargeable LED torch supplied with a battery charger.
Sold in a purple cardboard box.**

Risk type

Electric shock

Legal provisions (at EU level)
and European standards
against which the product was
tested and did not comply

**The electrical insulation of the battery charger is not
sufficient. The creepage distance between the primary and
secondary circuits is too small. The product does not
comply with the requirements of the Low Voltage Directive
and the relevant European standard EN 60335.**

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

12/04/2016

Measures ordered by public
authorities

Recall of the product from end users
Other

Date of entry into force

12/04/2016

Alert number **[A12/0595/16](#)**



Notifying country **Austria**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Camming devices**

Name **Camalots and Camalot Ultralights**

Brand **Black Diamond**

Type / number of model **Camalot Ultralights of all sizes manufactured between 10 November 2015 and 4 March 2016 and with a production code of between 5309 and 6061.
Camalots of all sizes which were manufactured between 18 May 2015 and 9 March 2016 and have a production code of between 5133 and 6067.**

Batch number **CAMALOT ULTRALIGHTS: Size / Style Number: .3 262103 .4 262104 .5 262105 .75 262107 #1 262110 #2 262120 #3 262130 #4 262140 #5 262150 #6 262160
CAMALOT: Size / Style Number: .4 262164 .5 262165 .75 262167 #1 262171 #2 262172 #3 262173 #4 262174**

Product description **Spring-loaded camming devices used for rock climbing.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **In a very high percentage of the products, it is possible that the axles of the camming devices are not correctly riveted. This could result in the camming device not being fully resilient or falling apart when used. As a consequence, the climber could fall from a height and sustain serious or fatal injuries. The product does not comply with the Personal Protective Equipment Directive.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **13/04/2016**

Products were found and measures were taken also in **Germany
Finland
Croatia**

Alert number **[A12/0613/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Suspension bracket**

Brand **Lowtec**

EC-type approval/model **Type: 87260901/87260951 Authorisation No: SA1161797/I
Sales description: 60901/60951**

Production dates **Concerns components produced in May 2014.**

Product description **Front suspension bracket for the VW Golf IV.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product could break owing to a production defect. If this happened, the resulting loss of driving stability would increase the risk of an accident.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/0596/16](#)**

Notifying country **Austria**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **Super Adventure**

Brand **KTM**

EC-type approval/model **1290**

Production dates **Model year 2015/16 vehicles are affected.**

Product description **Motorcycle.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **An oil leak can cause damage inside the strut of the semi-active suspension, thereby leading to a functional impairment of the suspension system.**

Country of origin **Austria**


Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **28/04/2016**

Products were found and measures were taken also in **Bulgaria
Denmark
Finland
Greece
Croatia
Portugal
Sweden
Slovenia
United Kingdom**

Safety Gate Alerts

Alert number **[A12/0597/16](#)**

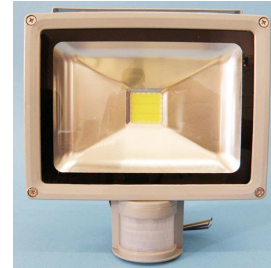

Notifying country **Hungary**

Product category **Lighting equipment**

Type **Consumer**

Product **LED floodlight**

Name **LED Flood Light**

Brand **Realm**

Type / number of model **Item Number: FLOOD LIGHT-20W-S**

Batch number **6 927766 070129**

Product description **Grey LED floodlight with motion sensor and free wire ends for mains connection. The product is intended for indoor and outdoor use. Packaging: cardboard box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cables are not properly secured against pulling and twisting and the wire ends can be pulled out easily. The PVC cables do not protect properly against the penetration of water. As a result of these defects, the user could touch live parts during normal use. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **02/10/2015**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Alert number

A12/0598/16



Notifying country

Sweden

Product category

Toys

Type

Consumer

Product

Rattle

Name

Pumpkin

Brand

Kids Concept

Type / number of model

Art no: 412968, 412951, 412944

Batch number

**7340028713968
7340028713944
7340028713951
Only batches ID373 and ID365 are affected.**

Product description

Babies' multicoloured bell rattle. The rattles comes in white and blue, white and pink or white and green. On each of the sides there are pictures of an owl.

Risk type

Choking

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

Some of the pins on the rattle have not been glued correctly and the sides can detach. If the rattle falls apart, the bell inside is released and a small child could put the bell into the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Country of origin

People's Republic of China

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Date of entry into force

03/03/2016

Measures taken by economic operators

**Withdrawal of the product from the market
Manufacturer**

Date of entry into force

03/03/2016

Products were found and measures were taken also in

**Denmark
Finland**

Alert number **[A12/0632/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Van**

Name **T5**

Brand **VW**

EC-type approval/model **Type approval numbers: e1*KS07/46*0027*03
e1*KS07/46*0036*02 Type: 7HC, 7J0.**

Production dates **The vehicles in question were manufactured between 9
August 2013 and 30 June 2015.**

Product description **Van using natural gas.**

Risk type **Fire**

Legal provisions (at EU level)
and European standards
against which the product was
tested and did not comply **Due to a leak between the composite natural gas container
valve and the container itself, natural gas may leak into the
interior/cargo space.**

Country of origin **Germany**

Measures taken by economic
operators **Recall of the product from end users
Manufacturer**

Products were found and
measures were taken also in **Denmark
The Netherlands
Sweden**

Alert number **[A12/0599/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Car**

Name **B-class**

Brand **Mercedes-Benz**

EC-type approval/model **Type approval numbers: e1*2001/116*0470*04-13,
e1*2007/46*0751*05-06 Types: 245 G, 246**

Production dates **The vehicles in question were manufactured between
December 2012 and March 2015 and are fitted with the
Easy-Vario seat**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level)
and European standards
against which the product was
tested and did not comply **The back screws on the rear seats could be missing on one
side. Passengers would therefore not be protected from
unsecured luggage in the event of a frontal collision,
because the rear seat could be lifted from behind.
Furthermore, the required seat belt anchorage may not be
guaranteed.**

Country of origin **Germany**

Measures taken by economic
operators **Recall of the product from end users
Manufacturer**

Products were found and
measures were taken also in **Finland
The Netherlands
Sweden
United Kingdom**

Alert number **[A12/0600/16](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **2008**

Brand **Peugeot**

Production dates **Production period: 14/07/2015.**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The tightening torque of the right-hand, lower seatbelt fixing bolts may not be correct. In this case, the performance of the seatbelt may not be guaranteed in the event of an impact.

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Importer**

Date of entry into force **15/04/2016**

Products were found and measures were taken also in
**Germany
Denmark
Spain
Croatia
The Netherlands
Norway
Sweden
Slovenia
Slovakia
United Kingdom**

Alert number **[A12/0628/16](#)**



Notifying country **Germany**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Lederhose (Leather shorts)**

Name **Lederhose Madl**

Brand **Krüger**

Type / number of model **Model 35012 colour 715**

Batch number **533516**

Product description **Khaki lederhose, embroidered; composition: 100% leather, pocket lining: 100% polyester. sample size 40.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of Chromium (VI) found in the leather is too high (measured value: up to 40 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH regulation.**

Country of origin **India**

Measures taken by economic operators **Withdrawal of the product from the market
Importer**

Date of entry into force **03/05/2016**

Alert number **[A12/0601/16](#)**



Notifying country **Estonia**

Product category **Toys**

Type **Consumer**

Product **Rattle set**

Name **Baby Rattle - Baby Love Play Set**

Brand **Unknown**

Product description **Babies' rattle set consisting of five different rattles in the shape of animals (elephant, giraffe, bear), a boat and a bottle. Packed a cardboard box with transparent window. Approximate size of box is 31 x 25 cm.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The elephant rattle can easily break, releasing small parts which children may put in the mouth and choke upon. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Retailer**

Date of entry into force **03/05/2016**

Alert number **[A12/0602/16](#)**

| | |
|---|--|
| Notifying country | United Kingdom |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | Passenger car |
| Name | Corsa D |
| Brand | Vauxhall |
| EC-type approval/model | Right hand drive model equipped with the LUH engine and 5-speed manual transmission. |
| Production dates | Certain vehicles built between 03/07/2012 and 03/09/2014. |
| Product description | Passenger car. |
| Risk type | Fire |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | Water can penetrate into the connector of the relay box located on the electronic vacuum pump causing a short circuit which could lead to a fire. |
| Country of origin | United Kingdom |
| Measures taken by economic operators | Recall of the product from end users Manufacturer |
| Date of entry into force | 22/04/2016 |

Alert number **[A12/0603/16](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **All-terrain vehicle**

Name **RZR 900, RZR 1000**

Brand **Polaris**

Production dates **Certain vehicles built between 22/07/2013 to 04/11/2015.**

Product description **All-terrain vehicle / side-by-side vehicle.**

Risk type **Fire**

Legal provisions (at EU level)
and European standards
against which the product was
tested and did not comply

**The fuel tank vent line may have insufficient clearance to
the exhaust pipe causing the fuel tank to build pressure
and expand, which may result in a fuel leak.**

Country of origin **United States**

Measures taken by economic
operators **Recall of the product from end users
Manufacturer**

Date of entry into force **19/04/2016**

Products were found and
measures were taken also in
**Denmark
Finland
Greece
The Netherlands
Norway
Sweden**

Alert number **[A12/0604/16](#)**



Notifying country **Hungary**

Product category **Lighting equipment**

Type **Consumer**

Product **Night-light**

Name **Vintage Night Lamp Porcelain**

Brand **Unknown**

Type / number of model **15416 / GL-088**

Batch number **3 427000 154163**

Product description **Night-light which can be plugged directly into a socket outlet. The light bulb has an E12 cap. The lamp shade is made of porcelain with two different patterns and inscriptions. Blister packaging.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Live parts become accessible when a different sized light bulb is used in the lamp holder. In addition, the clearance between the accessible parts and the lateral contacts of the lamp holder is too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Measures ordered by public
authorities

Recall of the product from end users
Other

Date of entry into force

12/02/2016

Alert number **[A12/0605/16](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **All-terrain vehicle**

Name **RZR 900, RZR 1000**

Brand **Polaris**

Production dates **Certain vehicles built between 08/07/2014 and 15/02/2016**

Product description **All-terrain vehicle / side-by-side vehicle.**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

In the event of an engine misfire, unburned fuel can be routed into the exhaust system, which can cause excessive exhaust heat that may lead to a fire.

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **19/04/2016**

Products were found and measures were taken also in **Denmark
Finland
Greece
Sweden**

Alert number **[A12/0614/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **NV400**

Brand **Nissan**

EC-type approval/model **Type: NV400 (X62) with M9T engine (engine index 700, 702, 706); EC type-approval: EC-BE-No e2*2007/46*0137 EC-BE-No e2*2007/46*0138 EC-BE-No e2*2007/46*0140 EC-BE-No e2*2007/46*0141 EC-BE-No e2*2.....**

Production dates **The vehicles concerned were manufactured between 18 September 2015 and 26 October 2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The turbo-charger oil hose may be incorrectly crimped. If the oil hose becomes completely detached, oil may escape endangering following vehicles.**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Denmark
Ireland
Slovenia
United Kingdom**

Alert number **[A12/0615/16](#)**



Notifying country **France**

Product category **Decorative articles**

Type **Consumer**

Product **Decorative grapes**

Name **Grappe raisin PVC (PVC bunch of grapes)**

Brand **CHAKS**

Type / number of model **20028 / PVC green grapes
2029 / PVC red grapes**

Batch number **3661652032572
3661652032589**

Product description **A bunch of red or green PVC grapes measuring 30cm X 15cm, with an attached label.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

This decorative article, due to its characteristic form, colour and size, may be mistaken for foodstuff. Small parts can be easily detached from the product and this may lead children to put them in the mouth, swallow or ingest them. The product does not comply with the requirements of the Directive 87/357/EEC on products which, appearing to be other than they are, endanger the health or safety of consumers.

Country of origin **People's Republic of China**

Measures taken by economic **Recall of the product from end users**

operators **Importer**

Date of entry into force **29/04/2016**

Alert number **[A12/0606/16](#)**

| | |
|---|---|
| Notifying country | Malta |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | Passenger car |
| Name | Clio |
| Brand | Renault |
| EC-type approval/model | Clio IV |
| Production dates | e2*2001/116*0327; e2*2007/46*0008. The affected vehicles were manufactured from 15/04/2014 to 06/10/2014 in France and 05/03/2013 to 02/04/2015 in Turkey |
| Product description | Passenger car |
| Risk type | Injuries |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The front wheel arch may be incorrectly installed. As a result, the brake hose may come into contact with the front wheel arch, causing wear of the brake hose by fretting. If the brake hose breaks and the brake fluid leaks out, the performance of braking could be compromised. |
| Country of origin | France |
| Measures taken by economic operators | Recall of the product from end users Manufacturer |
| Date of entry into force | 29/04/2016 |
| Products were found and measures were taken also in | Denmark Finland Greece The Netherlands Norway Sweden Slovenia Slovakia |

Alert number **[A11/0048/16](#)**



| | |
|---|---|
| Notifying country | Hungary |
| Product category | Electrical appliances and equipment |
| Type | Consumer |
| Product | Battery charger |
| Name | Lead Acid Charger |
| Brand | Unknown |
| Type / number of model | TS-1012C |
| Product description | Battery charger for lead acid batteries. Output: DC 6 V / 1000 mA. Packaging: plain white cardboard box. |
| Risk type | Electric shock |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The electrical insulation is not sufficient which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335. |
| Country of origin | People's Republic of China |
| Measures ordered by public authorities | Withdrawal of the product from the market Other |
| Measures ordered by public authorities | Recall of the product from end users Other |
| Date of entry into force | 12/11/2015 |

Alert number **[A12/0607/16](#)**



Notifying country **Hungary**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **USB power supply**

Name **USB Power Adapter**

Brand **Unknown**

Type / number of model **Model: A1265; Serial No: 1X91029Y459T**

Batch number **6 417182 108402**

Product description **White USB power supply / charger supplied with a USB lead. Packaging: box with transparent windows.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The insulation between the primary and secondary circuits is not sufficient, which may cause an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **24/11/2015**

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

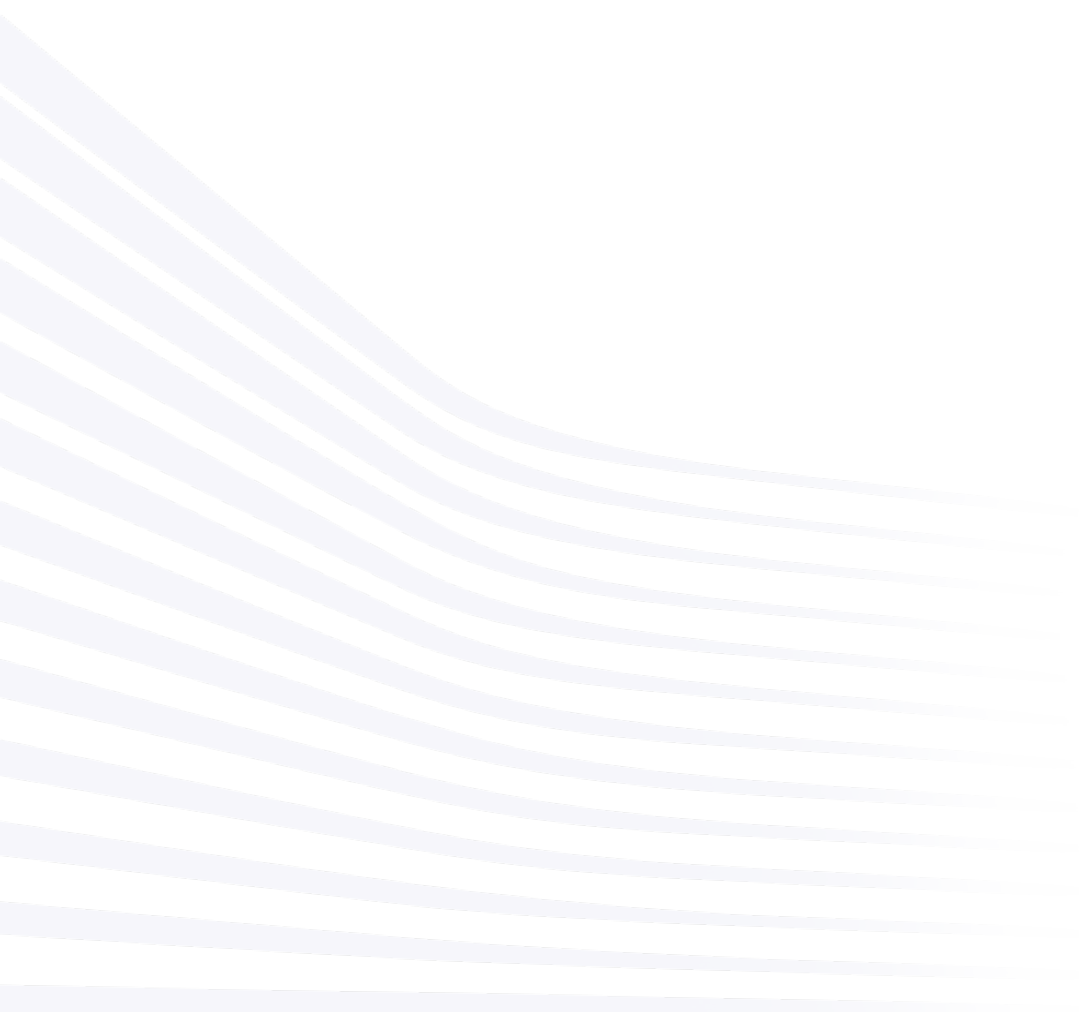

Alert number **[A12/0608/16](#)**



| | |
|---|---|
| Notifying country | Hungary |
| Product category | Electrical appliances and equipment |
| Type | Consumer |
| Product | Electric mosquito-repellent device |
| Name | TRAVEL Mosquito Plug |
| Brand | Unknown |
| Type / number of model | WQM165A (on the product); A-00277 (on the packaging) |
| Batch number | 5 995780 281501 |
| Product description | Yellow, mains-operated, mosquito repellent device which plugs directly into a mains socket outlet. Supplied with 10 tablets. Blister packaging. |
| Risk type | Electric shock |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The casing of the product does not have sufficient mechanical strength which could lead to live parts becoming accessible. It is possible to touch the live parts of pins of the plug when inserting or removing the device from the mains socket. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335. |
| Country of origin | People's Republic of China |
| Measures ordered by public authorities | Withdrawal of the product from the market Other |

Measures ordered by public
authorities

Recall of the product from end users
Other

Date of entry into force

03/07/2015

Alert number **[A12/0616/16](#)**



Notifying country **Estonia**

Product category **Toys**

Type **Consumer**

Product **Plastic Doll**

Name **Winter Princess**

Brand **Sparkle Girlz**

Type / number of model **Item No. 24111**

Batch number **884978241111**

Product description **10 cm doll with long purple hair. The toy is supplied in blue cardboard packaging (size 12 x 10 cm).**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the doll contains both di-(2-ethylhexyl) phthalate (DEHP) and dibutylphthalate (DBP) (measured values: 1.2 and 15.2% by weight respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Warning consumers of the risks
Retailer**

Date of entry into force **04/05/2016**


Measures taken by economic operators **Withdrawal of the product from the market
Retailer**

Date of entry into force **04/05/2016**

Products were found and measures were taken also in **Bulgaria
Luxembourg
Latvia
Norway**

Alert number

[A12/0631/16](#)

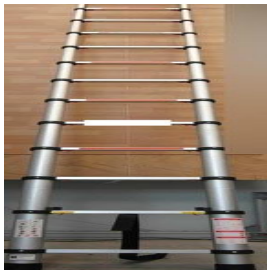

Notifying country **The Netherlands**

Product category **Other**

Type **Consumer**

Product **Telescopic ladder**

Name **3.8M TELESCOOP LADDER**

Brand **Halverwerk**

Type / number of model **02150-09-07/HA380**

Product description **Telescopic ladder - length 3.8m, packed in cardboard packaging.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The ladder does not have sufficient mechanical strength and can bend or break during use, causing the user to fall from a height. In addition, the space between the rungs/steps is not equal when the ladder is not completely extended and the user could therefore miss his step, lose

balance and fall from a height. Also, whilst unlocking the locking mechanism of certain rungs/steps, parts of the ladder above may descend very quickly and crush the user's fingers. The product does not comply with the relevant European standard EN 131.

Country of origin

People's Republic of China

Measures ordered by public authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

31/01/2016

Alert number **[A12/0617/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **C-class**

Brand **Mercedes-Benz**

EC-type approval/model **Type-approval numbers: e1*2001/116*0431*32, e1*2001/116*0457*25; Type: 204, 204 K.**

Production dates **Vehicles produced from December 2013 to April 2016 are affected.**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The connection between the high-pressure pipe from the fuel rail and the high-pressure pump may loosen. If fuel leaks onto the road as a result, it could increase the risk of accidents for following vehicles.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Finland
Ireland
The Netherlands
Norway
Portugal
Sweden
Slovenia
United Kingdom**

Alert number

A12/0618/16



Notifying country **Estonia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Cloetta Spelletta Beautiful Fashion**

Brand **Braizlllaz (COUNTERFEIT)**

Type / number of model **8501**

Product description **Doll with long pink hair and red eyes wearing a black and white dress. The doll is approximately 25 cm, made of flexible plastic, and packed in a cardboard box bearing various inscriptions.**


Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The plastic material of the head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: more than 20% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Retailer**

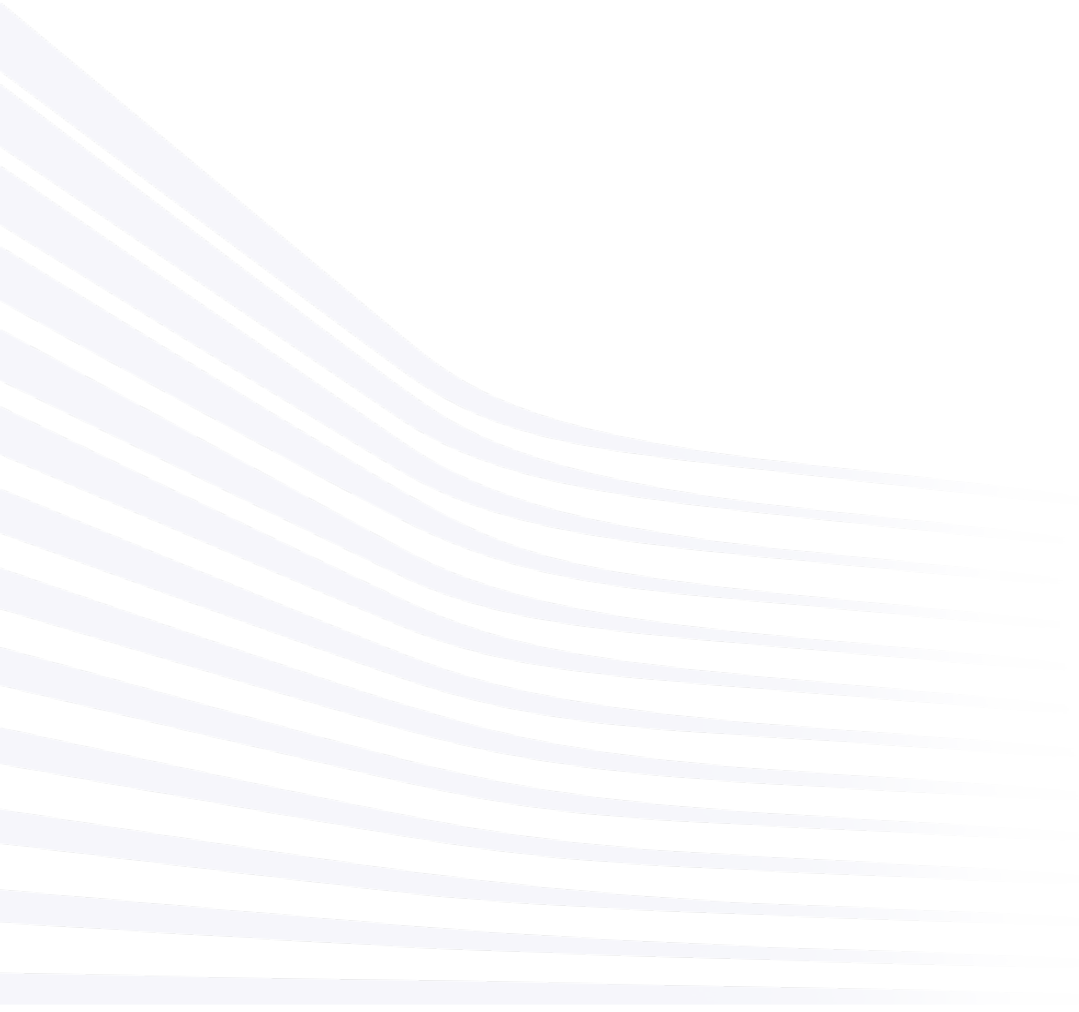

Alert number **[A12/0619/16](#)**

| | |
|---|---|
| Notifying country | Portugal |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | Passenger car |
| Name | Espace and Talisman |
| Brand | Renault |
| EC-type approval/model | Espace V (JRA4, JRA5, JRME) and Talisman (KPA3, KPA4, KPA5, LPA3, LPA4, LPA5, LPMJ, LPMV). |
| Production dates | Production period: until 03/02/2016. |
| Product description | Passenger cars. |
| Risk type | Injuries |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | Possible incorrect assembly of the left or right front flexible brake hose could lead to wear of the flexible brake hose by fretting on the wheel rim and on the tyre. Possible brake fluid leakage, which results as a consequence, could lead to long brake pedal travel and a decrease of braking efficiency. |
| Country of origin | France |
| Measures taken by economic operators | Recall of the product from end users Distributor |
| Date of entry into force | 10/05/2016 |
| Products were found and measures were taken also in | Denmark Estonia Finland Croatia The Netherlands Poland Sweden Slovenia Slovakia |

Alert number **[A12/0620/16](#)**

| | |
|---|---|
| Notifying country | Portugal |
| Product category | Motor vehicles |
| Type | Consumer |
| Product | Passenger car |
| Name | Espace and Talisman |
| Brand | Renault |
| EC-type approval/model | Espace V (JRA4, JRA5, JRME) and Talisman (LPA3, LPA4, LPA5, LPMJ, LPMV). |
| Production dates | Production period: until 11/01/2016. |
| Product description | Passenger car |
| Risk type | Injuries |
| Legal provisions (at EU level) and European standards against which the product was tested and did not comply | The webbing of the front seat belts may have been partially cut. If this is the case, it could result in a loss of efficiency of the safety belt protection performance in the event of an accident. |
| Country of origin | France |
| Measures taken by economic operators | Recall of the product from end users Distributor |
| Date of entry into force | 10/05/2016 |
| Products were found and measures were taken also in | Denmark Finland Croatia The Netherlands Poland Slovenia Slovakia |

Alert number **[A12/0621/16](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Espace**

Brand **Renault**

EC-type approval/model **Espace V (JRA4, JRA5, JRME).**

Production dates **Production period: until 18/09/2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The front wheel alignment may be incorrect. The lower suspension arm may not be properly fixed and could slip. Possible premature and asymmetrical wear of the front tyres which arises as a result could, in extreme cases, lead to a sudden loss of tyre pressure.**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **10/05/2016**

Products were found and measures were taken also in **Bulgaria
Denmark
Croatia
The Netherlands
Poland
Sweden
Slovenia
Slovakia**

Alert number **[A12/0622/16](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Espace**

Brand **Renault**

EC-type approval/model **Espace V (JRA4, JRA5, JRME).**

Production dates **Production period: until 14/12/2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Due to the absence of primer when bonding, the sun roof may not be properly attached. Part of the sunroof could consequently detach from the vehicle whilst driving, posing risk for following vehicles.**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **10/05/2016**

Products were found and measures were taken also in **Bulgaria
Germany
Denmark
Croatia
The Netherlands
Poland
Romania
Sweden
Slovakia**

Alert number **[A12/0629/16](#)**



Notifying country **Finland**

Product category **Toys**

Type **Consumer**

Product **Toy gun**

Name **City Police Soft Bullets Gun**

Brand **Unknown**

Type / number of model **art. E058-064**

Product description **Plastic toy gun with five projectiles. The gun is a black-silver-orange coloured handgun. "Force" is written on the barrel. The projectiles are made of golden plastic with red suction cups. The gun and the projectiles are packed in a cardboard and plastic blister packaging.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The red plastic suction cups of the projectiles can easily detach. A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toys Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border
Other**

Date of entry into force **28/04/2016**

Alert number **[A12/0623/16](#)**



Notifying country **Denmark**

Product category **Toys**

Type **Consumer**

Product **Set of whistles**

Name **4 FLØJTER - 4 WHISTLES**

Brand **Tiger**

Type / number of model **Item no. 2600226**

Batch number **Batch 79468**

Product description **Whistles in different colours designed as lips with a sound mechanism in the middle. Sold in a plastic bag with cardboard blister.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The sound unit of the toy may become loose if pulled or picked at, creating a small part. Small children could put this small part in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Distributor**


Spain

Products were found and
measures were taken also in

Finland
France
Hungary
Ireland
Iceland
Latvia
Sweden

Alert number

[A12/0624/16](#)

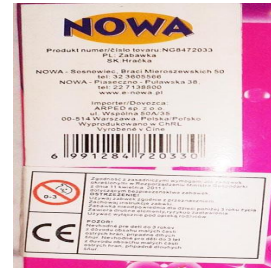

Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Beautiful Children**

Brand **Nowa
Xiangxing toys**

Type / number of model **NO.XX2822 (on the package) NG8472033 (on the label)**

Batch number **6991284720330 (on the label)**

Product description **Plastic doll with long blond hair and pink dress. Packaged in a cardboard box with a transparent plastic window on the front side.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 20.8% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public **Ban on the marketing of the product and any**

authorities

accompanying measures
Other

Date of entry into force

05/01/2016


Measures ordered by public
authorities

Warning consumers of the risks
Other

Date of entry into force

05/01/2016

Alert number **[A12/0612/16](#)**

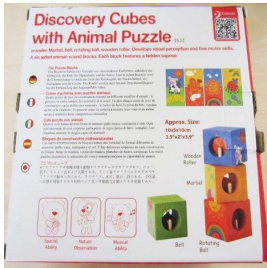

Notifying country **Estonia**

Product category **Toys**

Type **Consumer**

Product **Wooden puzzle**

Name **Discovery Cubes with Animal Puzzle**

Brand **Classic World**

Type / number of model **3522**

Batch number **6940351735227**

Product description **Toy wooden puzzle cubes with openings. Each cube contains a small part (a bell, a wooden roller, a marble, and a rotating ball) blocked by a small stick. Different images are printed on the cubes (cow, chicken, ladybird, sun). The product is sold in a cardboard packaging.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Children can easily access the small parts contained in the cubes (bell, wooden roller, marble, and rotating ball). Small children could put these small parts in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic **Recall of the product from end users**

operators **Importer**

Date of entry into force **24/03/2016**

Alert number **[A11/0050/16](#)**



Notifying country **France**

Product category **Toys**

Type **Consumer**

Product **Soft toy and ball**

Name **DEVIL INSIDE**

Brand **TIF 8**

Type / number of model **Item No 36937 (bag) + item 36933 (soft toys) .**

Product description **Red and black soft ball with a zip-fastener and a red and black soft toy (devil) wearing a football shirt and carrying a small soft football.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The fibrous stuffing material of the toy is easily accessible due to the weakness of certain seams. The stuffing material may cause choking if put in the mouth by children. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **24/03/2016**


Measures taken by economic operators

**Withdrawal of the product from the market
Distributor**

Date of entry into force

24/03/2016

Alert number **[A12/0630/16](#)**

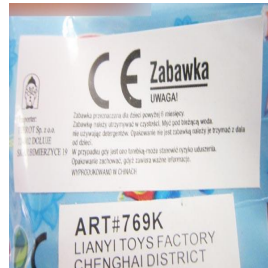

Notifying country **Poland**

Product category **Toys**

Type **Consumer**

Product **Pull-along toy telephone**

Brand **bionyi**

Type / number of model **ART. #769K**

Batch number **5900700105423**

Product description **Toy telephone with wheels and a cord with which a child may pull it along.**

Risk type **Choking
Strangulation
Suffocation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply


The stickers on the toy can easily detach, generating small parts. A small child may put them in the mouth and choke. Moreover, the cord is too long which can lead to strangulation while playing with the toy. Also, the plastic bag of the packaging is too thin. If a child plays with the packaging, the plastic can cover the mouth and nose causing suffocation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market
Importer**

Alert number

A12/0611/16

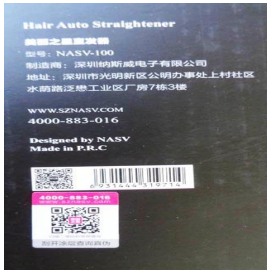

Notifying country **United Kingdom**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Hair brush straightener**

Name **Hair Auto Straightener**

Brand **NASV Beauty Your World**

Type / number of model **NASV-100**

Batch number **6931444319714**

Product description **Hair straightening brush with attached mains lead and 3 pin plug. Packaged in black box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The electrical insulation is inadequate: there is access to metal parts of the brush separated from live parts by basic insulation and the dimensions of the plug fuse are not correct. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335 and the relevant national standard BS1363.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market
Importer**



Alert number **[A12/0610/16](#)**



Notifying country **France**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's fancy dress/pyjamas with hat**

Brand **PLUS**

Type / number of model **Ref. 7713441**

Batch number **7713441000036**

Product description **Santa Claus red, white and black pyjamas with press-stud fastening down the front and legs; sold with a red and white hat.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The red fabric contains azo dyes releasing the aromatic amine 2-Naphthylamine (measured value: up to 82 mg/kg). When the product is in direct and prolonged contact with the skin, the aromatic amine may be absorbed by the skin. Aromatic amines can cause cancer, cell mutations and affect reproduction. The product does not comply with the REACH Regulation.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Importer**

Date of entry into force **07/04/2016**

Measures taken by economic operators

**Withdrawal of the product from the market
Importer**

Date of entry into force

07/04/2016

Alert number **[A12/0625/16](#)**



Notifying country **Finland**

Product category **Lighting equipment**

Type **Consumer**

Product **LED ceiling light**

Name **LED Panel Light**

Brand **Faro Barcelona**

Type / number of model **LED power supply:WG-(6W--9W)
Light:42862**

Batch number **8421776085404**

Product description **LED ceiling light supplied with a power supply ("LED Driver"). Sold in a brown cardboard box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The electrical insulation of the power supply unit is not sufficient. The creepage distance between the primary and secondary circuits is too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598 and EN 61347.**

Country of origin **Spain**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **25/02/2016**


Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **25/02/2016**

Products were found and measures were taken also in **Spain**

Alert number

A12/0633/16

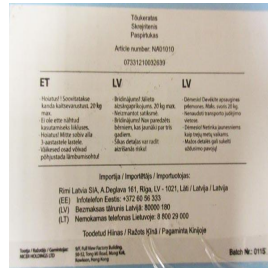

Notifying country

Latvia

Product category

Toys

Type

Consumer

Product

Toy scooter

Name

KIDS TRI SCOOTER

Brand

Unknown

Type / number of model

Art. NA01010

Batch number

7331210032639; Batch Nr.:0115

Product description

Toy scooter in blue and pink with three wheels (one in front and two rear wheels). Packaging - cardboard box.

Risk type

Choking

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The product poses a risk of choking because small parts (the screw nuts of the wheels) easily detach from the scooter: a child may put the small part in the mouth and choke. In addition, the scooter is not sufficiently stable, causing the child to lose balance and fall. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.

Country of origin

People's Republic of China

Measures taken by economic operators

**Destruction of the product
Importer**

Date of entry into force **01/04/2016**

Products were found and
measures were taken also in **Estonia**

Alert number

[A12/0590/16](#)



Notifying country **Slovakia**

Product category **Toys**

Type **Consumer**

Product **Plastic swan with eggs**

Name **Lay egg - swan toys**

Brand **Unknown**

Type / number of model **NO.1401A**

Product description **Colourful plastic swan operated by three „AA“ batteries. After pressing the red button the swan moves and emits lights and sounds. The package also includes three plastic eggs. The product is supplied in a white/blue cardboard box with a transparent window.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy contains small parts (the eggs) that can be swallowed by small children and cause choking. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Warning consumers of the risks
Other**

Date of entry into force **08/12/2015**

Measures ordered by public
authorities

**Ban on the marketing of the product and any
accompanying measures
Other**

Date of entry into force

08/12/2015

Alert number **[A12/0589/16](#)**



Notifying country **Germany**

Product category **Toys**

Type **Consumer**

Product **Wooden musical toy (castanets)**

Name **Die Lieben Sieben**

Brand **Die Spiegelburg**

Type / number of model **Article No 12200**

Batch number **4029753122001**

Product description **Wooden castanet painted red and yellow.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The red and yellow paint of the wooden toy contains lead (measured value up to 330 mg/kg). Exposure to lead can result in severe and irreversible neurotoxicity, particularly in the case of children. The product does not comply with the requirements of the the Toy Safety Directive and the relevant European standard EN 71-3.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **15/04/2016**

Products were found and
measures were taken also in

Austria
Denmark
Estonia
Spain
Luxembourg

Alert number **[A12/0609/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Professional**

Product **Lorry**

Name **Actros, Antos, Arocs**

Brand **Mercedes-Benz**

EC-type approval/model **Type-approval numbers e1*2007/46*0726 e1*2007/46*0727 e1*2007/46*0728 e1*2007/46*0729 e1*2007/46*0730 e1*2007/46*0731 e1*2007/46*0732 e1*2007/46*0733 e1*2007/46*0734 e1*2007/46*0735 e1*2007/46*07.....**

Production dates **The vehicles affected were produced between 1 October 2011 and 5 March 2016.**

Product description **Lorry**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The exhaust pipe may work loose and fall onto the road leading to an accident.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Denmark
Finland
The Netherlands
Norway
Portugal
Slovenia
United Kingdom**