

Alert number

A12/0958/16



Notifying country

Spain

Product category

Electrical appliances and equipment

Type

Consumer

Product

Mini fan

Name

"USB MINI FAN"

Brand

REY-CITY

Type / number of model

Model: BB-815; ref.: 7038

Batch number

8720121770386

Product description

The product is a small fan that connects to a computer USB port. It is sold in a blue box marked with the following: 'USB MINI FAN', a photograph, model name, warnings in English, 'BB 815 SUPER QUIET FC' and the CE mark.

Risk type

Cuts

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The front grille can easily become bent, which allows easy access to the metal blades. When using the fan, the user can consequently suffer cuts caused by the rotating blades. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.

Country of origin

People's Republic of China

Measures ordered by public authorities

**Withdrawal of the product from the market
Other**

Date of entry into force **10/03/2016**



Alert number **[A12/0970/16](#)**

Notifying country **Cyprus**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Accord, Civic, CR-V, Element, Legend, Odyssey, Pilot, Ridgeline**

Brand **Honda**

Production dates **Affected Models: 2003-2008 Honda Accord 2003-2008 Honda Civic - 2005-2008 Honda CR-V - 2003-2005 Honda Element - 2007-2008 Honda Legend - 2002-2004 Honda Odyssey - 2004-2008 Honda Pilot**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The inflator's propellant may degrade over time due to heat cycles and exposure to moisture. In case of an accident with airbag deployment, the inflator may burst and metal fragments may be expelled and cause serious or fatal injuries.**

Country of origin **Japan**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **02/06/2016**

Products were found and measures were taken also in **Germany
Denmark
Finland
France
Greece
The Netherlands
Portugal
Sweden
Slovenia
Slovakia**

Alert number **[A12/0972/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Toy gun set**

Name **Sucker Gun Toys**

Brand **Unknown**

Type / number of model **NO.8800 / MKC022524**

Batch number **6991200225246**

Product description **Toy set comprised of a gun, a target, a radio and six black arrows with red suction cups.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The red suction cups contain bis (2-ethylhexyl) phthalate (DEHP) (measured value: 0,729% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. In addition, the product contains di-'isononyl' phthalate (DINP) (measured value: 0,729% by weight and 0.236 % by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles articles which can be placed in the mouth by children.

Country of origin **People's Republic of China**

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

Date of entry into force

29/06/2016

Alert number **[A12/0997/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Doll set**

Name **Toys**

Brand **Unknown**

Type / number of model **2009A (M11881720)**

Batch number **5203754005931**

Product description **Plastic baby doll and bath sold in a plastic bag.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (34,751%by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Date of entry into force **27/06/2016**

Alert number **[A12/0959/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **All-terrain vehicle**

Name **Commander**

Brand **Can-am**

EC-type approval/model **Type-approval number: e13*2002/24*0455; Type: K;**

Production dates **The vehicles concerned were manufactured in 2013. Recall code: 6030**

Product description **All-terrain vehicle**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The gearing on the steering coupling may wear down the rack-and-pinion, which may lead to a loss of steering.**

Country of origin **Mexico**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/0960/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Van**

Name **Vivaro**

Brand **Opel/Vauxhall**

EC-type approval/model **Type: e1 * 2007/46 * 0575 * 08; e1 * 2007/46 * 0575 * 09, EC type-approval: F7**

Production dates **Concerns vehicles built between 2012 and 2014.**

Product description **Van**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A faulty connection between the steering wheel and the steering column may lead to loss of steering.**


Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Denmark
The Netherlands
Poland
Sweden**

Alert number

[A12/0973/16](#)

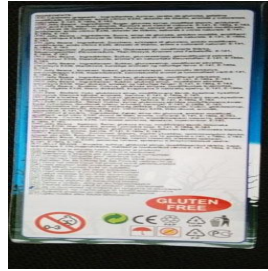

Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic doll and sweets**

Name **Monster Girls**

Brand **Fantasy Toys**

Type / number of model **FTC50369**

Batch number **8436031760064**

Product description **Plastic doll sold with sweets (jelly beans) in a cardboard packaging.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) and di-butyl phthalate (DBP) (measured value: up to 34,1% in the head and 4,2 % in the shoes respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system. In addition, the shoes of the doll also contain di-'isononyl' phthalate (DINP) (measured value: 0.2 % by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles articles which can be placed in the mouth by children .

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

27/06/2016

Alert number **[A12/0961/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Van**

Name **Trafic**

Brand **Renault**

EC-type approval/model **Type: EL / JL / L EC-type approval: e2*2007/46*0104*?? / e2*98/14*0213*?? / e2*2007/46*0014*??**

Production dates **The vehicles concerned were manufactured in 2012 and 2013.**

Product description **Van**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A faulty connection between the steering wheel and the steering column may cause the steering to fail.**


Country of origin **France**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Denmark
Finland
Greece
Croatia
Ireland
The Netherlands
Portugal
Sweden
Slovenia
Slovakia**

Alert number

[A12/0989/16](#)

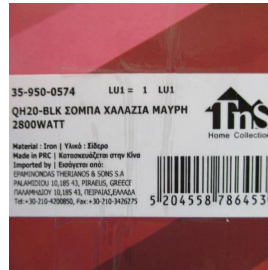

Notifying country

Cyprus

Product category

Electrical appliances and equipment

Type

Consumer

Product

Electric heater

Name

Quartz Heater

Brand

TNS Home Collection

Type / number of model

QH20 (QH20-BLK), QH20 (QH20-BUR) QH20 (QH20-GRY)

Batch number

54204558786453

Product description

Electric heater in a white/red cardboard package.

Risk type

Fire

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The heater is not stable and could overturn leading to a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60335.

Country of origin

People's Republic of China

Measures ordered by public authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

21/06/2016

Alert number **[A12/0971/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **918 Spyder**

Brand **Porsche**

EC-type approval/model **Type: 918 EC type approval: e13*KS07/46*0014*03**

Production dates **The vehicles concerned were manufactured in 2015. Recall code: AG04.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The screws on the end mount of the seatbelt and on the seatbelt winder can become loose, which can increase the risk of injury in the event of an accident.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Denmark
The Netherlands
Norway
Sweden
Slovakia**

Alert number **[A12/0962/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Genesis**

Brand **Hyundai**

EC-type approval/model **Types: BK38, BK20 EC type approval: e9*KS07/46*0010, e9*KS07/46*0011**

Production dates **The vehicles concerned were manufactured between 2011 and 2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The screws for the rear axle differential mount can come loose. The rear axle differential can fall onto the road. The differential oil can leak out and end up on the carriage way, posing a risk for following vehicles.**

Country of origin **Republic of Korea**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Denmark
Poland
Sweden**

Alert number **[A12/0974/16](#)**



Notifying country **Germany**

Product category **Protective equipment**

Type **Consumer**

Product **Leather work gloves**

Name **Lederhandschuhe**

Brand **Blackfox**

Type / number of model **CB1058**

Batch number **3 414902839083**

Product description **2 pairs of light brown leather work gloves.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of Chromium (VI) in the leather is too high (measured average content of 6.3 mg/kg.). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the requirements of the Personal Protective Equipment Directive and with the REACH Regulation.**


Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market
Retailer**

Date of entry into force **15/07/2016**

Products were found and
measures were taken also in

France

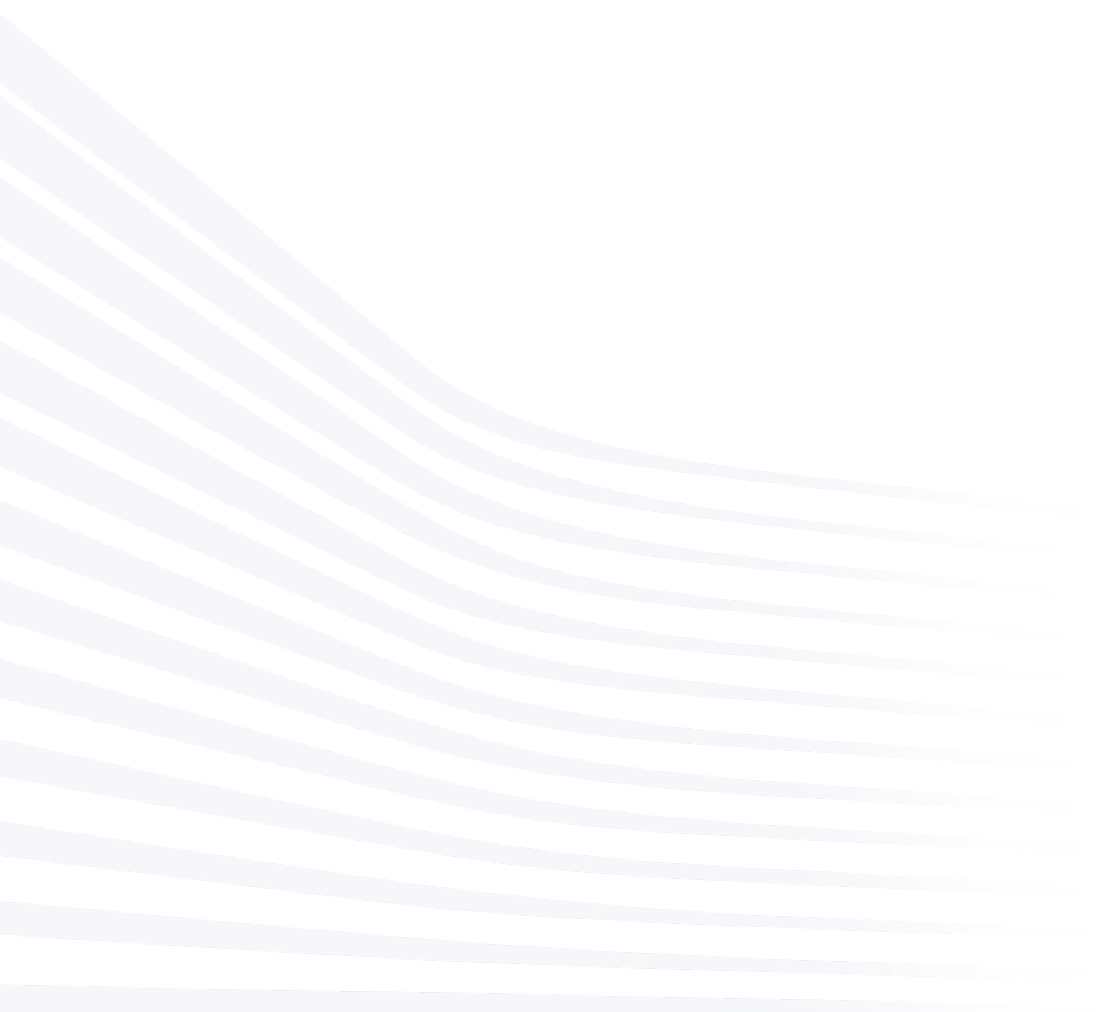

Alert number **[A12/0995/16](#)**



Notifying country **France**

Product category **Toys**

Type **Consumer**

Product **Putty**

Name **Pâte A Prout / Nasty Putty**

Brand **PACA Import**

Type / number of model **400006**

Batch number **2016 YW 0001**

Product description **Fluorescent putty (green, pink, yellow and orange), which makes a noise. The product is packed in small transparent plastic tubs.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The putty releases an excessive amount of boron (measured values: green = 2 204 mg/kg, orange = 2 099 mg/kg, yellow = 2 028 mg/kg, pink = 1 893 mg/kg). Ingestion or contact with an excessive quantity of boron may harm the health of children by damaging the reproductive system. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-3.**

Country of origin **People's Republic of China**

Measures taken by economic **Withdrawal of the product from the market**

operators

Importer

Measures taken by economic operators

**Destruction of the product
Importer**

Measures taken by economic operators

**Recall of the product from end users
Importer**



Alert number **[A12/0965/16](#)**



Notifying country **Austria**

Product category **Toys**

Type **Consumer**

Product **Toy mobile telephone**

Brand **BAIJIALE / BJL Toys**

Product description **Pink imitation mobile telephone with fairytale figures, a blue printed lanyard and a battery compartment without screws. Packed in a cardboard box with a transparent window.**

Risk type **Damage to hearing**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The sound level is too high and can consequently cause damage to hearing. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Destruction of the product
Retailer**

Date of entry into force **26/07/2016**

Alert number **[A12/0975/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Tiguan, Sharan**

Brand **VW**

EC-type approval/model **Type approval numbers: e1*2007/46*0487*,
e1*2007/46*0401* Types: 5N, 7N**

Production dates **The vehicles in question were manufactured between 12
January 2015 and 8 February 2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level)
and European standards
against which the product was
tested and did not comply **In the event of the deployment of the side airbag, the
casing of the gas generator of the airbag may be damaged
and small metal parts may break off and injure the driver
or passenger.**

Country of origin **Germany**

Measures taken by economic
operators **Recall of the product from end users
Manufacturer**

Products were found and
measures were taken also in **Finland
Greece
The Netherlands
Norway
Portugal
Sweden
Slovenia
Slovakia**

Alert number

A12/0976/16



Notifying country

Germany

Product category

Clothing, textiles and fashion items

Type

Consumer

Product

Leather suspender belt

Brand

ZADO

Type / number of model

Order number. 93259

Batch number

200013010205

Product description

Leather suspender belt

Risk type

Chemical

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The amount of Chromium (VI) in the leather is too high (measured levels of 40 mg/kg and 35 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.

Country of origin

Türkiye

Measures taken by economic operators

**Withdrawal of the product from the market
Distributor**

Products were found and measures were taken also in

**Denmark
Finland
France**

Alert number

[A12/0996/16](#)



Notifying country **Germany**

Product category **Protective equipment**

Type **Consumer**

Product **Motorcycle helmet**

Brand **Nishua**

Type / number of model **Sales name: NTX-3**

Batch number **The motorcycle helmets in question were manufactured between 1 March 2016 and 3 June 2016.**

Product description **Motorcycle helmets**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The helmet does not provide proper protection due to an insufficient shock absorbing capacity for side impacts. The product does not comply with the UNECE Regulation No. 22.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Alert number **[A12/0990/16](#)**



Notifying country **Bulgaria**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Inflatable vest**

Name **Swim Vest**

Brand **KAIXIANG**

Product description **Children's inflatable vest in different sizes: - Size 58cm x 48cm, colour yellow, with two black buckles and printed with 'Swim Vest' and 'ABC Pool School', - Size 64cm x 54cm, colour orange, with two black buckles and printed with 'Swim Vest' and 'ABC Pool School'. The products are sold in tran**

Risk type **Drowning**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The information on the product use, the warnings and the markings are insufficient to ensure that the product is used correctly and safely. The product does not comply with the relevant European standard EN 13138.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **16/05/2016**

Alert number **[A12/0964/16](#)**



Notifying country	United Kingdom
Product category	Hobby/sports equipment
Type	Consumer
Product	Climbing harness
Name	Syncro Harness
Brand	Wild Country
Type / number of model	Type C. 2016 Model Year
Batch number	01 A 01 16
Product description	Climbing harness individually packaged. Recall notice: www.wildcountry.com/en/wild-country-syncro-harness-recall
Risk type	Injuries
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	The waist belt buckle can slip under load, resulting in the climber falling from a significant height, leading to serious injury or death. The product does not comply with the requirements of the Personal Protective Equipment Directive.
Country of origin	People's Republic of China
Measures taken by economic operators	Recall of the product from end users Manufacturer

Date of entry into force **20/07/2016**

Products were found and
measures were taken also in **Poland**

Alert number **[A12/0991/16](#)**



Notifying country **Bulgaria**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Inflatable armbands**

Brand **Tama Original**

Product description **Swimming armbands, pink colour, with 2 dolphins and the inscription "TAMA Original". Single inflatable chamber. The products are packed in transparent plastic packaging.**

Risk type **Drowning**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product has only one inflatable chamber, which may expose a child to the risk of drowning. Moreover, the information on the product use, the warnings and the markings are insufficient to ensure that the product is used correctly and safely. The product does not comply with the requirements of the Personal Protective Equipment Directive and with the relevant European standard EN 13138-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **16/05/2016**

Alert number **[A12/0992/16](#)**



Notifying country **Bulgaria**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Inflatable vest**

Name **Swimmers**

Brand **Unknown**

Product description **Inflatable vests covering the waist and neck. There are 2 types: - Blue and white with dolphin images, with a clasp at the front, - Pink and white with drops and dolphin images, with a clasp at the front and a warning inscription. The products are sold in transparent, plastic packaging with a c**

Risk type **Drowning**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The information on the product use and the warnings are insufficient to ensure that the product is used correctly. The product does not comply with the European standard EN 13138-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **16/05/2016**

Alert number **[A12/0994/16](#)**



Notifying country **Bulgaria**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Inflatable vest for babies**

Name **Happy baby**

Brand **Unknown**

Product description **Inflatable vest for babies. Colour: light blue, with transparent upper and lower parts. Two buckles and 3 balls. Inscription on the product: "Happy baby". The products are sold in transparent, plastic packaging.**

Risk type **Drowning**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The information on the product use and the warnings and markings are insufficient to ensure that the product is used correctly and safely. The product does not comply with the relevant European standard EN 13138-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force **16/05/2016**

Alert number **[A12/0977/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **XC70, V60, XC60, V60CC, V40, V40CC**

Brand **Volvo**

EC-type approval/model **Type: B, D, F, M; EC type-approval: e9*2001/116*0065*28, e9*2007/46*0023*24, e9*2001/116*0068*24, e9*2007/46*0023*24, e4*2001/116*0076*40, e4*2001/116*0076*40**

Production dates **The vehicles concerned were manufactured in 2015 and 2016.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Owing to a faulty gas generator, the driver airbag may only partially deploy in the event of a road accident leading to an increased risk of injury for the driver.**



Country of origin **Sweden**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Denmark
Finland
Greece
Ireland
The Netherlands
Portugal
Sweden
Slovenia
Slovakia**

Alert number

A12/0966/16

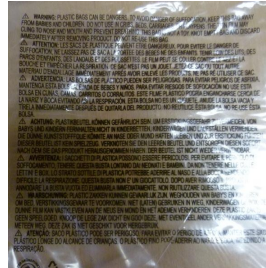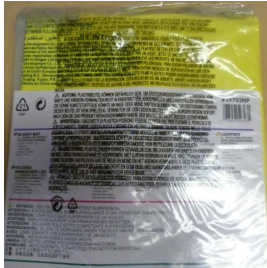

Notifying country

Bulgaria

Product category

Hobby/sports equipment

Type

Consumer

Product

Inflatable mattress

Name

Air mattress

Brand

Intex

Type / number of model

59703NP

Batch number

0 78257 59703

Product description

Air mattress, glossy mat, ±1.83m x 69 cm. The product is sold in transparent, plastic packaging with a colourful, paper insert.

Risk type

Drowning

Legal provisions (at EU level)

Information on use of the product, the warnings and

and European standards against which the product was tested and did not comply

markings are insufficient to ensure that the product is used correctly and safely. The product does not comply with the European standard EN 15649.

Country of origin

People's Republic of China

Measures ordered by public authorities

**Ban on the marketing of the product and any accompanying measures
Other**

Date of entry into force

16/05/2016

Products were found and measures were taken also in

Denmark

Alert number **[A12/0967/16](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **CBR300RA**

Brand **Honda**

EC-type approval/model **2015 and 2016 model years**

Production dates **Specific vehicles built between 23/05/2014 and 02/04/2016**

Product description **Motorcycle**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The silver plating of the connecting rod bearing retainer could corrode due to improper machining of the crankpin hole. Over time this could cause the engine to stop or stall without warning and to fail to re-start. This could place the rider in a dangerous situation where injuries could occur.**

Country of origin **Thailand**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Germany
Estonia
Greece
The Netherlands
Portugal
Sweden
Slovakia**

Alert number **[A12/0968/16](#)**



Notifying country	Portugal
Product category	Cosmetics
Type	Consumer
Product	Skin-lightening product
Name	Crème de beauté clarifiante / Lightening beauty cream
Brand	CaroWhite
Batch number	Batch number: B3/31425-B / Barcode: 6181100530056 FAB: 04/16; EXP: 04/18.
Product description	Skin-lightening beauty cream with carrot oil. Supplied in an orange, plastic bottle with an orange cap and white lettering. Volume 300 ml.
Risk type	Chemical
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	The product contains hydroquinone which can cause skin irritation and dermatitis. The product does not comply with the Cosmetic Products Regulation.
Country of origin	Ivory Coast
Measures ordered by public authorities	Import rejected at border Other
Date of entry into force	25/07/2016

Alert number **[A12/0969/16](#)**

Notifying country **United Kingdom**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Civic and Civic Tourer**

Brand **Honda**

Production dates **Specific vehicles built between 29/02/2016 and 31/03/2016**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

One of the valves in the vehicle stability assist / anti-lock braking modulator may be kept open as a result of a small piece of valve material remaining in the valve during the manufacturing of the modulator. If the valve does not operate correctly, the anti-lock braking will not operate correctly resulting in possible wheel lock under anti-lock brake operation. This could increase the risk of a vehicle crash.

Country of origin **United Kingdom**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Germany
Denmark
Estonia
Finland
Greece
Ireland
Norway
Portugal
Sweden
Slovakia**

Alert number

[A12/0993/16](#)



Notifying country

Malta

Product category

Lighting chains

Type

Consumer

Product

Lighting chain

Brand

Butlers

Type / number of model

10160596

Batch number

4035644833826

Product description

Lighting chain accompanied by a white power adapter.

Risk type

Electric shock

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The metal pins of the power adapter may come loose during use and become stuck in the socket, causing a risk of electric shock if the user touches them. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.

Country of origin

Germany

Measures taken by economic operators

**Recall of the product from end users
Manufacturer**

Alert number

[A12/0978/16](#)



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Fad Girl - Magic Girl**

Brand **Hong Sheng**

Type / number of model **NO.807**

Batch number **6957718421112**

Product description **Plastic doll sold in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: up to 31,56% by weight in the head) and di-butyl phthalate (DBP) (measured value: 0,14 % by weight in the hands). These phthalates may harm the health of children, causing possible damage to the reproductive system. In addition, it also contains diisodecyl phthalate (DIDP) (measured value: up to 0,27% by weight in the hands) and di-'isononyl' phthalate (DINP) (measured value: up to 2.05% by weight in the hands). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles articles which can be placed in the mouth by children .

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

29/06/2016

Alert number **[A12/0979/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Happy Toy City**

Brand **Novi Stars**

Type / number of model **NO. 3366**

Batch number **6912525744809**

Product description **Plastic doll in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

The plastic material of the doll contains bis (2-ethylhexyl) phthalate (DEHP) and di-butyl phthalate (DBP) (measured values: up to 32.12% by weight in the head and 4,97 % by weight in the hands respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system. In addition, it also contains diisodecyl phthalate (DIDP) and di-'isononyl' phthalate (DINP) (measured values: up to 0,25% by weight in the boots and 33.99 % in the hands respectively). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles articles which can be placed in the mouth by children.

Country of origin

People's Republic of China

Measures ordered by public
authorities

**Withdrawal of the product from the market
Other**

Date of entry into force

29/06/2016

Alert number **[A12/0998/16](#)**



Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Bicycle rack**

Name **Sprint**

Brand **Thule**

Production dates **The bicycle racks in question were manufactured between 2015 and 2016.**

Product description **Roof-mounted bicycle rack**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A defect in the clamp device on the bicycle rack can cause the bicycle to detach from the rack and fall onto the road endangering traffic coming behind.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **Austria
Denmark
Finland
Ireland
Latvia
Sweden**

Slovenia



Alert number **[A12/0980/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Pickup truck**

Name **Silverado, Sierra**

Brand **Chevrolet / General Motors**

EC-type approval/model **a) Silverado 1500 Series b) Sierra 1500 Series**

Production dates **2014 Silverado 1500 Series - 29 Jan 2013 - 04 Sep 2014
2015 Silverado 1500 Series - 21 Apr 2014 - 21 Jan 2015
2014 GMC Sierra 1500 Series 29 Jan 2013 - 04 Sep 2014
2015 GMC Sierra 1500 Seri.....**

Product description **Pickup truck**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The seat-belt tensioner can move into a position forward of the seat back bolster, which allows the occupant to sit on top of it in a sliding motion while entering the vehicle. This action can bend the cable at a severe angle over the seat-side shield, which over time may cause the cable to fatigue. In a crash, a fatigued tensioner cable could break increasing the risk of injury to the driver.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Products were found and measures were taken also in **The Netherlands**

Alert number **[A12/0981/16](#)**



Notifying country **United Kingdom**

Product category **Protective equipment**

Type **Consumer**

Product **Children's sunglasses**

Name **Kids Sunglasses**

Brand **Boots**

Type / number of model **Style code = 26BOK002F (Found on arm of the sunglasses).
Item code = 64 11 665**

Batch number **5045096411663**

Product description **Children's sunglasses. 100% UVA & UVB protection. Intended for ages 4 and above. No packaging.**

Risk type **Choking
Cuts**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic flower can detach from the frame exposing a sharp screw, posing a risk of cuts and choking for young children. The product does not comply with the requirements of the Personal Protective Equipment Directive.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users
Manufacturer**

Date of entry into force **27/07/2016**

Products were found and
measures were taken also in **Ireland**

Safety Gate Alerts

Alert number **[A12/0982/16](#)**

Notifying country **Greece**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Mii, Toledo, Leon and Ibiza**

Brand **Seat**

EC-type approval/model **Models Mii (AA), Toledo (NH), Leon (5F) and Ibiza (6J)**

Production dates **The recall affects 2016 model year vehicles.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There is a possibility that the locking lever of the manual child lock was damaged during manufacturing. This can lead to the child lock deactivating without being noticed, especially in the event of strong vibrations.**

Country of origin **Spain**

Measures taken by economic operators **Recall of the product from end users
Distributor**

Date of entry into force **05/08/2016**

Products were found and measures were taken also in **Germany
Denmark
Finland
Croatia
Ireland
The Netherlands
Portugal
Sweden
Slovenia
Slovakia**

Alert number **[A12/0983/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' sweatshirt**

Brand **Pink & Ka**

Type / number of model **008**

Product description **Sweatshirt for children in different colours. The product includes a drawstring with free ends in the neck area. The product is decorated with three stars and an inscription: "LITTLE GIRLS".**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The drawstring in the neck area of the sweatshirt could become trapped during various activities of the child, possibly leading to strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Türkiye**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **19/04/2016**

Alert number **[A12/0984/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' trousers**

Brand **Pink & Ka**

Type / number of model **034**

Product description **Leisure trousers for girls in white or green colour. The waistband of the trousers includes an unattached drawstring with free ends. The trousers are decorated with a pink inscription: "NEW YORK CITY GIRLS". Size: 3-12 years**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The unattached drawstring in the waist area of the trousers could become trapped during various activities of the child, possibly leading to injuries. The product does not comply with the relevant European standard EN 14682.**


Country of origin **Türkiye**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **19/04/2016**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Alert number **[A12/0985/16](#)**

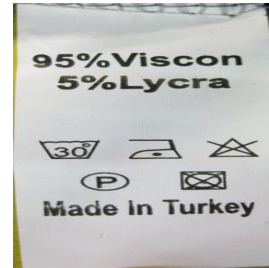

Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Children's waistcoat**

Brand **Pink & Ka**

Type / number of model **026**

Product description **Children's waistcoat with hood and zip. The hood includes a drawstring with free ends. Size: 5-10 years**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The drawstring in the neck area of the garment could become trapped during various activities of the child, possibly leading to strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **Türkiye**

Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **19/04/2016**

Alert number **[A12/0986/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Boys' sweatshirt**

Brand **Golden apple**

Type / number of model **TP-608**

Batch number **4893940087820**

Product description **Sweatshirt with hood for children in different colours. The product includes a drawstring with knotted ends in the hood. The product is decorated with an inscription: "SPORTS". Size: 134-164**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The drawstring in the neck area of the sweatshirt could become trapped during various activities of the child, possibly leading to strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**


Measures ordered by public authorities **Withdrawal of the product from the market
Other**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **19/04/2016**



Alert number **[A12/0987/16](#)**

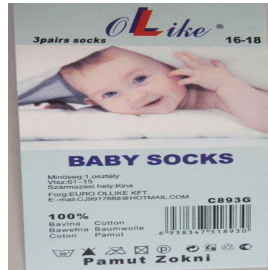

Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Babies' socks**

Name **BABY SOCKS**

Brand **Olike**

Type / number of model **C893G**

Batch number **1511160048751 / 6938347518930**

Product description **Three pairs of baby socks in one package. On one pair of them there are glued pompoms.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small pompoms can easily detach. A small child could put them in the mouth and choke on them.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users
Other**

Date of entry into force **23/11/2015**

Measures ordered by public
authorities

Withdrawal of the product from the market
Other

