

Alert number **[A12/1001/16](#)**



Notifying country **Poland**

Product category **Toys**

Type **Consumer**

Product **Push-along toy**

Name **HAPPY STAR**

Brand **PHU MERK-POL**

Type / number of model **MPG36053**

Batch number **5900368360530**

Product description **Push-along toy in the form of a helicopter.**

Risk type **Choking  
Suffocation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Various small parts can detach. A child may put them in the mouth and choke on them. The packaging material is too thin and could cause suffocation if a child plays with it. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Warning consumers of the risks  
Other**

Measures ordered by public **Withdrawal of the product from the market**

authorities **Other**



Alert number **[A12/0999/16](#)**



Notifying country **Poland**

Product category **Toys**

Type **Consumer**

Product **Doll and pushchair**

Name **My Lovely baby**

Brand **Karo**

Type / number of model **2012B**

Batch number **7460745268166**

Product description **Doll and pushchair set in plastic packaging.**

Risk type **Chemical  
Choking  
Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**Small parts of the toy can easily detach (e.g. the handle of the doll's soother and the heart securing the handle). Small children may put them in the mouth and choke. The battery cover is also easily removable, giving access to button batteries which could be swallowed by children and cause damage to the gastrointestinal tract or choking. Moreover, the safety lock of the pushchair is not sufficiently strong and can release if the pushchair is loaded, causing it to collapse. This may cause injuries to children playing with the toy and their fingers could be trapped between moving parts as it collapses. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standards EN 71-1, EN 62115.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

Alert number **[A11/0074/16](#)**



Notifying country **Finland**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Inflatable armbands**

Brand **Proaqua**

Type / number of model **34-9428**

Batch number **Batch 2015**

Product description **Swimming armbands decorated with pictures of fish, sold in a plastic bag.**

Risk type **Drowning**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **When the caps are not entirely pushed in, air can leak through the valves, possibly causing the armbands to deflate with a risk of drowning for the user. The product does not comply with the Personal Protective Equipment Directive and the relevant European standard EN 13138.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **07/06/2016**

Products were found and **Norway  
Sweden**

measures were taken also in



Alert number **[A11/0073/16](#)**



Notifying country **Finland**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Inflatable armbands**

Name **Splash and play**

Brand **Bestway**

Type / number of model **item number 32042**

Batch number **Batch number BWSHE22403S 2014-11-20**

Product description **Swimming armbands decorated with pictures of dolphins, sold in plastic packaging.**

Risk type **Drowning**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The strength of the seams is not sufficient and a chamber may start to leak after prolonged or repeated use. The deflation of the chamber may affect buoyancy, as well as the size of the product. Consequently, the product might not stay on the child's upper arms, posing a risk of drowning. The product does not comply with the requirements of the Personal Protective Equipment Directive and the relevant European standard EN 13138.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures**

**Other**

Date of entry into force **07/06/2016**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Alert number **[A12/1000/16](#)**



Notifying country **Malta**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Car power inverter**

Name **Power Inverter DC to AC**

Brand **DIK**

Product description **400W to 1500W inverter. The inverter is packaged in a transparent plastic package with a blue cardboard label.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product has no shutters to protect against access to live parts, which could result in the user receiving an electric shock. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **15/07/2016**

Alert number **[A12/1021/16](#)**



Notifying country **Germany**

Product category **Jewellery**

Type **Consumer**

Product **Earrings**

Brand **Fossetti**

Type / number of model **provided by W. u. P.: Article 100866**

Batch number **GTIN 4 040315008663**

Product description **A pair of silver-coloured, metal earrings with a colourless, transparent decorative stone; packaging: a transparent plastic bag.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The metal contains cadmium (measured value: up to 57% by weight). Cadmium is harmful to human health, because it accumulates in the body and can damage organs and it may cause cancer. The product does not comply with the REACH Regulation.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Date of entry into force **30/05/2016**

Measures taken by economic operators

**Withdrawal of the product from the market  
Importer**

Date of entry into force

**30/06/2016**

Alert number **[A12/1022/16](#)**

Notifying country **France**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **3008**

Brand **Peugeot**

EC-type approval/model **E2\*2001/116\*0377\*23**

Production dates **Manufactured from 02/06/2016 to 06/06/2016.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The upper support of the left rear spring of the suspension may crack or deform, which could affect the vehicle's road-handling characteristics and make it difficult for the driver to keep the vehicle under control.**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **07/07/2016**

Products were found and measures were taken also in **Norway  
Portugal  
Slovakia**

Alert number **[A12/1002/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Pick-up truck**

Name **D-Max**

Brand **Isuzu**

EC-type approval/model **Edition 10 anniversary model Germany. Type: ATFS EC type-approval: e4\*2007/46\*0413\***

Production dates **The vehicles in question were manufactured between 2.6.2015 and 29.2.2016.**

Product description **Pickup truck**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **When the wheel hubs were being repainted in the Custom Truck Services Centre, the wheel mating surfaces were also painted. Owing to settling effects, the wheel may become detached from the vehicle.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Alert number

**A12/1003/16**



Notifying country

**Finland**

Product category

**Electrical appliances and equipment**

Type

**Consumer**

Product

**Energy meter**

Name

**Energy Display**

Brand

**ELIQ**

Type / number of model

**CPA0500050 (power adapter)**

Batch number

**7 350067 550011**

Product description

**Energy meter supplied with a power supply ("Switching Adapter"). Sold in a white cardboard box.**

Risk type

**Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The electrical insulation of the power supply is not adequate. The clearance /creepage distances between the primary and secondary windings of the power supply are too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Recall of the product from end users  
Other**

Date of entry into force **27/05/2016**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **27/05/2016**

Alert number

**[A12/1004/16](#)**



Notifying country **The Netherlands**

Product category **Other**

Type **Consumer**

Product **Telescopic ladder**

Name **Highstep**

Brand **Expo Borse**

Type / number of model **Telescopic Ladder 3.2 metres**

Batch number **4036812150479**

Product description **Telescopic ladder 3.2 m, packed in a cardboard box.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Fingers can be trapped between the steps/rungs when releasing the locking mechanisms. The ladder stiles are not strong enough and could break during use. The product does not comply with the relevant European standard EN 131.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **01/05/2016**

Alert number **[A12/1044/16](#)**



Notifying country	<b>United Kingdom</b>
Product category	<b>Kitchen/cooking accessories</b>
Type	<b>Consumer</b>
Product	<b>Thermos flask</b>
Name	<b>Vacuum Flask with 2 cups</b>
Brand	<b>Thermate</b>
Type / number of model	<b>0-57625</b>
Batch number	<b>5050577576250</b>
Product description	<b>1.8 litre thermos flask with 2 cups. Polypropylene outer and vacuum glass inner. Available in various colours - purple, yellow, blue, pink. No packaging.</b>
Risk type	<b>Chemical</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The flask contains asbestos fibres. If the thermos breaks, the user may inhale asbestos fibres, which are carcinogenic. The product does not comply with the REACH Regulation.</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>25/06/2016</b>

Alert number **[A12/1005/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **1199 Panigale SL ABS**

Brand **Ducati**

EC-type approval/model **Type: H8; EC type-approval: e3\*2002/24\*0586\***

Production dates **Vehicles produced in 2014 are affected.**

Product description **Motorcycle**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A component of the clutch could break. This could lead to the rear wheel locking up and cause the rider to crash.**

Country of origin **Italy**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Denmark  
Greece  
Ireland  
The Netherlands  
Norway  
Sweden  
Slovakia**

Alert number **[A12/1006/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Caravan**

Name **Eriba Nova GL/SL**

Brand **Hymer**

EC-type approval/model **Type-approval number: e1\*2007/46\*0286\*09 to \*11; Type: EG/N 001**

Production dates **Vehicles produced in 2016 are affected.**

Product description **Caravan**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The adhesive on the gas locker door may become detached. This may result in the external casing coming off. This casing may drop onto the road and put other road users at risk.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Denmark  
Finland  
The Netherlands**

Alert number **[A11/0070/16](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Children's skeleton costume**

Name **Esqueleto Infantil Costume**

Brand **CHANG HONG**

Type / number of model **Item No K007495/ NO.HSG6500**

Batch number **8433865007495**

Product description **Children's skeleton costume in two pieces. Presented for sale in a plastic bag with a card inside.**

Risk type **Suffocation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic bag is too thin and can cover the mouth and/or nose of a child causing suffocation. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **08/04/2016**

Alert number

**[A12/1007/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Musical toy**

Name **Fun Car - High Toys Set**

Brand **Unknown**

Type / number of model **9282345/1047A**

Batch number **5290509051558**


Product description **Plastic, battery-operated toy in the form of a van with dog face, flashing lights and sound effects. There are also four plastic animal figures. Packaged in a cardboard box.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The four plastic animal figures are small parts. The wheels of the toy can detach. A child could put the figures or the wheels in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

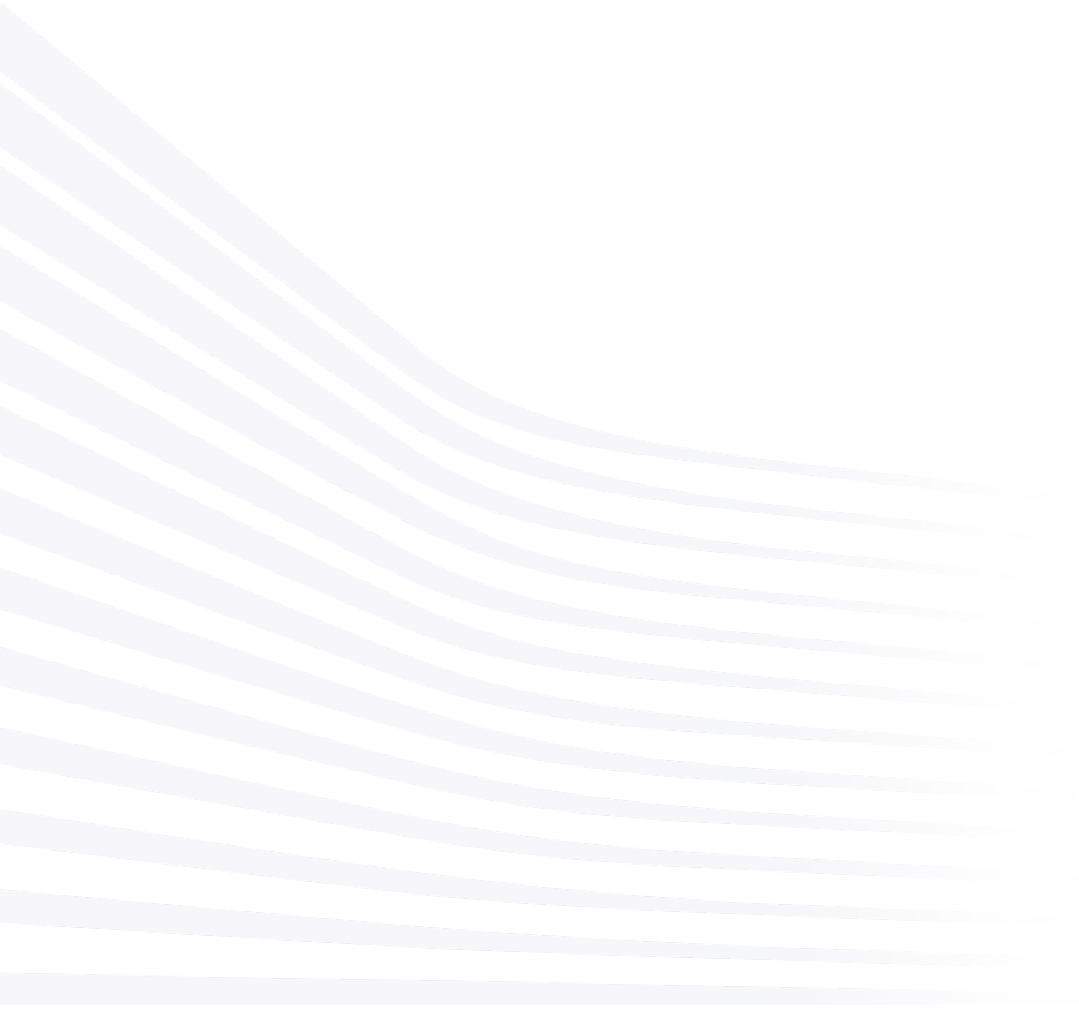

Alert number

**[A12/1008/16](#)**



Notifying country **Finland**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Heated gloves**

Name **Akkukäyttöinen lämpökäsine (Battery-operated heated gloves)**

Brand **Snow fox**

Type / number of model **HS085-1200**

Batch number **6 420071 080482**

Product description **Electrically heated gloves supplied with a battery charger ("Li-ion battery charger"). Sold in a black cardboard box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The clearance /creepage distances between the primary and secondary windings of the battery charger are too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **22/06/2016**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **22/06/2016**

Alert number

**[A12/1009/16](#)**



Notifying country **Poland**

Product category **Toys**

Type **Consumer**

Product **Skipping rope**

Name **Skakanka kolorowe skręty / skipping rope**

Brand **ANJANTO**

Type / number of model **PLU 236760**

Batch number **5907551030492**

Product description **Colourful skipping rope.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The skipping rope contains bis (2-ethylhexyl) phthalate (DEHP) (measured value: 36,7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Measures ordered by public **Warning consumers of the risks**

authorities

**Other**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**



Alert number **[A12/1010/16](#)**



Notifying country **The Netherlands**

Product category **Toys**

Type **Consumer**

Product **Soft toy**

Name **Remote Control Playfull Puppy**

Brand **JOHNTOY**

Type / number of model **27521 / WIC351549**

Batch number **8711866 275212 / 15-148**

Product description **Soft toy dog in cardboard box.**

Risk type **Choking  
Suffocation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The nose and the eyes of the toy can be easily detached. A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **16/02/2016**

Products were found and  
measures were taken also in

**Slovenia**  
**Slovakia**

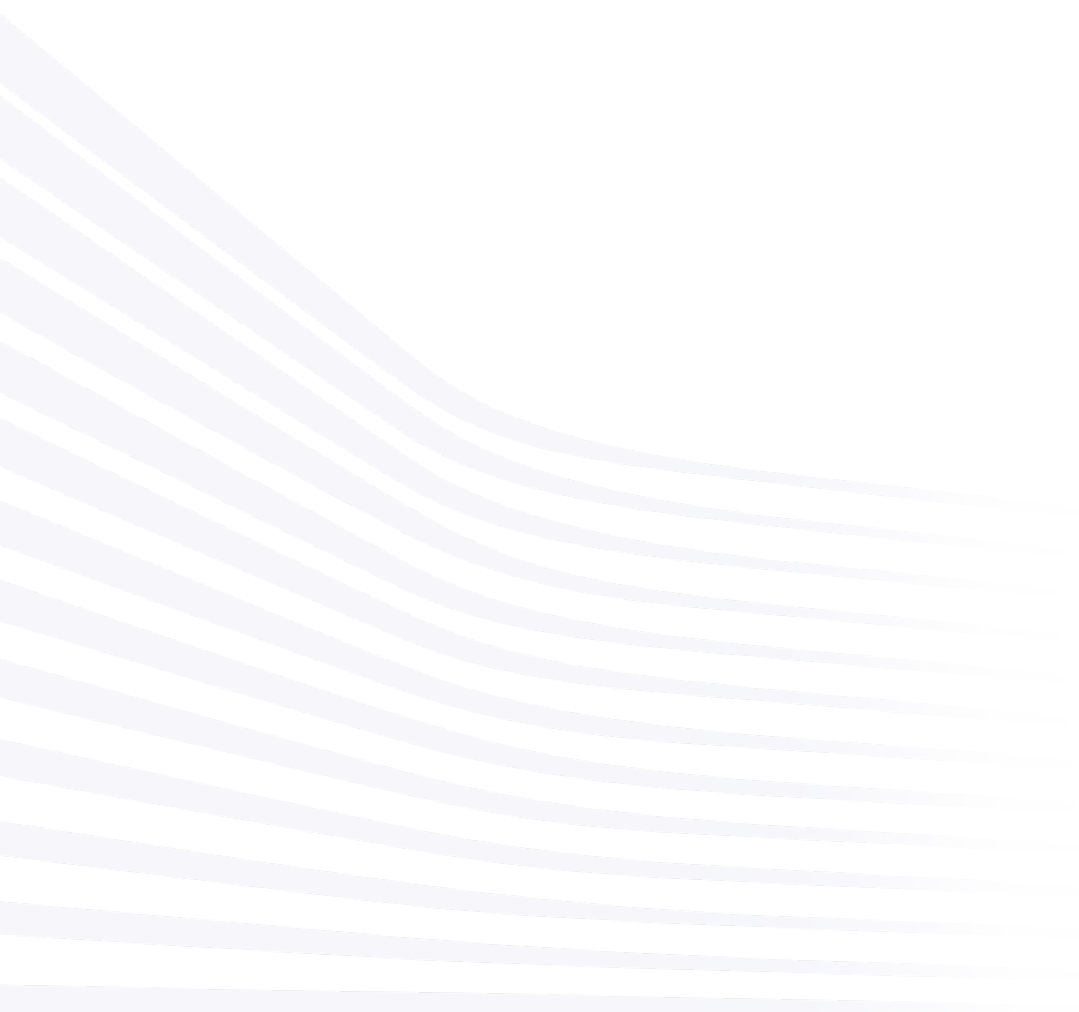

Alert number **[A12/1011/16](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car / van**

Name **C5, Berlingo, Jumpy**

Brand **Citroën**

EC-type approval/model **C5 (X7), Berlingo III and Jumpy III.**

Production dates **Production period: 22/04/2016 to 05/05/2016**

Product description **Passenger car / van**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The driver's airbag may not deploy properly in the event of an accident due to the possible failure of one of its components.**

Country of origin **Portugal**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **02/08/2016**

Products were found and measures were taken also in **Denmark  
Estonia  
Finland  
Croatia  
Malta  
The Netherlands  
Norway  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number **[A12/1012/16](#)**

Notifying country **Portugal**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car / van**

Name **Partner, Expert**

Brand **Peugeot**

EC-type approval/model **Partner III and Expert III.**

Production dates **Production period: 27/04/2016 to 06/05/2016**

Product description **Passenger car / van**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Due to a possible failure of one of the components of the airbag, the driver's airbag may not deploy properly in the event of an accident.**

Country of origin **Portugal**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **02/08/2016**

Products were found and measures were taken also in **Bulgaria  
Denmark  
Estonia  
Finland  
Greece  
Croatia  
Malta  
The Netherlands  
Norway  
Sweden  
Slovenia  
Slovakia**

Alert number

**A12/1013/16**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Toy pram**

Name **Baby Carriage**

Brand **One Six Eight**

Type / number of model **12010D63 / CS7826**

Batch number **20140606 / 9912011500633**

Product description **Toy pram for dolls, packaged in a plastic bag.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy pram has only one locking device which does not automatically engage. There is consequently a risk of fingers getting trapped between moving parts if the pram collapses. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **25/07/2016**

Alert number **[A12/1045/16](#)**



Notifying country **Finland**

Product category **Lighting equipment**

Type **Consumer**

Product **Rechargeable torch**

Name **LED Spotlight**

Brand **Arctic Marine**

Type / number of model **Battery charger: GM-042100**

Batch number **6 430022 584167**

Product description **Rechargeable torch supplied with a battery charger ("AC/DC Adapter").**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The electrical insulation of the battery charger is not adequate. The clearance /creepage distances between the primary and secondary windings of the battery charger are too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standards EN 60598 and EN 61558.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **23/05/2016**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **25/05/2016**

Alert number **[A12/1023/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Octavia, Rapid, Citigo**

Brand **Skoda**

EC-type approval/model **Types: 5E, NH, AA; EC type-approvals: e11\*2007/46\*0243, e11\*2007/46\*0250, e13\*2007/46\*1169.**

Production dates **The vehicles concerned were manufactured between 25.11.2015 and 14.4.2016.**

Product description **Passenger car.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The lever of the manual, child-proof, locking system could break owing to prior damage during the manufacturing process. This can cause the child-proof locking system to be turned off without being noticed, especially in the event of strong vibrations, making it possible for the door to be opened from the inside.**

Country of origin **Czechia**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Bulgaria  
Denmark  
Finland  
Greece  
Croatia  
Ireland  
The Netherlands  
Norway  
Portugal  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number **[A12/1014/16](#)**



Notifying country **Hungary**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Educate the girl**

Brand **Unknown**

Type / number of model **NO.08087 (on the collective packaging containing 12 dolls); 5B041-A-H-0720-002 (on the individual packagings)**

Batch number **2015172902005; 1501697467880**

Product description **Plastic mermaid dolls in different colours. 12 items are supplied in one collective packaging. The dolls are packed individually in a transparent plastic cylinder.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 36% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**06/07/2016**

Alert number **[A12/1015/16](#)**



Notifying country **Hungary**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Merry**

Brand **Unknown**

Type / number of model **No. G908**

Product description **Plastic doll with long blond hair, supplied in a cardboard box with a transparent window.**


Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 26% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**


Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public authorities **Recall of the product from end users  
Other**

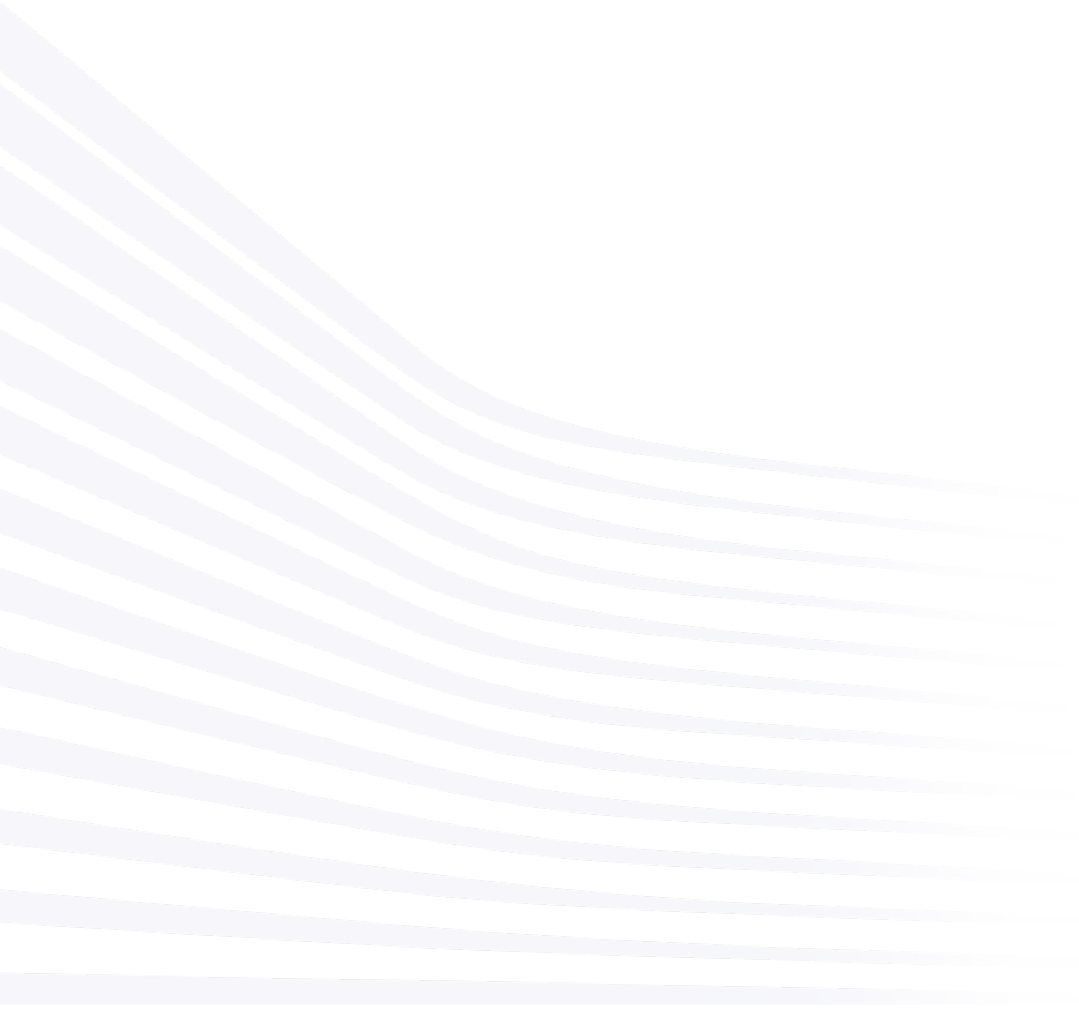

Alert number

**A12/1016/16**

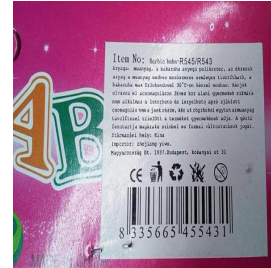

Notifying country **Hungary**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **My Baby**

Brand **Unknown**

Type / number of model **Item No: R545/R543**

Batch number **8335665455431**

Product description **Plastic baby doll with nursing bottle. Packaged in a transparent plastic bag with a cardboard label.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 26% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**02/03/2016**

Alert number **[A12/1019/16](#)**



Notifying country **Finland**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Rain cape**

Name **Sadeviitta/ Regncap [Rain cape]**

Brand **Unknown**

Type / number of model **Article no. 146785**

Batch number **Bar code: 6410411467851**

Product description **Transparent, plastic rain cape (one size, both for men and women) packed in a transparent plastic bag (size approx. 17 cm x 10 cm), with a white press stud.**

Risk type **Environment**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material (PVC) of the bag contains cadmium (measured value: up to 1300 mg/kg). The product poses an environmental pollution risk as cadmium accumulates in the human body and can damages organs and cause cancer. The product does not comply with the REACH Regulation.**

Country of origin **Japan**

Measures ordered by public authorities **Import rejected at border  
Other**



Alert number **[A12/1017/16](#)**



Notifying country **Hungary**

Product category **Toys**

Type **Consumer**

Product **Plastic snake**

Name **Játék állat [Toy animal]**

Brand **Baohua Toys**

Type / number of model **1-9203-837S7**

Batch number **4792852720118**

Product description **Two green plastic, toy snakes in a transparent plastic bag with a cardboard label.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy snake contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 8.9% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **04/07/2016**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number **[A12/1018/16](#)**



Notifying country **Hungary**

Product category **Toys**

Type **Consumer**

Product **Toy whistle**

Name **Síp**

Brand **fakopáncs**

Type / number of model **971**

Batch number **5999520237476**

Product description **Plastic whistle with a wooden animal head on top; packed in a transparent plastic bag.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The antennae of the animal figure can be easily detached. A small child may put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public **Recall of the product from end users**

authorities

**Other**

Date of entry into force

**28/06/2016**

Alert number **[A12/1024/16](#)**

Alert number **[A12/1025/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Cherokee**

Brand **Jeep**

EC-type approval/model **Type: KL EC type approval: e4\*2007/46\*0783\*02**

Production dates **The vehicles affected were manufactured between 10.9.2013 and 6.8.2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The control module may have the wrong parameters for headlamp levelling. This can mean that the switch for the headlamp levelling has to be operated in the wrong direction in order to achieve the desired levelling of the headlamps. This can cause an accident.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Spain  
Norway  
Sweden  
United Kingdom**

Alert number

**[A12/1026/16](#)**



Notifying country

**France**

Product category

**Electrical appliances and equipment**

Type

**Consumer**

Product

**Charger for mobile phone**

Name

**Kit chargeur allume-cigare**

Brand

**POWER+**

Type / number of model

**CP 39062 , CP 39063 and CP 43928**

Batch number

**9063/405493/00; 3120370390635**

Product description

**Charger for mobile phone which connects to the mains or a car cigarette lighter socket.**

Risk type

**Electric shock  
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The electrical insulation is inadequate: the creepage distances between the live and neutral wires in the primary circuit are too small. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60960.**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Withdrawal of the product from the market  
Distributor**

Date of entry into force

**04/07/2016**

Measures taken by economic operators

**Recall of the product from end users  
Distributor**

Date of entry into force

**08/07/2016**

Alert number **[A12/1027/16](#)**



Notifying country **France**

Product category **Jewellery**

Type **Consumer**

Product **Earring hooks**

Brand **DTM LOISIRS CRÉATIFS**

Type / number of model **268404**

Batch number **3471052684048 (ean)**

Product description **20 mm gold-coloured, hanging earring-hooks, sold in batches of 6 in a transparent bag.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of nickel released by the earring hooks is too high (measured value up to 42 µg/cm<sup>2</sup>/week). Nickel is a strong sensitizer and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. The product does not comply with the REACH Regulation.**

Country of origin **Taiwan**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **20/07/2016**

Measures taken by economic operators

**Withdrawal of the product from the market  
Importer**

Date of entry into force

**20/07/2016**

Alert number

**[A12/1028/16](#)**



Notifying country **Poland**

Product category **Toys**

Type **Consumer**

Product **Soft toy**

Name **PLAYME - SOFT DOLL**

Brand **Brimarex**

Type / number of model **B627 (F17843)**

Batch number **5907791563903**

Product description **Soft, stuffed doll approximately 390 mm high. The eyes and mouth are embroidered and the nose is made of hard plastic covered with textile material. The doll is dressed in a dress with two buttons. No packaging.**


Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The nose of the doll, as well as the buttons of the dress, can be easily detached. A child may put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number **[A12/1029/16](#)**

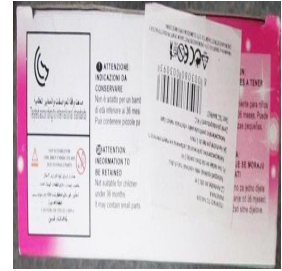

Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **VOGUE Girl, VOGUE STYLE**

Brand **Angel**

Type / number of model **NO. 888-A; ITEM NO:TC140309**

Batch number **8003080003093**

Product description **Set of 2 plastic dolls, in different sizes (10 and 28 cm) with spare clothes on a hanger. Both dolls have blonde hair pulled back in a ponytail.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 13 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number **[A12/1030/16](#)**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Sweet the First - Girl and her Friends**

Brand **Unknown**

Type / number of model **NO.JF880**

Batch number **On the label: B-B: BB16-10825, 6917984564746**

Product description **Plastic doll in a blue dress with gold stars and with pink shoes.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 17.6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number

**A12/1031/16**

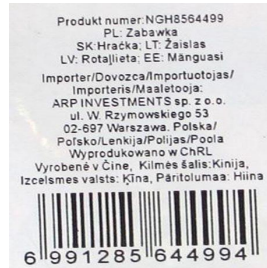

Notifying country

**Czechia**

Product category

**Toys**

Type

**Consumer**

Product

**Plastic doll**

Name

**UNIQUE Model Fashion Vogue**

Brand

**Unknown**

Type / number of model

**NO.ZY88288**

Batch number

**On the labels: NGH8564499; EAN: 6991285644994**

Product description

**Mermaid plastic doll sold in pink cardboard and plastic packaging.**

Risk type

**Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: up to 35% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Other**



Alert number **[A12/1032/16](#)**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Shun**

Brand **Unknown**

Type / number of model **NO:3808**

Batch number **On the label: Item No: JR1408204 / EAN: 1408204004400**


Product description **Plastic doll (about 10 cm tall) with 3 pieces of clothing, a pony and a silver wand, sold in a pink cardboard and plastic packaging.**

Risk type **Chemical**


Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the head of doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 39.2 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

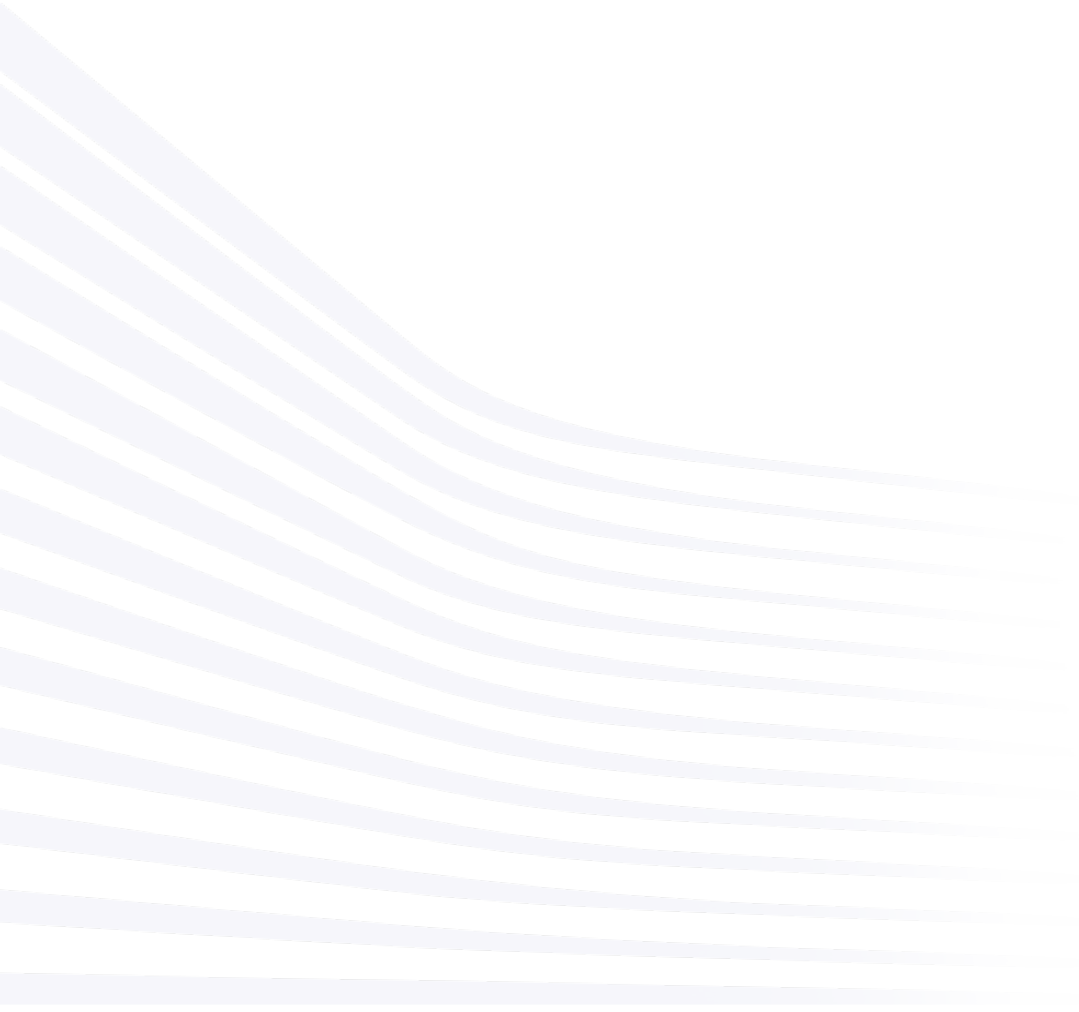

Alert number **[A12/1034/16](#)**

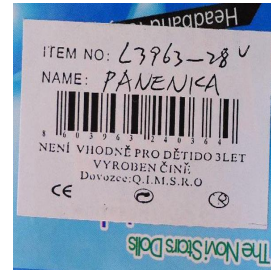

Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Brand **Novi stars (COUNTERFEIT)**

Type / number of model **NO.N9**

Batch number **On the label: L3963-28 / 8603963240364**

Product description **Plastic doll about 24 cm tall, sold in blue cardboard and plastic packaging.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 16.9 % by weight ). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **21/07/2016**

Alert number **[A11/0115/16](#)**

Notifying country **Lithuania**

Product category **Motor vehicles**

Type **Consumer**

Product **Fuel filter**

Brand **Filtron**

EC-type approval/model **PP 847/6**

Production dates **841/6FIL, 841/6WXA, 841/6WXE**

Product description **Fuel filter**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The upper cap of the fuel filter can become loose. Fuel leakage from the fuel filter could cause a fire.**

Country of origin **Poland**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **28/07/2016**

Products were found and measures were taken also in **Cyprus  
Estonia  
Greece  
Croatia  
Poland  
Portugal  
Slovenia**

Alert number **[A12/1033/16](#)**

Notifying country **Hungary**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Swift**

Brand **Suzuki**

EC-type approval/model **Swift (AZG)**

Production dates **The vehicles affected were manufactured between 17.04.2013 and 19.09.2015.**

Product description **Passenger car**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The adhesive force of the double sided tapes which fix the front seat heater to the seat may deteriorate and the seat heater could consequently move. This could lead to part of the seat heating up excessively causing a fire.**


Country of origin **Hungary**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Date of entry into force **13/07/2016**

Products were found and measures were taken also in **Denmark  
Finland  
Greece  
Croatia  
Iceland  
The Netherlands  
Norway  
Poland  
Sweden  
Slovenia  
Slovakia**

Alert number **[A11/0071/16](#)**

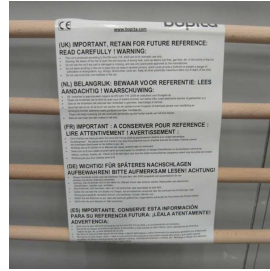

Notifying country **The Netherlands**

Product category **Childcare articles and children's equipment**

Type **Consumer**

Product **Cot**

Name **Ledikant Finn**

Brand **Bopita**

Type / number of model **148011**

Batch number **8712657019152**

Product description **White lacquered baby/children's cot. The components are packed in a cardboard box.**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cot has four accessible protruding parts/snag points to which the garments of the child could get caught, causing strangulation. The product does not comply with the relevant European standard EN 716.**

Country of origin **The Netherlands**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

Date of entry into force **12/04/2016**

Products were found and  
measures were taken also in

**Luxembourg**

Alert number **[A12/1035/16](#)**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Sweet - My fashion style Special Style**

Brand **Unknown**

Type / number of model **Item No: JR1408122; NO:8820**

Batch number **8654188588820**

Product description **Plastic doll sold with 5 different pieces of clothing in pink cardboard and plastic packaging.**


Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 30.8 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **20/07/2016**

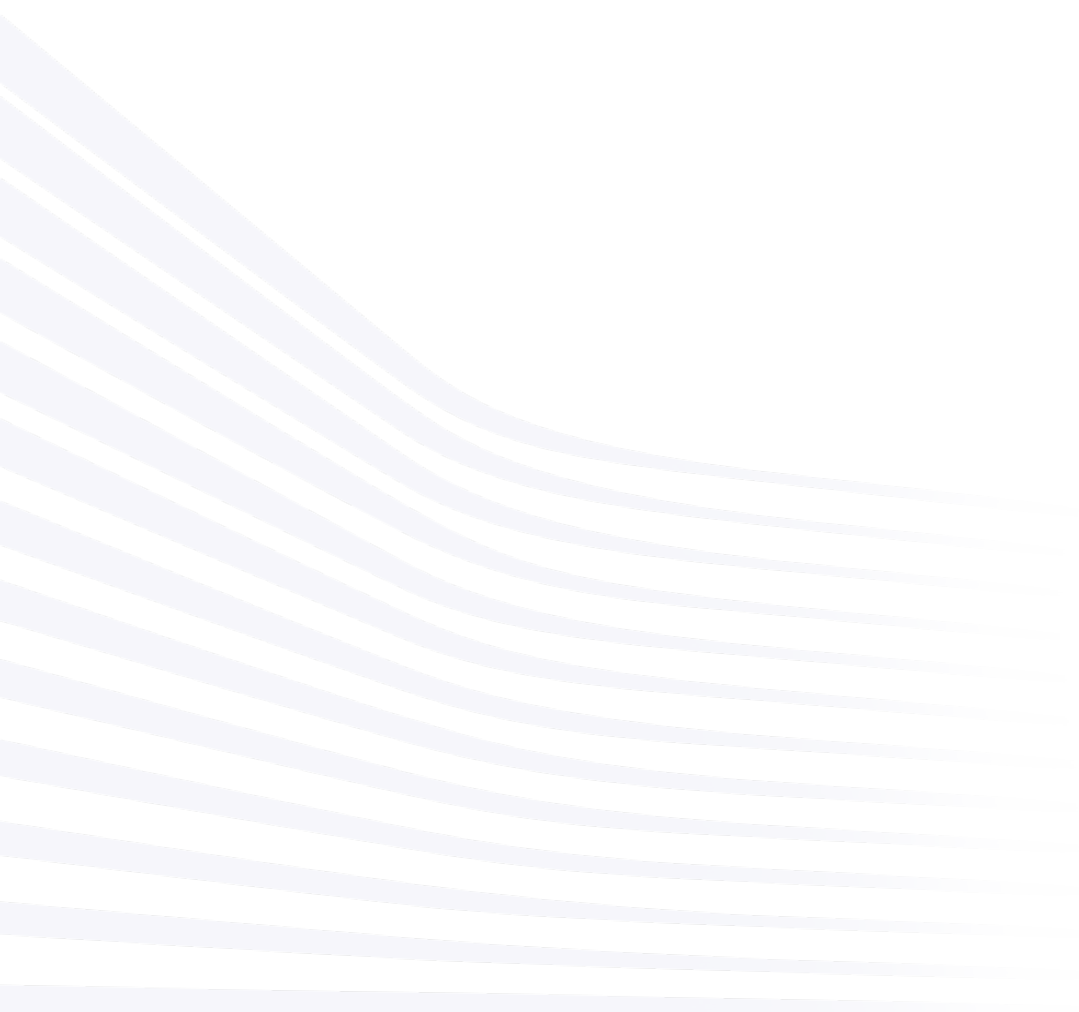

Alert number **[A12/1036/16](#)**

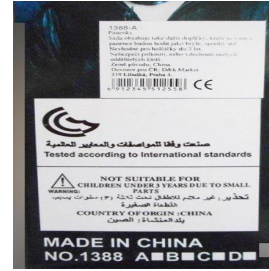

Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **MALEFICIENT (COUNTERFEIT)**

Brand **Unknown**

Type / number of model **NO.1388**

Batch number **6912345512558**

Product description **Plastic doll (about 32 cm tall) with black clothes and black hair sold in cardboard and plastic packaging.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 30% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number

**A12/1037/16**



Notifying country	<b>Czechia</b>
Product category	<b>Toys</b>
Type	<b>Consumer</b>
Product	<b>Plastic doll</b>
Name	<b>Delicate Person Fish princess</b>
Brand	<b>Unknown</b>

Type / number of model **NO.: 1819**

Batch number **6915468156845**

Product description **Plastic mermaid dolls (about 15 cm tall) sold in a collective packaging containing 24 items. Each individual doll is also packed in plastic packaging.**

Risk type **Chemical**

Legal provisions (at EU level) **The head of the doll contains di-(2-ethylhexyl) phthalate**

and European standards against which the product was tested and did not comply

**(DEHP) (measured value: 24.7% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Other**

Date of entry into force

**27/07/2016**

Alert number **[A12/1038/16](#)**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Rikki Mermaid girl**

Brand **H2O Just add water (COUNTERFEIT)**

Type / number of model **03-2014**

Batch number **177509-01976-00-010115.**


Product description **Plastic mermaid doll (about 30 cm tall), with orange or pink fins, sold in plastic transparent packaging with a picture of mermaids.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 36.9% in the head and 44.2% by weight in the fins). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

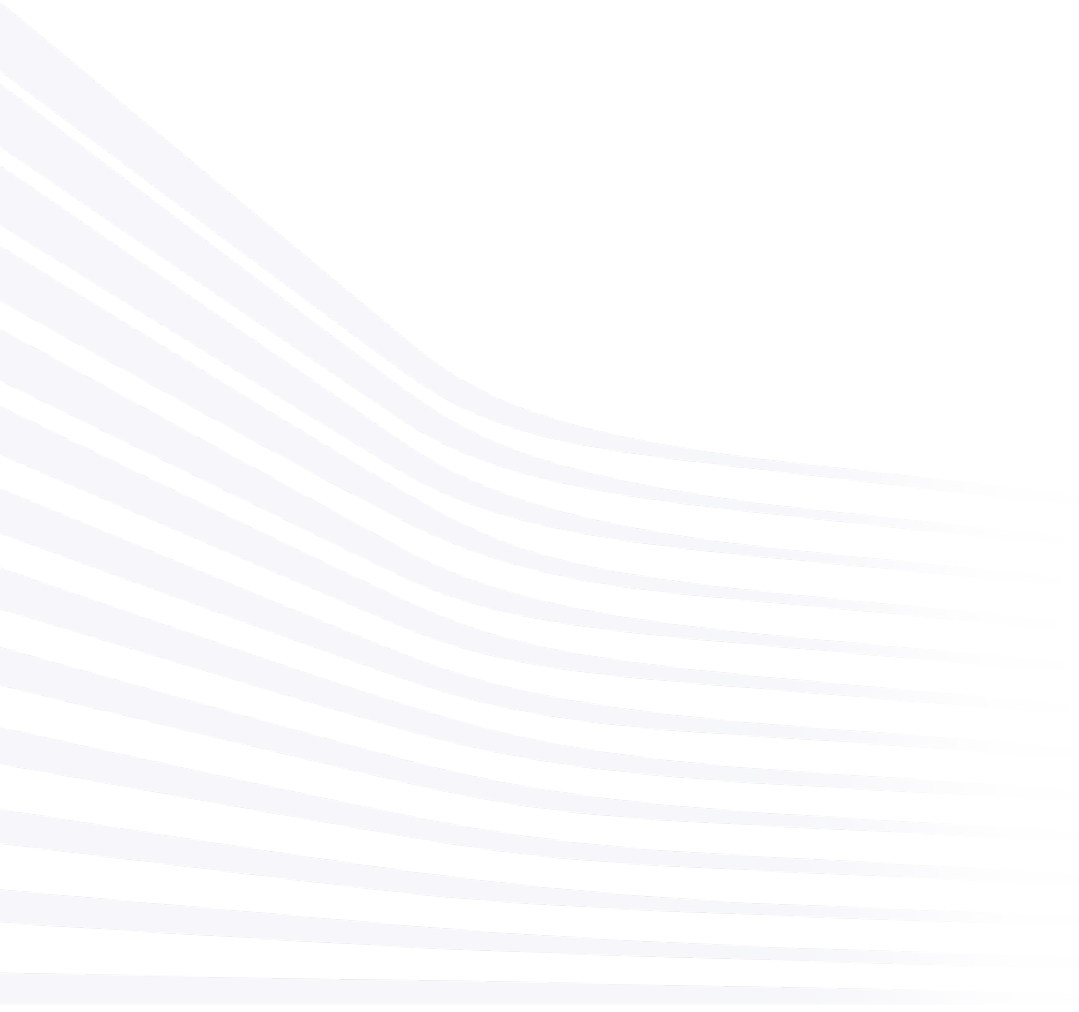

Alert number **[A12/1040/16](#)**



Notifying country **Czechia**

Product category **Cosmetics**

Type **Consumer**

Product **Herbal shampoo**

Name **Bylinny Sampon**

Brand **BON Bio Organic & Natural Auroville**

Type / number of model **MD: May 2014; Use within: Apr 2016**

Product description **Handcrafted herbal shampoo, 100 ml. Ingredients: "a unique combination of medicinal herbs, aloe vera and essential oil of lemon & basil."**

Risk type **Microbiological**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains aerobic mesophilic bacteria (measure value up to  $1.6 \times 10^4$  cfu /g). The contamination can cause eye irritation and inflammation of the conjunctiva. The product does not comply with the Cosmetic Products Regulation.**

Country of origin **India**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **06/07/2016**

Alert number

**A12/1039/16**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **FROZEN - Elsa queen and princess Anne (COUNTERFEIT)**

Brand **Fashion**

Type / number of model **NO.942**

Batch number **On the label: Panenky, L5080/5/1152, EAN: 8602795511529**

Product description **Plastic doll (approx. 15 cm tall) sold in a blue and pink box with transparent window.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 23.2% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **27/07/2016**



Alert number

**A12/1041/16**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic dolls**

Name **Sofia the First**

Brand **Unknown**

Type / number of model **NO.SF-9**

Batch number **On the label: ITEM NO: SF-9K 8595573001570**

Product description **3 plastic dolls and a snowman sold in cardboard and plastic packaging.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 18% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number

**A11/0072/16**



Notifying country

**Hungary**

Product category

**Lighting chains**

Type

**Consumer**

Product

**Lighting chain**

Name

**35 LED\*\* Lampes fixes**

Brand

**Actuel - Auchan**

Type / number of model

**797998; DF-LED-35S**

Batch number

**3 245676 049060**

Product description

**Lighting chain with 35 blue LED lamps. Packaging: cardboard box.**

Risk type

**Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**Parts of basic insulated wires are accessible. In case of damage to the wires, the live conductors of the wires could become accessible. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Other**

Date of entry into force

**06/07/2016**

Alert number **[A12/1042/16](#)**



Notifying country **Hungary**

Product category **Lighting equipment**

Type **Consumer**

Product **Ceiling light**

Name **Spot Lámpatest/Ceiling Lighting Point Fitting**

Brand **Kanlux**

Type / number of model **ARGUS CT-2114**

Batch number **5 905339 003256**

Product description **Recessed ceiling light. Packaging: cardboard box with transparent window.**

Risk type **Burns  
Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There is no cover to prevent contact between the bulb and the wiring. The inadequately insulated mains lead may consequently overheat and live parts could become accessible. In addition, the overheated parts could cause burns for users. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public  
authorities

**Recall of the product from end users**  
**Other**

Date of entry into force

**07/10/2015**