

Alert number **[A12/1263/16](#)**



Notifying country **Romania**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **False nails**

Name **Nail Art**

Brand **MEIJJAER**

Type / number of model **MJE - 060**

Product description **Set of plastic nails (12 pcs) in different designs and colours (yellow, purple and black), supplied with glue in an orange tube. Packed in a cardboard box with transparent window.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The glue contains dibutyl phthalate (DBP), which is toxic to reproduction. The product does not comply with the Cosmetic Products Regulation.**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **13/09/2016**

Alert number

**[A12/1256/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' dress**

Name **SWEET ELBISE**

Brand **Bulsen**

Type / number of model **KOD: 002**

Batch number **8680445160020**

Product description **Dress for girls with glued decorative elements. Size: 74.**


Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small decorative elements can be easily detached. A small child could put them in the mouth and choke on them.**

Country of origin **Türkiye**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public authorities **Recall of the product from end users  
Other**

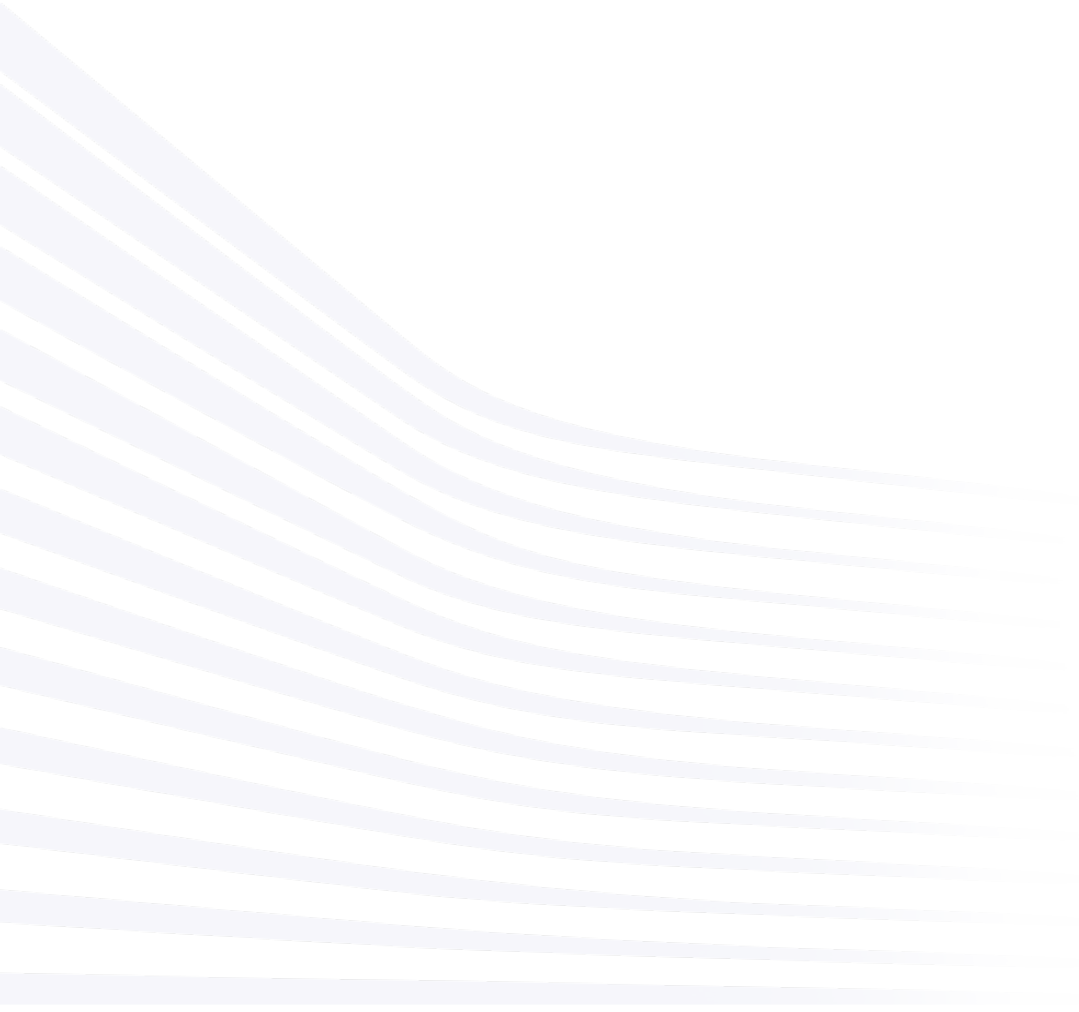

Alert number **[A12/1257/16](#)**



Notifying country	<b>Hungary</b>
Product category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Product	<b>Girls' dress</b>
Brand	<b>Esila</b>
Type / number of model	<b>BB0185</b>
Product description	<b>White dress for girls with glued decorative elements. Size: 98-3Y.</b>
Risk type	<b>Choking</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The small decorative elements can be easily detached. A small child could put them in the mouth and choke on them.</b>
Country of origin	<b>Türkiye</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Other</b>
Measures ordered by public authorities	<b>Recall of the product from end users Other</b>
Date of entry into force	<b>08/07/2016</b>

Alert number **[A12/1258/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' dress**

Brand **R. Framboise**

Type / number of model **LYS XRO-621**

Product description **White dress for girls with decorative elements. Size: 6M.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small decorative elements can be easily detached. A small child could put them in the mouth and choke on them.**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **09/08/2016**

Alert number **[A12/1259/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Babies' booties**

Brand **Bebessi**

Type / number of model **252**

Batch number **8699108402520**

Product description **Booties for babies in different colours with glued pompoms.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small pompoms can be easily detached. A small child could put them in the mouth and choke on them.**


Country of origin **Türkiye**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **09/09/2016**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number **[A12/1264/16](#)**

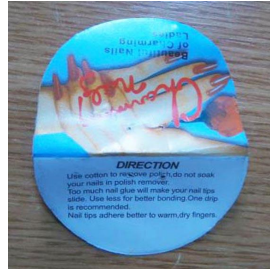

Notifying country **Romania**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **False nails**

Name **Charming Nails**

Brand **KT**

Batch number **01119333704-01224512124**

Product description **Set of white plastic nails (13 pcs) in different designs and sizes, and supplied with glue in an orange tube. Packed in a plastic bag.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The glue contains dibutyl phthalate (DBP), which is toxic to reproduction. The product does not comply with the Cosmetic Products Regulation.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

Date of entry into force **19/09/2016**

Alert number **[A12/1260/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Babies' booties**

Brand **aura.via**

Type / number of model **BV208**

Batch number **140600301BV208012**

Product description **Booties for babies in different colours, decorated with glued plush bears. The eyes of the bears are sewn beads. Bells are attached to the necks of the bears.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The eyes and bells of the bears can be easily detached. A small child could put them in the mouth and choke on them.**

Country of origin **Unknown**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **26/08/2016**

Measures ordered by public **Withdrawal of the product from the market**

authorities **Other**



Alert number **[A12/1261/16](#)**



Notifying country **Hungary**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' dress**

Brand **Avid Diva**

Type / number of model **KOD: 615**

Batch number **8000000 004158**

Product description **Dress for girls with short-sleeved bolero. The dress has glued decorative elements. Size: 98 - 3 years.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small decorative elements may be easily detached. A small child could put them in the mouth and choke on them.**

Country of origin **Türkiye**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **11/08/2016**

Alert number **[A12/1269/16](#)**



Notifying country **The Netherlands**

Product category **Toys**

Type **Consumer**

Product **Wooden toy**

Name **Kugelbahn**

Brand **Haba**

Type / number of model **TL72802**

Batch number **EAN 4010168035802**

Product description **Wooden toy packed in a cardboard box.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The small green balls on the toy can detach. A child could put them in the mouth and choke on them. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.**

Country of origin **Germany**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

Date of entry into force **07/03/2016**

Products were found and  
measures were taken also in

**Denmark**  
**Luxembourg**



Alert number **[A12/1270/16](#)**



Notifying country **Germany**

Product category **Toys**

Type **Consumer**

Product **Plastic ball**

Brand **Segmüller's Babyland**

Type / number of model **90594**

Batch number **262679800000**

Product description **Plastic green ball with picture of a blue dolphin, 20 cm diameter. The ball is sold without packaging.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic of the ball contains di-isobutyl phthalate (DiBP) (measured value 41% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. The product does not comply with the requirements of the Toy Safety Directive.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Alert number **[A12/1267/16](#)**



Notifying country **France**

Product category **Chemical products**

Type **Consumer**

Product **Descaling solution**

Name **Détartrant forte solution ('Descaler strong solution')**

Brand **PLANET PURE**

Type / number of model **Fraîcheur Limette & Menthe**

Batch number **9120001460076 - 2015; 16.01.150**

Product description **Lemon fresh and mint' descaling solution in 510 ml spray container.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product is highly corrosive due to its high acidity (pH 1.7) and can cause skin burns or lesions. Since it lacks important safety information and warnings, the user has no information on the dangers incurred when the product comes into contact with the skin. The product does not comply with Regulation (EC) No. 1272/2008 on classification, labelling and packaging of substances and mixtures and with Regulation (EC) No. 648/2004 on detergents.**

Country of origin **Austria**

Measures taken by economic **Recall of the product from end users**

operators **Distributor**

Date of entry into force **22/06/2016**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Date of entry into force **22/06/2016**

Alert number **[A12/1214/16](#)**



Notifying country **Sweden**

Product category **Jewellery**

Type **Consumer**

Product **Bracelet**

Brand **Lo-ika**

Product description **Bracelet with yellow and silver coloured metal beads.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The amount of nickel released by the metal in the bracelet beads is too high (measured values up to 1.8 µg/cm<sup>2</sup>/week). Nickel is a strong sensitizer and can cause allergic reactions if present in articles that come into direct and prolonged contact with the skin. The product does not comply with the REACH Regulation.**

Country of origin **Thailand**

Measures taken by economic operators **Withdrawal of the product from the market  
Importer**

Alert number

**A12/1213/16**



Notifying country **Sweden**

Product category **Cosmetics**

Type **Consumer**

Product **Sunscreen product**

Name **Sun oil**

Brand **Acorelle**

Type / number of model **Ref 4602**

Batch number **8511L7301  
EAN code: 3700343046020  
Expire date 12/2017**

Product description **Sun oil packaged in a brown bottle with a white label. The product information is printed in white and orange. The bottle contains 75 ml.**

Risk type **Health risk / other**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**According to the ingredients list, this sunscreen product does not contain any of the UV filters listed in the Cosmetic products regulation, while sun protection can only be obtained by these UV filters. Instead, the product use karanja oil as a UV filter and the product is marketed as "sun oil high protection SPF 30" and "Sun oil effectively protects the skin from the harmful effects of UVA and UVB rays". A sunscreen product without any of the allowed UV filters presents a potential health risk when it comes to the effects of UVB and UVA radiation. According to the Commission recommendation on the efficacy of sunscreen products and the claims made relating thereto**

**(2006/647/EC) sunscreen products need to protect against both UVB and UVA radiation in order to prevent sunburn and the damage linked to photo-ageing and induced photoimmunosuppression.**

Country of origin	<b>France</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Distributor</b>
Date of entry into force	<b>01/06/2016</b>
Measures taken by economic operators	<b>Withdrawal of the product from the market Retailer</b>
Date of entry into force	<b>30/05/2016</b>
Products were found and measures were taken also in	<b>Portugal</b>

Alert number

**[A12/1271/16](#)**



Notifying country **Germany**

Product category **Toys**

Type **Consumer**

Product **Wooden toy**

Name **Geburtstagskerze**

Brand **Bino**

Type / number of model **9981062**

Batch number **4019359810624**

Product description **Multicoloured, animal-shaped, wooden toy on four wheels. A candle holder is affixed to the animal's back.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Small parts can easily detach from the toy. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Ban on the marketing of the product and any accompanying measures  
Other**

Date of entry into force **15/08/2016**

Products were found and  
measures were taken also in

**Slovenia**

Alert number

**A12/1215/16**



Notifying country

**Finland**

Product category

**Hobby/sports equipment**

Type

**Consumer**

Product

**Radio controlled car**

Name

**RTR Super Sport**

Brand

**WaveRunner**

Type / number of model

**Battery charger: LJ-1000800D  
Car:L959 2.4G**

Product description

**Radio controlled car supplied with a battery charger ("AC/DC Adapter"). Sold in a cardboard box.**

Risk type

**Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The creepage distance between the live primary circuit and the accessible secondary circuit of the transformer of the battery charger is not sufficient. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Country of origin

**People's Republic of China**

Measures ordered by public authorities

**Withdrawal of the product from the market  
Other**

Date of entry into force

**11/08/2016**

Measures ordered by public

**Recall of the product from end users**

authorities

**Other**


Date of entry into force

**11/08/2016**

Products were found and  
measures were taken also in

**Denmark**

Alert number **[A12/1216/16](#)**

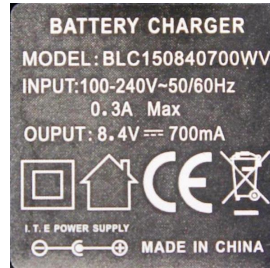

Notifying country **Finland**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Heated gloves**

Name **Electronic Thermal Gloves**

Brand **Nevercold**

Type / number of model **Battery charger: BLC 150840700WV  
Gloves: Ontario**

Batch number **6430038643612**

Product description **Heated gloves supplied with a battery charger. Sold in a transparent package.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The creepage distance between the live primary circuit and the accessible secondary circuit of the transformer of the battery charger is not sufficient. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Recall of the product from end users  
Other**

Date of entry into force **24/03/2016**


Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

Date of entry into force

**24/03/2016**

Alert number **[A12/1217/16](#)**

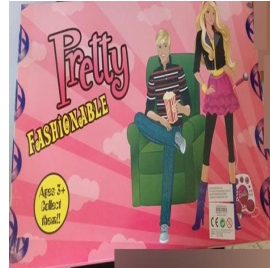

Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Pretty Fashionable**

Brand **Unknown**

Type / number of model **802-4**

Batch number **60801425**

Product description **Plastic doll with accessories supplied in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 39.4% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **30/08/2016**

Alert number **[A12/1245/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Professional**

Product **Mobile crane/Special vehicle**

Name **ATF**

Brand **Tadano Faun**

EC-type approval/model **Type: TF02, TF03, TF04, TF05, TF06 Authorisation No: TF04: e1 \* 2007/46 \* 1431 \* and individual approval; TF05: e1 \* 2007/46 \* 1598 \* and individual approval; TF02, TF03 AND TF06: individual approval**

Production dates **The vehicles concerned were manufactured between 2013 and 2015.**

Product description **Mobile crane**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There is a possibility that the pneumatic connecting lines are not attached properly and could detach themselves. The detachment of the lines could lead to a loss of pressure in the braking system, which could result in reduced braking performance and/or unintentional braking.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **The Netherlands  
Sweden**

Alert number **[A12/1248/16](#)**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Electric heater**

Brand **JOCEL**

Type / number of model **RH06**

Batch number **5601774012586**

Product description **White electric heater, with a carrying handle. The product is supplied in a black cardboard box.**

Risk type **Electric shock  
Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product is not adequately earthed. This may cause an electric shock. In addition, the product is not sufficiently stable and may overheat: if it overturns at high temperatures, it may cause a fire. The product does not comply with the requirements of the Low Voltage Directive and the relevant European Standard EN 60335.**



Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **03/08/2016**

Alert number

**[A12/1246/16](#)**

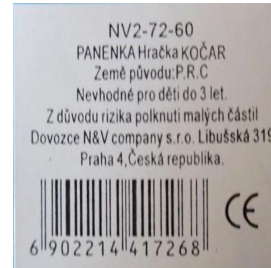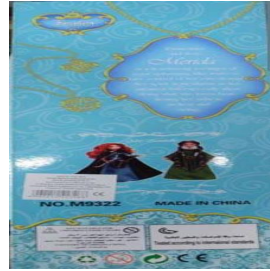

Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Fashion Princess Merida**

Brand **Unknown**

Is the product counterfeit? **Counterfeit**

Type / number of model **NO.M9322**

Batch number **6902214417268  
NV2-72-60**

Product description **Plastic doll with red hair, supplied in cardboard box with transparent window.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of the doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 34 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles**

Country of origin **People's Republic of China**

Measures ordered by public **Withdrawal of the product from the market**

authorities

**Other**

Date of entry into force

**06/09/2016**

Alert number **[A12/1268/16](#)**



Notifying country	<b>Germany</b>
Product category	<b>Clothing, textiles and fashion items</b>
Type	<b>Consumer</b>
Product	<b>Baby shoes</b>
Name	<b>Baby Lauflernschuhe (First-walker shoes for babies)</b>
Brand	<b>HSM Schuhmarketing</b>
Type / number of model	<b>EDM-Nr. 2586882009</b>
Batch number	<b>4039653435767 (size 18/19); 4039653435804 (size 20/21); 4039653435842 (size 22/23)</b>
Product description	<b>2 pairs of baby shoes in beige with a blue dog's head and a blue edge; sample size 18/19.</b>
Risk type	<b>Chemical</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The amount of Chromium (VI) in the leather is too high (measured value up to 30.2 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.</b>
Country of origin	<b>People's Republic of China</b>
Measures taken by economic operators	<b>Recall of the product from end users Importer</b>
Date of entry into force	<b>12/09/2016</b>

Measures taken by economic operators

**Destruction of the product  
Importer**

Date of entry into force

**12/09/2016**



Alert number **[A12/1212/16](#)**



Notifying country **Spain**

Product category **Lighting equipment**

Type **Consumer**

Product **Lampholder**

Name **Portalamparas Blanco**

Brand **Munchina**

Type / number of model **LH04, ref. 70020**

Batch number **8435322700208**

Product description **Black / white lampholder.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **When a lamp is inserted, the live lamp cap is accessible. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60238.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **18/05/2016**

Alert number **[A12/1218/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic doll set with accessories**

Name **Pretty-Fashion Trend Girl**

Brand **Unknown**

Type / number of model **No: Q22F**

Batch number **60801630**

Product description **Two plastic dolls (woman and man) with accessories in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The dolls' heads contain bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 32.32 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number **[A12/1219/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Toy cooking set**

Name **Cooking Playset**

Brand **XIE CHENG TOYS**

Type / number of model **Item no. 610**

Batch number **60803429**

Product description **Toy cooking set supplied in plastic bag with zipper.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic packing bag contains di-(2-ethylhexyl) phthalate (DEHP) (measured value: 15.5% by weight) and di-butyl phthalate (DBP) (measured value: 3.8% by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **30/08/2016**



Alert number **[A12/1247/16](#)**

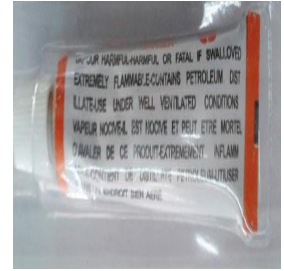

Notifying country **Spain**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Bicycle repair kit**

Name **BIKE REPAIR KIT / RED SUN (glue)**

Brand **FEIYUE TOOL**

Type / number of model **Ref. 10139 and 600206 (with Red Sun glue)**

Batch number **6900101301058  
8433878101395**

Product description **Puncture repair kit containing various items: spanners, patches, a tube of RED SUN glue, etc. The product is packaged in a sealed cardboard blister pack.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product contains chloroform (measured concentration: 2 % by weight) and methylene chloride (measured concentration: 46 % by weight), both substances are suspected of causing cancer. The product lacks warnings and pictograms needed to inform consumers on how to use the product safely. Consumers using the glue may inhale or ingest it or it may accidentally come into contact with their skin causing skin irritation or health damage. The product does not comply with the REACH regulation.**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

Date of entry into force

**14/03/2016**

Alert number **[A12/1210/16](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Fancy-dress costume**

Name **DISFRAZ (CHICA) ('Girls' costume')**

Brand **EM Home**

Type / number of model **ref. 9993285**

Batch number **8435340632857**

Product description **Shepherdess fancy-dress costume consisting of a white blouse, black bodice decorated with red ribbons, a red dress decorated with black ribbons and a headscarf. The packaging is a transparent plastic bag sealed at the top by a cardboard strip.**

Risk type **Burns**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The headscarf is highly flammable and can cause burns if it catches fire. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-2.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number **[A12/1220/16](#)**



Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' dress**

Brand **MONNALISA**

Type / number of model **7604**

Batch number **117924 / 9999990067579**

Product description **White dress with flower print, for girls of 4 years. The garment has functional cords in the neck area to be tied at the back.**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The functional cords with free ends at the back of the dress can become trapped during various activities of a child, leading to strangulation. The product does not comply with the relevant European standard EN 14682.**


Country of origin **Italy**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Products were found and measures were taken also in **France  
Greece  
Italy**

Alert number

**[A12/1221/16](#)**

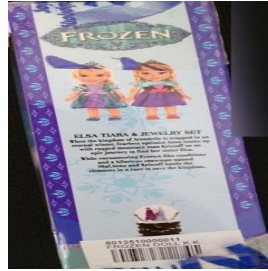

Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Frozen**

Brand **Unknown**

Is the product counterfeit? **Counterfeit**

Batch number **8013510000011**

Product description **Plastic doll in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The head of the doll contains 38 % by weight of bis (2-ethylhexyl) phthalate (DEHP) and 0.76% by weight of di-‘isononyl’ phthalate (DINP). DEHP may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles articles which can be placed in the mouth by children.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number **[A12/1222/16](#)**



Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' bikini**

Brand **Hello Bikini**

Type / number of model **L3812**

Product description **Fuchsia bikini for girls of 6 years. The two-part garment has cords to be tied at the back of the garment.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cords with free ends at the back of the bikini can become trapped during various activities of a child, leading to injury. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number

**A12/1223/16**



Notifying country **United Kingdom**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Travel plug adaptor**

Name **Universal Travel Adaptor**

Brand **Bitmore**

Type / number of model **BM-UTA**

Batch number **5 060275 390836**

Product description **Travel plug adaptor with USB outputs. Packaged in printed cardboard box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **It is possible for two sets of plug pins to be open at the same time and for electrical continuity to exist between them. In this case, if one set of pins is plugged into a mains socket, the other set of pins will be live and accessible to the user. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60950.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Importer**

Alert number **[A12/1224/16](#)**



Notifying country	<b>Spain</b>
Product category	<b>Toys</b>
Type	<b>Consumer</b>
Product	<b>Body paints</b>
Name	<b>Tattoo Gel Pens</b>
Brand	<b>Pampy</b>
Type / number of model	<b>314731</b>
Batch number	<b>8430173147318</b>
Product description	<b>Body paints in six colours.</b>
Risk type	<b>Microbiological</b>
Risk description	<b>The product is contaminated by moulds and yeasts (concentration 27000 cfu/g).</b>
Legal provisions (at EU level) and European standards against which the product was tested and did not comply	<b>The product does not comply with the requirements of the Toy Safety Directive.</b>
Country of origin	<b>People's Republic of China</b>
Measures ordered by public authorities	<b>Withdrawal of the product from the market Other</b>



Alert number

**A12/1225/16**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **my HORSE**

Brand **Unknown**

Type / number of model **NO.3908**

Batch number **6991207442219**

Product description **Plastic doll with a toy horse, supplied in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The head, the legs and the hands of the doll contain di-(2-ethylhexyl) phthalate (DEHP) (measured values up to 32.4% by weight) and the head also contains di-butyl phthalate (DBP) (measured value: 0.2% by weight). These phthalates may harm the health of children causing possible damage to the reproductive system. In addition they also contain di-'isononyl' phthalate (DINP) (measured values: up to 12.3 % by weight). Finally, the head of the doll contains also diisodecyl phthalate (DIDP) (measured value: 0.18% by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles that can be placed in the mouth by children.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Other**

Date of entry into force

**30/08/2016**

Alert number **[A12/1226/16](#)**

Notifying country **Spain**

Product category **Motor vehicles**

Type **Consumer**

Product **Van**

Name **Primastar**

Brand **Nissan**

EC-type approval/model **Primastar (X83)**

Production dates **Vehicles manufactured between 25 September 2012 and 14 December 2013.**

Product description **Van**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **There may be cracks in the metallic structure of the steering wheel and as a consequence the structural resistance of the steering wheel may be compromised. The steering wheel could break and become detached from the steering column, resulting in a loss of steering control.**

Country of origin **France**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Date of entry into force **18/08/2016**

Products were found and measures were taken also in **Germany  
Denmark  
Finland  
Ireland  
The Netherlands  
Norway  
Sweden**

Alert number **[A12/1242/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Toy gun set**

Name **Shoot**

Brand **Super Gun**

Type / number of model **Item number: 811405**

Batch number **5899108114055**

Product description **Toy gun set which includes four plastic darts with suction cups.**

Risk type **Choking**


Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The suction cup of the dart can easily detach. If a child puts the dart in the mouth, the suction cup can detach leaving the airways obstructed by the suction cup. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **25/07/2016**

Alert number **[A12/1227/16](#)**

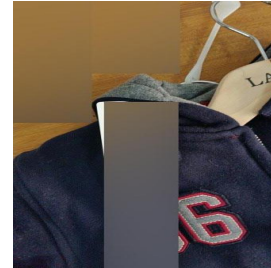

Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Clothing set**

Brand **Legendary Riders Cavaliere**

Type / number of model **6267265.200.3A**

Batch number **5290561821601**

Product description **Boys' clothing set consisting of a blue sweater and grey trousers. Size 3 years. The sweatshirt has a hood with drawstrings.**

Risk type **Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The drawstrings in the hood can become trapped during various activities of the child, leading to strangulation. The product does not comply with the relevant European standard EN 14682.**


Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **13/09/2016**

Products were found and **Greece**

measures were taken also in

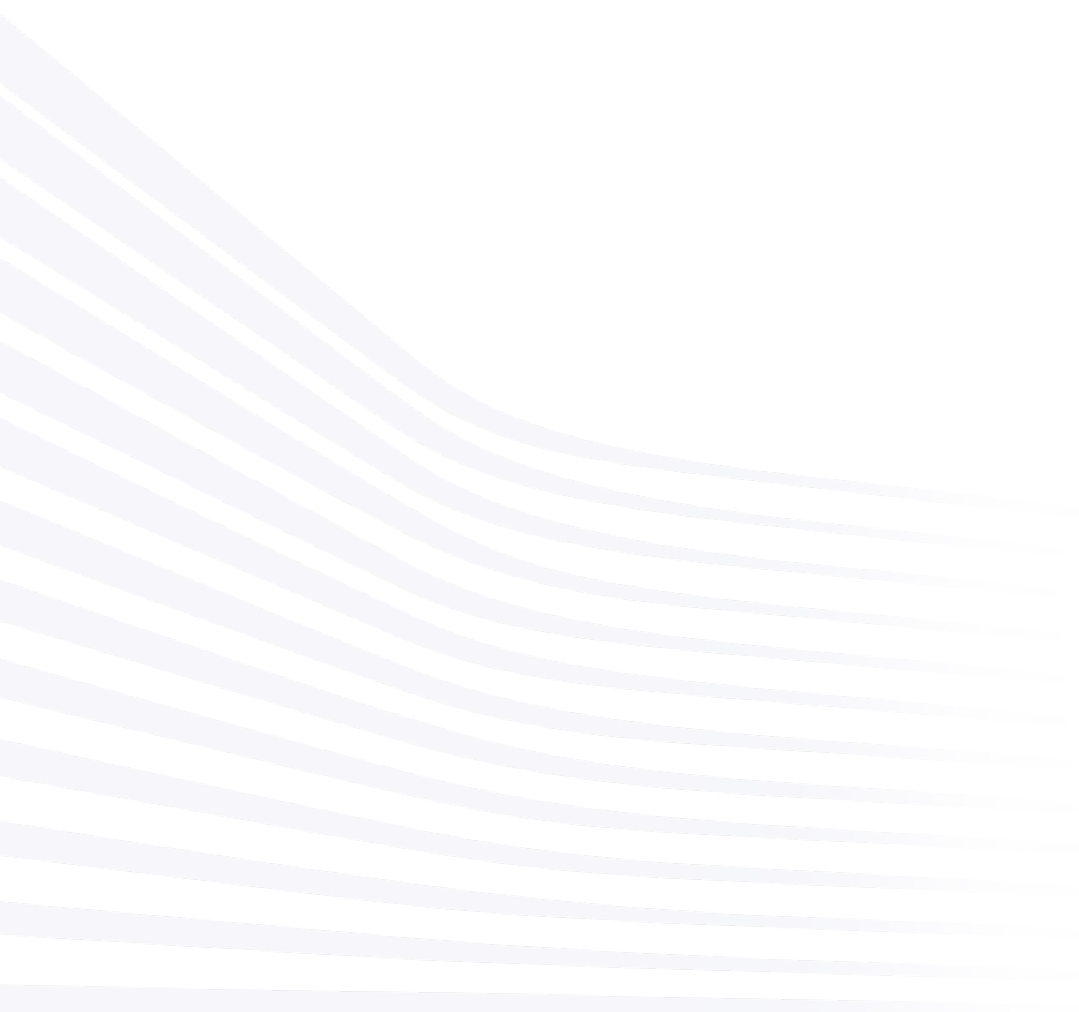

Alert number **[A12/1228/16](#)**

Notifying country **Poland**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Grand Cherokee, Durango**

Brand **Jeep, Dodge**

Production dates **Vehicles affected were manufactured in 2011 and 2012.**

Product description **Passenger car**

Risk type **Fire**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**A short circuit in the wiring of a lamp installed in the sunvisor may cause a fire.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Products were found and measures were taken also in **Bulgaria  
Germany  
Denmark  
Finland  
Greece  
Croatia  
Ireland  
The Netherlands  
Norway  
Portugal  
Sweden  
Slovenia  
Slovakia**

Alert number **[A12/1229/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic dolls**

Name **HAPPY POP**

Brand **Unknown**

Type / number of model **NO.S4**

Batch number **4991207628088**

Product description **Two plastic dolls with accessories in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The plastic material of the dolls contains bis (2-ethylhexyl) phthalate (DEHP) (measured value up to 39.3% by weight) and di-butyl phthalate (DBP) (measured value up to: 1.9%). These phthalates may harm the health of children, causing possible damage to the reproductive system. The product also contains diisodecyl phthalate (DIDP) (measured value up to: 1.9%) and di-'isononyl' phthalate (DINP) (measured value up to: 1.5%). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles that can be placed in the mouth by children.**

Country of origin **People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market**  
**Other**

Date of entry into force

**30/08/2016**

Alert number

**A12/1230/16**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic educational toy**

Name **Happy Shrimp**

Brand **Funny Toys**

Type / number of model **No.3192/5088B**

Batch number **7100201111710**


Product description **Plastic toy helicopter in the shape of a shrimp with 4 plastic animal figures to be inserted; battery-operated emitting sounds and lights.**

Risk type **Choking**


Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy can easily break, generating small parts. Also the plastic figures are small parts. Small children may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

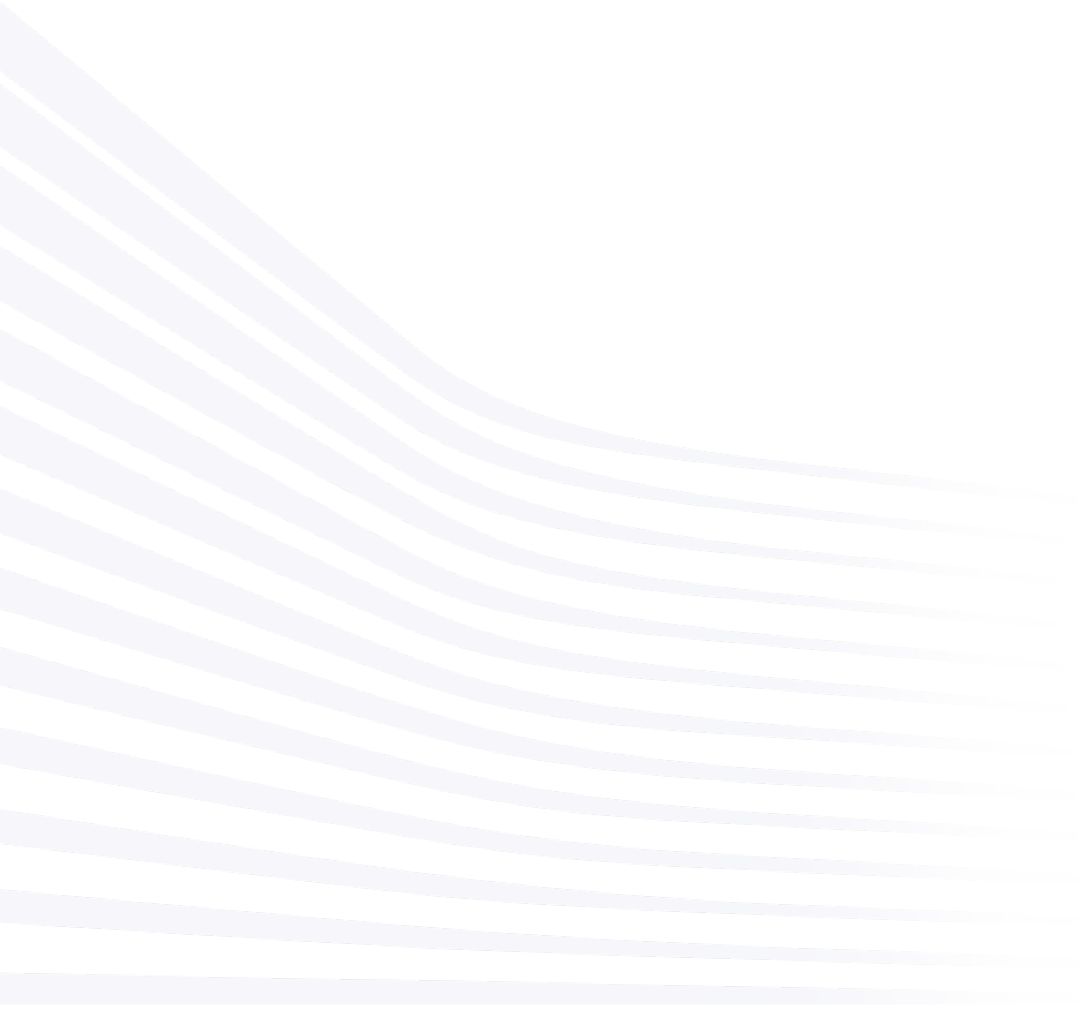

Alert number **[A12/1231/16](#)**

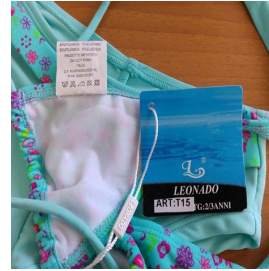

Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' bikini**

Brand **Leonado**

Type / number of model **T15**

Product description **Blue bikini for girls of 2 and 3 years. The two-part garment has halter neck cords and cords to be tied at the back.**

Risk type **Injuries  
Strangulation**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cords with free ends at the back and in the neck area of the bikini can become trapped during various activities of a child, leading to injuries or strangulation. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number

**A12/1232/16**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Plastic dolls**

Name **Mexie girls**

Brand **Unknown**

Is the product counterfeit? **Counterfeit**

Type / number of model **NO.1109**

Batch number **6991202703728**

Product description **Two plastic dolls with accessories, supplied in a cardboard box.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The head, the hands and the legs of the doll with brown hair contain di-(2-ethylhexyl) phthalate (DEHP) (measured values up to: 41.6% by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. They also contain di-'isononyl' phthalate (DINP) (measured values up to: 0.8% by weight). According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles and the phthalates DINP, DIDP and DNOP are prohibited in all toys and childcare articles that can be placed in the mouth by children.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Withdrawal of the product from the market  
Other**

Date of entry into force

**30/08/2016**

Alert number **[A12/1233/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Toy pushchair with doll**

Name **Baby Toy**

Brand **Warmbaby**

Type / number of model **T05022**

Batch number **8675410039586**

Product description **Toy set with a doll and a pushchair supplied in a transparent bag.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The pushchair has only one safety lock and may easily collapse. Children's finger may become trapped between moving parts, causing injuries. The product does not comply with the requirements of the Toy Safety Directive and with the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **25/07/2016**

Alert number

**A12/1234/16**



Notifying country **Spain**

Product category **Chemical products**

Type **Consumer**

Product **Cleaning gel**

Name **Gel Líquido**

Brand **MISTER POMEZ**

Type / number of model **1 litro**

Batch number **8412716210017**

Product description **Liquid cleaning gel. The product is sold in a white opaque container with blue screw cap. A blue label is attached to the product.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The product is corrosive. As the tactile warning of danger, required for these kind of preparations, and the name of the substances as well as the precautionary statements are not indicated, the consumer has no information on a safe use of the product and the dangers incurred when the product comes into contact with the skin or if it is ingested. The product does not comply with Regulation (EC) No 648/2004 on detergents.**

Country of origin **Spain**

Measures ordered by public **Withdrawal of the product from the market**

authorities

**Other**

Date of entry into force

**12/04/2016**

Alert number **[A12/1235/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Toy pushchair**

Name **Baby Stroller**

Brand **One Six Eight**

Type / number of model **7821**

Batch number **8675413033574**

Product description **Toy pushchair for dolls, supplied in a plastic bag with a cardboard label on top.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The pushchair has only one safety lock and may easily collapse. Children's finger may become trapped between moving parts, causing injuries. The product does not comply with the Toy Safety Directive and with the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **25/07/2016**

Alert number **[A11/0089/16](#)**



Notifying country **Slovenia**

Product category **Hobby/sports equipment**

Type **Consumer**

Product **Repair kit**

Name **Schlauchboot-Reparatur-Set (Repair kit for inflatable boat)**

Brand **SEILFLECHTER**

Type / number of model **577566**

Batch number **3838556 564571**

Product description **Repair kit for boats in an orange plastic container, including glue, sand paper and patches.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The glue contains toluene above the permitted level (measured value: 29.8% by weight). The product does not comply with the REACH Regulation.**

Country of origin **Germany**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **26/07/2016**

Alert number **[A12/1211/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Professional**

Product **Bus**

Name **S 431 DT, S 511 HD, S 515 MD, S 515 HD, S 516 MD, S 516 HD/2, S 516 HD, S 517 HD, S 515 HDH, S 516 H**

Brand **Evobus**

EC-type approval/model **EC type-approval: e1\*2007/46\*0013, e1\*2007/46\*1133, e1\*2007/46\*1160, e1\*2007/46\*1569, e1\*2007/46\*0087, e1\*2007/46\*0090, e1\*2007/46\*0036, e1\*2007/46\*0037, e1\*2007/46\*0024, e1\*2007/46\*0025, e1\*20.....**

Production dates **The vehicles concerned were manufactured between July and August 2016.**

Product description **Bus**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **A leak may arise near the pressure sensor in the axle modulators, proportional relay valves and trailer control valves from the firm WABCO due to the loosening of the connection between pressure sensor and support. As a result, braking pressure may not be correctly regulated. The braking pressure applied may, under certain conditions, be too high on one side of the rear axle and higher than expected by the driver on the front axle.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Denmark  
Croatia  
The Netherlands  
Norway  
Poland  
Sweden  
Slovenia**

Alert number **[A12/1236/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger cars**

Name **Escalade / Escalade ESV / Corvette / Encore / LaCrosse / Caprice / Silverado / Trax / Spark EV / SS**

Brand **Cadillac / Chevrolet / Buick / GMC**

EC-type approval/model **European models: Cadillac Escalade, Escalade ESV, EC type-approval: e13\*2007/46\*1479\*00, type: K2XX; Chevrolet Corvette, EC type-approval: e13\*KS07/46\*1275\*00, type: Y1BC.**

Production dates **The vehicles concerned were manufactured between 2013 and 2016.**

Product description **Passenger cars.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Due to a software problem, the frontal airbags and seatbelt pretensioners may not deploy correctly, which may increase the risk of injury to occupants in the event of a crash.**

Country of origin **United States**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Finland  
The Netherlands  
Sweden**

Alert number **[A12/1237/16](#)**



Notifying country **Slovenia**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Leather belt**

Brand **Never 2 hot**

Batch number **276841400002**

Product description **Pink leather belt with rivets.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of Chromium (VI) in the leather is too high (measured value: 13 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH regulation.**

Country of origin **Unknown**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **13/09/2016**

Alert number **[A12/1238/16](#)**

Notifying country **Germany**

Product category **Motor vehicles**

Type **Consumer**

Product **Passenger car**

Name **Passat**

Brand **VW**

EC-type approval/model **Type-approval numbers: e1\*2001/116\*0307\*; type: 3C**

Production dates **The vehicles concerned were produced between 27.4.2015 and 14.10.2015.**

Product description **Passenger car**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **It is possible that one or more of the pump pistons in the Electronic Stability Control (ESC) control device may become stuck. A pump piston that becomes stuck leads to diminished pressure build-up/pressure reduction in the hydraulic system. The Electronic Stability Programme's regulating capability is thus restricted.**

Country of origin **Germany**

Measures taken by economic operators **Recall of the product from end users  
Manufacturer**

Products were found and measures were taken also in **Finland  
Croatia  
Norway  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number **[A12/1239/16](#)**



Notifying country **Czechia**

Product category **Toys**

Type **Consumer**

Product **Plastic doll**

Name **Modern Girls, enjoy the living fun!**

Brand **Unknown**

Type / number of model **NO: 0939**

Batch number **ITEM NO: TT2434K30 / EAN: 8592434163175**


Product description **Plastic doll about 25 cm tall packed in a cardboard and plastic packaging**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The head of doll contains di-(2-ethylhexyl) phthalate (DEHP) (measured value 22.7 % by weight). This phthalate may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation, DEHP, DBP and BBP phthalates are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

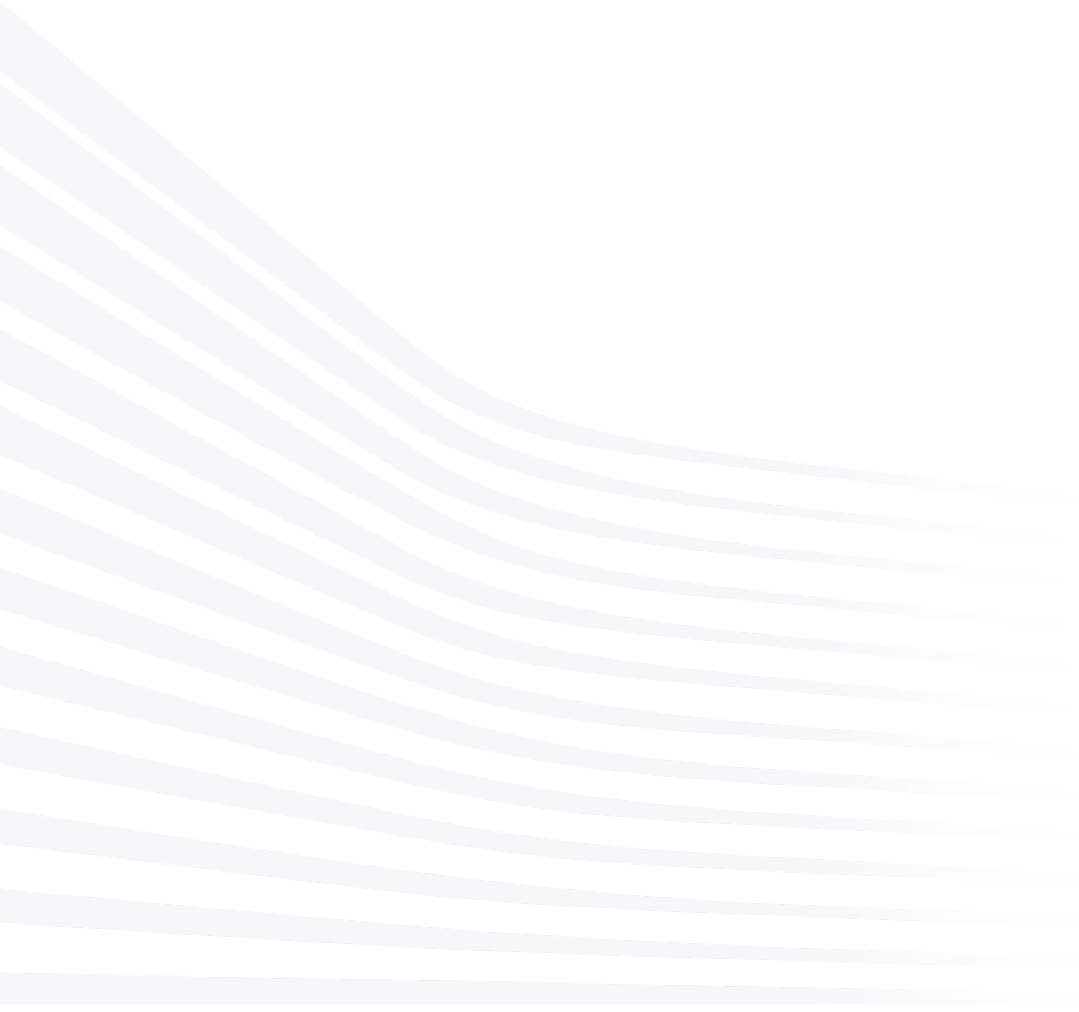

Alert number **[A12/1240/16](#)**

Notifying country **Poland**

Product category **Motor vehicles**

Type **Consumer**

Product **Motorcycle**

Name **MSX, NSS**

Brand **Honda**

EC-type approval/model **Honda MSX125  
Honda NSS300/A FORZA**

Production dates **Honda MSX125 manufactured from 22.02.2013 - 24.09.2015  
Honda NSS300/A FORZA manufactured from 22.02.2013 - 24.09.2015**

Product description **Motorbikes.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The fuel pump's cover made of composite may be deformed because of long-term contact with fuel. The deformation may cause a pump impeller to stop and damage pump's engine, consequently stopping the motorcycle engine with no possibility to to start it. This defect can cause an accident.**

Country of origin **Thailand**

Measures taken by economic operators **Recall of the product from end users  
Distributor**

Products were found and measures were taken also in **Bulgaria  
Denmark  
Finland  
Greece  
Croatia  
Ireland  
Portugal  
Sweden  
Slovenia  
Slovakia  
United Kingdom**

Alert number **[A12/1249/16](#)**



Notifying country **Estonia**

Product category **Toys**

Type **Consumer**

Product **Plastic Doll**

Name **Sparkle Girlz Winter Fairy**

Brand **Sparkle Girlz / Funville**

Type / number of model **Item No 24118**

Batch number **884978241180**

Product description **10cm doll with long blue hair. The toy is supplied in blue cardboard packaging. Packaging size: 12cmx10cm.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The shoes of the doll contain bis-(2-ethylhexyl) phthalate (DEHP) (measured value 0.5% by weight) and dibutylphthalate (DBP) (measured value 12.5% by weight). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Warning consumers of the risks  
Importer**

Date of entry into force **21/09/2016**

Measures taken by economic operators **Withdrawal of the product from the market  
Importer**

Date of entry into force **21/09/2016**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **21/09/2016**

Alert number **[A12/1241/16](#)**



Notifying country **Cyprus**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Girls' bikini**

Brand **YES ! DO KID'S**

Type / number of model **G99670**

Product description **Pink bikini for girls of 7/8 (9/10 on the label) years. The two-part garment has cords to be tied at the back.**

Risk type **Injuries**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The cords with free ends at the back of the bikini can become trapped during various activities of a child, leading to injuries. The product does not comply with the relevant European standard EN 14682.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Alert number **[A12/1243/16](#)**



Notifying country **Cyprus**

Product category **Toys**

Type **Consumer**

Product **Bow and arrow play set**

Name **Toxophily Set**

Brand **King Sport**

Type / number of model **35881A**

Batch number **8013511415173**

Product description **Bow and arrow play set. The arrows have suction cups.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The suction cup of the arrow can easily detach. If a child puts the arrow in the mouth, the suction cup can detach leaving the airways obstructed by the suction cup. The product does not comply with the requirements of the Toy Safety Directive and the relevant European Standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **25/07/2016**

Alert number **[A11/0088/16](#)**



Notifying country **Poland**

Product category **Machinery**

Type **Consumer**

Product **Electric hedge trimmer**

Name **MHTP 710**

Brand **Macallister**

Batch number **CN: 8467298000**

Product description **Electric hedge trimmer.**

Risk type **Burns**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **During use, the engine may break down and sparks may come in contact with the user's hand causing burns to the user's skin. The product does not comply with the requirements of the Machinery Directive.**

Country of origin **People's Republic of China**

Measures taken by economic operators **Withdrawal of the product from the market  
Distributor**

Date of entry into force **20/09/2016**

Products were found and measures were taken also in **France  
Ireland**

Alert number **[A12/1244/16](#)**



Notifying country **Spain**

Product category **Lighting chains**

Type **Consumer**

Product **Lighting chain**

Name **LED 240 Bombillas, Luces de Arbol**

Brand **Ocean**

Type / number of model **LED-ZHK-215**

Batch number **5615000122154**

Product description **Lighting chain with 240 bulbs sold in a plastic box.**

Risk type **Electric shock**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The wiring connecting the flashing unit to the lights is too thin and not strong enough. It could break exposing live parts. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60598.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **13/01/2016**

Alert number **[A12/1265/16](#)**



Notifying country **Slovenia**

Product category **Clothing, textiles and fashion items**

Type **Consumer**

Product **Leather slippers**

Brand **Alenka**

Type / number of model **art. 2021, 37-38**

Product description **Pink leather slippers.**

Risk type **Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The amount of Chromium (VI) in the leather is too high (measured value: 43 mg/kg). Chromium (VI) is sensitising and may trigger allergic reactions. The product does not comply with the REACH Regulation.**

Country of origin **Slovenia**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**

Date of entry into force **14/09/2016**

Alert number **[A12/1250/16](#)**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Wooden toy**

Brand **Ale-hop**

Type / number of model **Reference 692341 (21259).**

Batch number **8432450073785**

Product description **Wooden toy representing a clown, with one string for hanging it up and another to pull, making the clown move its extremities (jumping jack). Description of the packaging: The toy is attached to a cardboard back.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Small parts can be easily detached from the toy (the clown's shoes) and be put in the mouth by small children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard En 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **12/09/2016**

Alert number

**A12/1251/16**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Plastic toy flower and xylophone**

Brand **Inteibi**

Type / number of model **Flower 696111590 (HS0312304) and Xylophone: 696111990 (HS0308539).**

Product description **Two colourful plastic toys : a flower and a xylophone. Description of the packaging: Transparent plastic with a sticker.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **Small parts (the yellow cap on the handle of the flower and the screws from the xylophone) can easily be detached from the toy. A small child may put them in the mouth and choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities


**Import rejected at border  
Other**

Date of entry into force

**12/09/2016**

Alert number

**[A12/1252/16](#)**

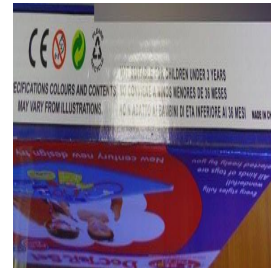

Notifying country

**Estonia**

Product category

**Toys**

Type

**Consumer**

Product

**Doctor play set**

Name

**Doctor play set**

Brand

**Unknown**

Product description

**Doctor play set including a range of medical tools. Packed in a transparent plastic blister and cardboard packaging. Packaging size: 34cm x 26cm.**

Risk type

**Chemical**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply

**The stethoscope tube of doctor play set contains bis (2-ethylhexyl) phthalate (DEHP) and dibutylphthalate (DBP) (measured values: 7.1% by weight and 3.4% respectively). These phthalates may harm the health of children, causing possible damage to the reproductive system. According to the REACH Regulation the phthalates DEHP, DBP and BBP are prohibited in all toys and childcare articles.**

Country of origin

**People's Republic of China**

Measures taken by economic operators

**Warning consumers of the risks  
Importer**

Date of entry into force

**20/09/2016**

Measures taken by economic

**Withdrawal of the product from the market**

operators **Importer**

Date of entry into force **20/09/2016**

Measures taken by economic operators **Recall of the product from end users  
Importer**

Date of entry into force **20/09/2016**

Alert number **[A12/1253/16](#)**



Notifying country **Spain**

Product category **Electrical appliances and equipment**

Type **Consumer**

Product **Mosquito killer lamp**

Name **Lampara Electrica Mata Mosquitos**

Brand **La Bolata**

Type / number of model **ref. 129478**

Batch number **8401294780449**

Product description **Black electrical mosquito killer lamp.**

Risk type **Electric shock**



Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The power cable is not correctly protected against pulling or twisting, the plug is not appropriate, the cross section of the cables is smaller than required and the grille may still be live after the appliance is disconnected. As a result of these defects, the user could touch live parts. The product does not comply with the requirements of the Low Voltage Directive and the relevant European standard EN 60335.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Withdrawal of the product from the market  
Other**



Alert number **[A12/1254/16](#)**

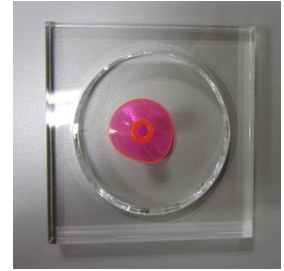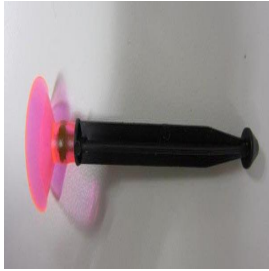

Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Toy gun**

Brand **Inteibi**

Type / number of model **Packaging: 696106190, Invoice: HS0282144.**

Product description **Toy gun with projectiles with suction cups.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The suction cup of the projectiles can easily detach. If a child puts the projectile in the mouth, the suction cup can detach leaving the airways obstructed by it. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin **People's Republic of China**

Measures ordered by public authorities **Import rejected at border  
Other**

Date of entry into force **12/09/2016**

Alert number

**A12/1255/16**



Notifying country **Spain**

Product category **Toys**

Type **Consumer**

Product **Beach toy set**

Name **Beach toys/Set de Playa**

Brand **Inteibi**

Type / number of model **696107890 on invoice: (HS0184910)**

Product description **Yellow beach bucket with orange, green and yellow accessories and moulds, supplied in a net with a label.**

Risk type **Choking**

Legal provisions (at EU level) and European standards against which the product was tested and did not comply **The toy contains small parts (the mould in the shape of a duck) that can be put in the mouth by children, causing them to choke. The product does not comply with the requirements of the Toy Safety Directive and the relevant European standard EN 71-1.**

Country of origin

**People's Republic of China**

Measures ordered by public  
authorities

**Import rejected at border  
Other**

Date of entry into force

**22/09/2016**